

Arboricultural Impact Assessment
For Trees At

Sunniside Farm, Sunniside Lane, Cleadon Hills, Tyne & Wear, NE34 8DY



# For FitzArchitects











# Document Verification

Document Title	<ul> <li>Arboricultural Impact Assessment For Trees At Sunniside Farm, Sunniside Lane, Cleadon Hills, Tyne &amp; Wear, NE34 8DY</li> <li>For FitzArchitects</li> </ul>
Prepared By	• Richard Bryson HNC ND Arb M.Arbor.A
Authorised By	Andrew Watson FLS MICFor CBiol MSB FArborA CEnv LCGI

Origina	II AIA
Issued 28th October 2014	Authorised - A Watson
•	
Revis	sion
•	
Revis	sion
The state of the s	

## **Table of Contents**

		Page	•
1.	Introduction	1	
2.	Protected Status Of Trees	1	
3.	Site Visit & Description	2	
4.	Appraisal	3	
5.	Tree Protection Measures	7	
6.	Conclusion	10	
	Appendices		
1.	Tree Survey		
2.	Glossary of Terms		
3.	Site Plans		
	<ul> <li>Existing Trees Shown On Existing Layout</li> <li>Retained Trees Shown On Proposed Protective Measures Indicated -Tree Protection Plan (TPP)</li> </ul>	Layout	With

## 1. Introduction

- 1.1 We are instructed by FitzArchitects on behalf of Miss A Wallhead and Mr R Nellis to provide an Arboricultural Impact Assessment (AIA) for the significant trees located in a specified area at Sunniside Farm in Cleadon Hills.
- 1.2 This report is produced to evaluate the proposed conversion of the existing out buildings into residential units and the addition of a new access driveway. The developments juxtaposition with the existing trees is considered.
- 1.3 We were provided with the following documents:
- Existing plan in digital AutoCAD format
- Proposed development plans in digital AutoCAD format
- 1.4 This assessment is concerned with recording the species, size and condition of the trees. Recommendations are made where appropriate to establish acceptable levels of safety for the site and also to establish a higher level of arboricultural management.
- 1.5 The trees are also evaluated for the purposes of British Standard 5837–2012 Trees in relation to design, demolition & construction, with regard to their quality and value. The type and size of the root protection area is calculated and the position of the protective barriers is determined. The remaining contribution or safe useful life expectancy is estimated as an indication of the trees period of retention.
- 1.6 All observations were from ground level without detailed investigation.
- 1.7 Trees are living organisms whose health and condition may change rapidly and all observations are based on the status of the tree at the time of inspection.

#### 2. Protected Status Of Trees

- 2.1 Trees may be legally protected, this may either be in the form of a Tree Preservation Order (TPO) or that the trees are located within a Conservation area.
- 2.2 Potentially large penalties may be enforced for illegally carrying out works on protected trees. It is recommended that checks are made before any works are undertaken and no work should commence until permission

has been granted. Please note that there are a number of exemptions from the requirement to obtain a felling licence including land on which <u>full</u> planning permission has been granted by the local authority, however this exemption does not cover land where only outline planning permission has been granted, or on land which has been allocated for residential development within local authority urban and local development plans.

2.3 AllAboutTrees has been able to ascertain with South Tyneside Council (the Local Planning Authority) on Monday 6<sup>th</sup> October 2014 that there are restrictions protecting the trees on the site. The site is within the 'Cleadon Pumping Station Conservation Area' and the trees are also protected by virtue of a TPO, TPO 62.

## 3. Site Visit & Description

Site location – N 54° 57' 50.22 W 01° 23' 52.55 O/S Grid reference- NZ 386 634 GB Grid



Figure 1 - The study area is indicated by the red boundary line as shown on the above image.

- 3.1 A site visit was undertaken on Thursday 23rd October 2014 by Richard Bryson. The weather was fine with no visibility constraints.
- 3.2 The study area consists of the specified area around the existing buildings at Sunniside Farm.

- 3.3 Access is via a private gateway which leads to a courtyard. This is surrounded by stables and outbuildings.
- 3.4 The outbuildings appear to be predominantly used for equestrian activities.
- 3.5 To the west and north of the buildings are paddocks. To the south is a training arena.
- 3.6 There were no apparent drainage problems.

#### 4. Appraisal

- 4.1 The trees have been surveyed on site and plotted on the site plan. Their positions are considered accurate given the provision of a detailed topographical survey. Some trees however were missed during the land survey and the positions of these have been determined using laser distometers and triangulation calculations.
- 4.2 All significant trees have been inspected and some of the smaller specimens have been included for accuracy. Individual recommendations are included within Appendix 1 of this report.

#### 4.3 **Root Protection Areas (RPAs)**

- 4.3.1 The British Standard Root Protection Areas (RPAs) are indicated by the red circles surrounding the trunk position of the trees on the associated plans. These indicative circles do not take into consideration site specific conditions such as the presence of buildings, roads, footpaths, topography, underground utility services etc. and are representative of typical root morphology where said structures are not encountered. For this reason in certain areas of the site the RPAs of several trees have been modified to take account of these structures and conditions, the Predicted Site Specific Root Protection Area is shown on the associated plans as a cyan polyline. In parts of the site retaining features will have restricted root spread. The above applies to:
- Trees 1-12

#### 4.4 **Tree Removals**

4.4.1 It will be necessary to remove some of the existing trees to facilitate the proposed development and to establish a higher level of arboricultural management for the site.

- Tree 11 will need to be removed to facilitate construction access for the refurbishment of the outbuilding.
- Trees 1-3 and group 1 should be removed as part of the overall site management. All are situated in inappropriate locations and are likely to damage the adjacent structures as they mature.
- 4.4.2 A breakdown of recommended removals, alongside their BS5837 category rating is provided in the table below. For further information regarding the BS5837 quality categorisation system please refer to Appendix 2 (II).

Tree Category Rating	Remove To Facilitate The Development	Remove Due To Structural Defects, Limited Safe Useful Life Expectancy, Site Management	Trees Identified For Removal, Both To Facilitate The Development And Due To Impaired Condition
A – High	-	-	-
B – Moderate	-	-	-
C – Low	-	2, 3	-
U – Unsuitable For Retention	-	1	11

4.4.3 To mitigate the above removals new planting should take place throughout the site. Careful consideration should be given to all new planting positions to ensure the trees can grow fully into maturity without requiring major or regular pruning works. New specimens should not be positioned in close proximity to buildings, windows or utility services.

#### 4.5 Retained Trees

- 4.5.1 Protective barriers as per section 5.1 of this report should be erected in the position indicated by the blue line on the Tree Protection Plan (TPP) prior to any works on site. Signs should also be attached stating that the area is a protected zone and should not be entered.
- 4.5.2 There are several level changes and retaining structures adjacent to the surveyed trees. These will effectively protect the trees during the construction phase and any arboricultural impact will be minimal. High sided construction machines should not operated beneath the canopies of any retained trees.

#### 4.6 Ground Levels

4.6.1 There should be no alteration of the ground level within the RPA of any retained tree. This includes the lowering of the ground level via the

excavation of existing material or the raising of the ground level via the importation of additional material.

- 4.6.2 Lowering of the ground level results in the inevitable severance of roots. As the majority of feeding roots are located towards the surface of the soil, lowering the ground level by even a few centimetres can have a drastic effect on the trees physiological health, greatly limiting the trees ability to uptake nutrients. A more significant reduction in ground level is likely to sever larger supporting roots resulting in immediate loss of structural integrity, predisposing the tree to failure.
- 4.6.3 Raising the ground level encourages anaerobic conditions, resulting in reduced gaseous exchange, a necessary part of the respiration process. Water penetration to the underlying root system is also limited. The roots are slowly suffocated leading to decline. Symptoms are likely to include wilting foliage, poor shoot elongation, late bud break, early leaf abscission, crown thinness, followed by dieback and eventually death.

#### 4.7 Wildlife Habitats

4.7.1 As part of the survey the significant trees were inspected from ground level with the use of binoculars for signs of wildlife habitation, in particular birds and bats.

#### **Bats**

- 4.7.2 All UK bats and their roosts are protected by law. The legislation protecting bats are:
- The Wildlife & Countryside Act 1981 (WCA)
- Conservation of Habitats and Species Regulations 2010
- 4.7.3 For all countries of the UK, the legal protection for bats and their roosts may be summarised as follows:

You will be committing a criminal offence if you:

- 1. Deliberately\* capture, injure or kill a bat
- 2. Intentionally or recklessly disturb a bat in its roost or deliberately disturb a group of bats
- 3. Damage or destroy a bat roosting place (even if bats are not occupying the roost at the time)
- 4. Possess or advertise/sell/exchange a bat (dead or alive) or any part of a bat
- 5. Intentionally or recklessly obstruct access to a bat roost

\*In a court, 'deliberately' will probably be interpreted as someone who, although not intending to capture/injure or kill a bat, performed the relevant action, being sufficiently informed and aware of the consequence his/her action will most likely have.)

- 4.7.4 Penalties on conviction the maximum fine is £5,000 per incident or per bat (some roosts contain several hundred bats), up to six months in prison, and forfeiture of items used to commit the offence, e.g. vehicles, plant, machinery.
- 4.7.5 When carrying out tree works it is essential that the contractor or other competent person carriers out a specific 'bats in trees risk assessment' which can be obtained from the 'Arboricultural Association' or the 'Bat Conservation Trust' (BCT). If evidence of bats is found work must stop immediately and Natural England Batline contacted (0845 1300 228). A further inspection may well be required by a licensed bat handler or roost visitor.

#### **Birds**

- 4.7.6 In the UK, all wild birds, their nests and their eggs are protected by law.
- 4.7.7 In England, Scotland and Wales the legislation that protects wild birds is:
- The Wildlife and Countryside Act 1981
- The Countryside (or CRoW) Act 2000
- 4.7.8 As with bats the contractor has an obligation to carry out visual checks prior to works. Where possible tree works should be carried out in the period from August to the end of February in order to avoid the bird nesting season.

#### 5. Tree Protection Measures

#### 5.1 Root Protection Area & Barrier Specification

- 5.1.1 Trees on development sites are prone to damage during the course of demolition and construction works. Retained trees need to be protected in line with British Standard 5837–2012 Trees in relation to design, demolition & construction.
- 5.1.2 This usually involves identifying a construction exclusion zone around the tree which should remain undisturbed with appropriate protective barriers preventing access to this Root Protection Area for the duration of the project.
- 5.1.3 The minimum root protection areas (measured in a radius from the centre of the tree to the protective barrier) are outlined for each individual tree and the barrier layout is indicated on the plan.
- 5.1.4 The exact root spread of an individual tree is difficult to quantify, but in general, the bulk of a trees roots are situated in the upper 600mm of the soil with the finer absorbing roots prevalent in the upper 250mm.
- 5.1.5 Dependant on soil conditions and the species of the tree, the root plate may extend radially for distances in excess of the height of the tree.
- 5.1.6 In the case of development sites, the root protection area is designed to prevent any significant long term damage to the tree by protecting the root plate and to some extent the lower branches of the tree.
- 5.1.7 The barriers should be erected prior to work commencing on site and should remain until construction activities have been completed. The root protection area should be considered essential and should not be removed or altered without prior recommendation by an Arboriculturalist and approval of the local planning authority.
- 5.1.8 The barrier should consist of a vertical and horizontal framework of scaffold tubing which is adequately braced to resist impacts. The vertical scaffold tubes need to be placed at a distance not exceeding 3m apart and driven securely into the ground for a minimum depth of 0.6m. Care should be taken when locating the vertical poles to avoid underground services and, in the case of the bracing poles, also to avoid any structural roots. The weldmesh or Heras panels need to be a minimum 2.0m tall and are securely attached to the scaffold framework with wire or scaffold clamps. The wire or scaffold clamps should be secured on the inside of the barrier to avoid easy dismantling. Panels on rubber or concrete feet are not resistant to impact and should not be used.

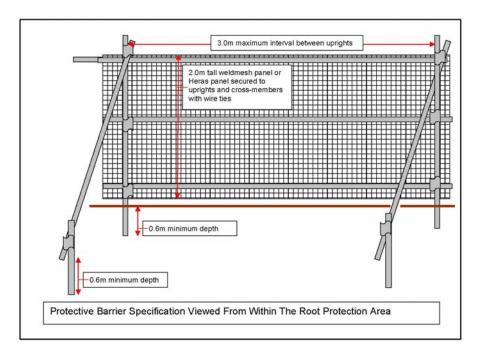


Figure 2- Protective barrier specification



Figure 3- Protective barrier as it should be erected on site

- 5.1.9 No fixing shall be made to any tree and all possible care must be taken to prevent damage to tree roots when locating the posts.
- 5.1.10 All types of barriers must be firmly attached to prevent movement by site personnel or vehicles and all weather signs with the wording "Construction exclusion zone- keep out" should be attached.

#### 5.2 Service Runs

- 5.2.1 It is assumed that the existing service runs will be exploited where possible, but if new works are required it is important that they comply with the National Joint Utilities Group (NJUG) 'Guidelines for the planning, installation, and maintenance of utility services in proximity to trees' and BS 5837:2012. The excavation of open trenches by machine will be unacceptable within the protective zone of any of the retained trees.
- 5.2.2 Acceptable techniques (fuller details in the appendices) for the laying of services in order of preference are:
- Trenchless- by using thrust boring or similar techniques
- · Broken Trench- to be dug by hand
- Continuous trench- to be dug by hand
- 5.2.3 Wherever possible, services should be routed outside of any retained trees RPA. When this is not possible apparatus should be routed together in a common duct and any inspection chambers sited outside the RPA.
- 5.2.4 When underground apparatus is to pass within the RPA of a retained tree, trenchless insertion methods should be used (see table below) with entry and retrieval pits sited outside the RPA. Shallow services runs may be dug with hand tools if appropriate.

Trend	chless Solu		Installation O	f Underground Se	ervices
Method	Accuracy (MM)	Bore <sup>(A)</sup> diameter (MM)	Maximum subterranean length (M)	Applications	Not suitable for
Microtunnelling	<20	100 to 300	40	Gravity-fall pipes, deep apparatus, watercourse/ roadway under crossings	Low-cost projects due to relative expense
Surface- launched directional drilling	≈100	25 to 1200	150	Pressure popes, cables including fibre optic	Gravity fall pipes, e.g. drains and sewers <sup>(B)</sup>
Pipe ramming	≈150	150 to 2000	70	Any large-bore pipes and ducts	Rocky and other heavily obstructed soils
Impact moling (C)	≈50 <sup>(D)</sup>	30 to 180 (E)	40	Gas, water and cable connections, e.g. from street to property	Any application that requires accuracy over distances in excess of 5m.

- (A) Dependent upon strata encountered
- (B) Pit-launched directional drilling can be used for gravity fall pipes up to 20m in subterranean length



- (C) Impact moling (also known as thrust-bore) generally requires soft, cohesive soils
- (D) Substantial inverse relationship between accuracy and distance
- (E) Figures given relate to single pass: up to 300mm bore achievable with multiple passes

#### 6. Conclusion

- 6.1 As with any construction exercise near trees, there are potential areas of conflict where damage could be caused to retained trees.
- 6.2 By using the protective elements dictated by British Standard 5837, no significant damage should take place during the construction phase and the tree cover should flourish in the longer term.
- 6.3 It is anticipated that all of the retained trees can be incorporated into the site design.
- 6.4 All tree works must conform rigorously to BS 3998 (2010) 'Recommendations for Tree Work'.

For and on behalf of AllAboutTrees Ltd

Richard Bryson

Andrew Watson FLS MICFor CBiol MSB FArborA CEnv LCGI -Chartered Arboriculturalist & Registered Consultant



# Appendix 1

Tree No.	Species Common Name Latin Name	Height (M)	Crow N		read ( E		Trunk Dia (MM)	No. Of Stems	Height Of Lower Canopy (M)	First Sign Branch (M) (Position)	Age	Physiol- ogical Condition	Structural Condition	Root Prot Area Radii (M)	Estimated Remaining Contribution (Years)	Tree Quality Assessment	Comments	Maintenance	Bat Roost Potential	Ultim Size Spec (M)	For	Priority
1	Sycamore Acer pseudoplatanus	10.5	3	3	3.5	2.5	305	2	2	2 E	Middle aged	Poor	Poor	3.7	<10	U - Unsuitable for retention	ground level. Inappropriate location. Abuts footings of oil tank.	This tree is unaffected by the proposals.  Remove as part of site management.	None	Height Spread	20	A
2	Sycamore Acer pseudoplatanus	10.5	4.5	5	5	0.5	160	1	3	3 N	Young	Fair	Fair	1.9	10-20	C - Low	Leans to the east.  Branches encroaching upon building.  Inappropriate location.  Growing in contact with and damaging stone boundary wall.  Abuts footings of oil tank.	This tree is unaffected by the proposals.  Remove as part of	None	22	20	A
3	Elder Sambucus nigra	6	3.5	3	3	3	350	1	2	0.5 N	Mature	Fair	Poor	4.2	10-20	C - Low	Basal decay.  Multiple stems from ground level.  Inappropriate location.  Growing in contact with and damaging stone boundary wall.	unaffected by the proposals.  Remove as part of	None	8	8	А



Tree No.	Species Common Name Latin Name	Height (M)			read ( E		Trunk Dia (MM)	Stems	Height Of Lower Canopy (M)	First Sign Branch (M) (Position)	Age	Physiol- ogical Condition	Structural Condition		Estimated Remaining Contribution (Years)	Tree Quality Assessment	Comments	Maintenance	Bat Roost Potential	Ultima Size F Speci (M)	or	Priority
4	Lawson cypress Chamaecyparis lawsoniana	4	1.5	1.5	1.5	1.5	240	1	0.5	0.5	Middle aged	Fair	Fair	2.9	<10	U - Unsuitable for retention	Significant browsing damage to trunk. Almost ring barked.	This tree is unaffected by the proposed development and can be retained for the short term.  A precautionary protective barrier should be positioned as per the blue line on the Tree Protection Plan (TPP)  No tree works required at the present time.	None	Height Spread	8	
5	Lawson cypress Chamaecyparis lawsoniana	2.5	1.1	1.1	1.1	1.1	240	1	0.5	0.5	Middle aged	Fair	Fair	2.9	<10	U - Unsuitable for retention	Multiple stems from ground level.  Significant browsing damage to trunk. Almost ring barked.  Some browning of foliage.	This tree is unaffected by the proposed development and can be retained for the short term.  A precautionary	None	18	8	-
6	Sycamore  Acer pseudoplatanus	11	4.5	4	5.5	8	572	2	1	1.5 N	Mature	Fair	Fair	6.9	40+	Moderate	Located outside site boundary.  Asymmetric crown spread.	This tree is unaffected by the proposals.		22	20	В



Sycamore  7 Acor pseudoplatanus  11 1 4 1 2.5 270 1 3 3.5 Middle Fair Fair 3.2 20-40 C - Low Deadwood.  Sycamore  8 Acor pseudoplatanus  Sycamore  8 Acor pseudoplatanus  Sycamore  13.5 5 6.5 6 5.5 620 1 2 2 N Mature Fair Fair 7.4 40+ A-High Minor/small diameter protective barier as dequated will be adequated by the position of the Minor/small diameter protective barier as dequated will be adequated will be adequated by the position of the Minor/small diameter protective barier as deaquated will be adequated will be adequated will be adequated by the position of the Minor/small diameter protective barier as deaquated will be adequated will be adequated will be adequated from the control of the Minor/small diameter protective barier as deaquated will be adequated from the control of the Minor/small diameter protective barier as deaquated will be adequated from the control of the Minor/small diameter protective barier as deaquated from the control of the Minor/small diameter protective barier as deaquated from the control of the Minor/small diameter protective barier as deaquated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as dequated from the control of the Minor/small diameter protective barier as decounted from the control of the Minor/small diameter protective barier as deal of the control of the Minor/small diamet	Tree No.	Species Common Name	Height (M)	Crow	n Sp	read (	(M)	Trunk Dia (MM)	No. Of Stems	Height Of Lower Canopy	First Sign Branch (M) (Position)	Physiol- ogical Condition	Structural Condition	Root Prot Area Radii	Estimated Remaining Contribution (Years)	Tree Quality Assessment	Comments	Maintenance	Bat Roost Potential	Ultim Size I Spec (M)	or	Priority
Sycamore  7 Acer pseudoplatanus  Sycamore  8 Acer pseudoplatanus  Sycamore  8 Acer pseudoplatanus  Sycamore  1 1 1 5 5 6.5 6 5 5.5 620 1 2 2 N Mature Fair Fair 7.4 40+ A-High cadequately adequately adequately overhead service cable will adequately overhead service cable will adequately overhead service cable will adequately service wires.  Subdominant stem from prune clear of service wires.  Situated at higher level approximately 1.5m above site.  Leans to the west.  Asymmetric crown spread.  Crown distorted due to group pressure.  Crown distorted due to group pressure.  Beadwood.  Situated at proximately 1.5m above site.  Crown distorted due to group pressure.  Sycamore  7 Acer pseudoplatanus  None 22  Sycamore  8 Acer pseudoplatanus  No major visible defects.  No metel protective barrier as deadwood retained in indicated by the blue protective barrier as deadwood retained in findicated by the blue protective barrier as deadwood retained in findicated by the blue protective barrier as deadwood retained in findicated by the blue protective barrier as deadwood retained in findicated by the blue protective barrier as deadwood retained in findicated by the blue protective barrier as deadwood retained in findicated by the blue protective barrier as deadwood retained in findicated by the blue pr		Latin Name		N	s	Ε	w							(M)						Height Spread		
Sycamore 7 Acer pseudoplatanus 11 1 2 5 270 1 3 3 \$\$ Middle aged  Fair Fair 3.2 20-40 C - Low  Deadwood. Situated approximately 1.5m lower than main site.  Close to wall.  Sycamore  8 Acer pseudoplatanus  Sycamore  Sycamore  No major visible defects. Position of the sexisting protective barier ac																	Branches encroaching upon overhead service cables.  Subdominant stem from ground level.  Situated at higher level approximately 1.5m above	retaining walls and boundary treatments will adequately protect the tree.  Prune clear of service wires.				
Sycamore  8	7	Acer	11	1	4	1	2.5	270	1	3	3 S	Fair	Fair	3.2	20-40	C - Low	Asymmetric crown spread. Crown distorted due to group pressure.  Deadwood.  Situated approximately 1.5m lower than main site.	unaffected by the proposals.  The existing retaining walls and boundary treatments will adequately protect the tree.  No tree works required at the	None	22	20	-
9 Sycamore 12 4 5 5.5 3.5 530 1 2 2.5 NE Mature Fair Fair 6.4 40+ B - Leans to the south. This tree is None 22	8	Acer pseudoplatanus							1			Fair				A -High	Minor/small diameter deadwood retained in canopy.  Close to wall and concrete drive.	The tree is retainable and will be adequately protected by the position of the protective barrier as indicated by the blue line on the Tree Protection Plan (TPP).  No tree works required at the present time.	None			-



Tree No.	Species Common Name Latin Name	Height (M)	Crow N		read( E		Trunk Dia (MM)		Height Of Lower Canopy (M)	First Sign Branch (M) (Position)	Age	Physiol- ogical Condition	Structural Condition	Root Prot Area Radii (M)	Estimated Remaining Contribution (Years)	Tree Quality Assessment	Comments	Maintenance	Bat Roost Potential	Ultim Size I Spec (M)	For	Priority
	Acer pseudoplatanus															Moderate	Deadwood.  Abuts against wall.  Level change between tree and field.	unaffected by the proposals.  The existing retaining walls and boundary treatments will adequately protect the tree.  No tree works required at the present time.		Height Spread		
10	Sycamore Acer pseudoplatanus	11	5.5	6.5	2.5	6	480	1	1.5	2 S	Mature	Fair	Fair	5.8	40+	B - Moderate	Asymmetric crown spread.  Deadwood.  Abuts against wall. Level change between tree and field.	This tree is unaffected by the proposals.  The existing retaining walls and boundary treatments will adequately	None	22	20	
11	Sycamore Acer pseudoplatanus	10	2.5	4	4.5	2	330	1	1	1.5 N	Middle aged	Fair	Poor	4	<10	U - Unsuitable for retention	Extensive stem decay.  Asymmetric crown spread.  Branches encroaching upon building.  Inappropriate location.  Growing in contact with and damaging building.  Browsing damage.	outbuildings.	None	22	20	A
12	Elder	6	3	2.5	2	2.5	350	1	2	0.5 N	Mature	Fair	Fair	4.2	10-20	C - Low	Multiple stems from ground level.	The tree is retainable and will		8	8	-



Tree No.	Species Common Name Latin Name	Height (M)	Crov N	vn Sp S	read ( E	M) W	Trunk Dia (MM)		Height Of Lower Canopy (M)	First Sign Branch (M) (Position)			Structural Condition	Prot Area	Estimated Remaining Contribution (Years)	Assessment	Comments	Maintenance	Bat Roost Potential	Ultima Size F Speci (M)	or	Priority
	Sambucus nigra																Inappropriate location.  Growing in contact with boundary wall.	be adequately protected by the position of the protective barrier as indicated by the blue line on the Tree Protection Plan (TPP).  No tree works required at the present time.		opread		
Groups																						
Group 1	Sycamore  Acer pseudoplatanus	5	-	-	-	-	<150	-	-	-	Young	Fair	Fair	1.8	10-20	C - Low	Self set saplings and regenerative growth adjacent to building	Remove as part of site management.	None	22	20	Α

## Appendix 2(1)

#### Glossary of Terms

1 Reference number: An individual identifying number

2 Species: Species identification is based on visual field observations and lists the common

name. In some cases the botanical name will be used where there is no common alternative. On in-depth surveys the botanical name only may be used

**3** Height: Height is estimated to the nearest metre. On computerised surveys this may be

within a range of heights. When measured height is required, a clinometer is used

to measure to the nearest metre

4 Diameter: Trunk diameter measured at 1.5 metres from ground level and recorded in

millimetres. In some surveys this is indicated as a range

**5** Spread: Measurement of canopy from the trunk to the nearest metre in four directions,

North, South, East, and West in metres

6 Lower crown

Clearance:

Height in metres of crown clearance above adjacent ground level

7 Age: Either an estimate (or statement if accurately known) of the age of the tree,

classified as:

Y = Young tree, established tree usually up to one third of expected ultimate height &

spread

**MA** = middle aged, usually between one third and two thirds of ultimate height &

spread

**M** = Mature, more or less at full height but still increasing in girth & spread

**OM** = Over mature, grown to full size and becoming senescent,

V = Veteran tree, individuals surviving beyond the typical age range for the species

8 Physiological

Condition:

Good = Healthy tree with good vitality,

Fair = Moderate health and vitality normal or slightly less for species and age

Poor = Poor shape or form - signs of decline in crown, may have structural

weakness.

Dead = dead or dying tree

9 Structural Good = No visible structural defects

**Condition:** Fair = Only minor structural defects

Poor = Defects which may need to be rectified or regularly monitored Remove = Severe defects which may result in immanent failure or collapse

**10 Management** General comments on the condition of the tree or group and any action required.

Recommendations: potential for wildlife habitats

11 Estimated Safe Useful Life Expectancy (SULE): in some cases the age ranges are modified

**Remaining** Short: 0 – 10 years Medium: 10– 20 Years **Contribution:** Intermediate: 20-40 Long: 40 + years

12 Tree Quality: Assessment of tree quality see following cascade chart for details

13 Priority: A - Works to achieve an acceptable level of safety or required to facilitate

the development

B - Works to achieve higher levels of arboricultural management.

C - To improve the aesthetic appearance.

14 Ultimate Size: Taken from Arboriculture Research Note 8490ARB or NHBC Standards Chapter

4.2 as appropriate The Normal Ultimate Height in an Urban Situation in metres.

Ultimate spread of the Crown in metres.

15 Root Protection

Area:

The distance at which the protective barrier should be erected measured in a radii

from the centre of the trunk in metres.

16 Pruning: Pruning shall be defined as the removal of living or dead parts of a plant by the

Contractor. Such parts may be soft growth, twigs, branches, limbs or sections of

the tree trunk. The cut material may vary from small to large in size.



17 Crown Cleaning:

Cleaning out is defined as the removal of dead, dying or diseased branchwood, broken branches or stubs left from previous tree surgery operations (see also 16 Deadwooding) together with all unwanted objects, which may include ivy (if specified) and/or other climbing plants, nails, redundant cable bracing, rope swings, tree houses and windblown rubbish from the tree, and any such debris from any cavities within the tree.

18 Deadwood Removal: Dead-wooding shall be defined as the removal of all dead and dying branches and

limbs from the tree.

19 Crown Lifting:

Crown lifting shall be defined as the removal of all soft growth and branches or parts thereof which are below or which extend below the height specified in the tender documents. It is recognised that the resultant canopy base might not be one single level but might be stepped to allow for different clearances, for example where a tree overhangs both the footway and the road where different height clearances are required.

20 Crown Reduction:

Crown reduction shall be defined as the reduction of the complete outline dimension of the canopy, from the tips of limbs and branches to the main trunk, by pruning growth to an acceptable branch, twig or but to leave a flowing silhouette.

# Appendix 2(11) Cascade Chart For Assessing Tree Quality

				11 (10)
Category and definition	4 Materia and antique to a large	Criteria – Subcategories	0. Maintenantinantinant	Identification
Trees to be considered for retention	1. Mainly arboricultural values	2. Mainly landscape values	3. Mainly cultural values, including conservation	on plan
Category High = A  Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially, if rare or unusual, or those that are essential components of groups, or of formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation historical, commemorative or other value (e.g. veteran trees or wood – pasture)	Green
Category Moderate = B  Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	Blue
Category Low = C  Trees of low quality with an estimated remaining life expectancy of at least 10 years; or young trees with a stem diameter below 150mm		Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value, and/ or trees offering low or only temporary/transient landscape benefits usually not be retained where they would impost diameter of less than 150mm should be considered.		Yellow
Category = U Trees unsuitable for retention  Those of such a condition that they	those that will become unviable afte companion shelter cannot be mitiga	able, structural defect, such that their early loss is exper er removal of other U category trees (i.e. where, for what ated by pruning) signs of significant, immediate and irreversible overall	atever reason, the loss of	Red
cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	Trees infected with pathogens of si very low quality trees suppressing a	gnificance to the health and/or safety of other trees nea	arby (e.g. Dutch elm disease) or	

#### Appendix 2(111)

Guidelines for the Planning, installation and Maintenance of utility services in proximity to trees-Based on information from National Joint Utilities Group (NJUG)

Ideally all services should be placed outside of the trees root protection area, but in some situations this is not feasible due to the confines of the site. If services must be laid within the root protection area acceptable techniques are detailed below in order of preference.

- Trenchless- by use of thrust boring or similar techniques. The pit excavations for starting and receiving the machinery should be located outside of the root protection area.
   To avoid root damage, the mole should run at a depth of at least 600mm.
   Use of external lubricants on the mole other than water (e.g. oil or bentinite) should be avoided.
- Broken trench- by using hand dug trench sections together with trenchless techniques. It should be limited to practical access and installation around or below the roots. The trench must be dug by hand (see following comments re continuous trenching) and only be long enough to allow access for linking to the next section. The open sections should be kept as short as possible.
- Continuous trench- the trench is excavated by hand and retains as many roots as possible. The surface layer is removed carefully and hand digging of the trench takes place. No roots over 2.5cm diameter or clumps of smaller roots (including fibrous) should be severed. The bark surrounding the roots must be maintained. Cutting of roots over 2.5cm diameter should not be attempted without the advice of a qualified Arboriculturalist.
  - If roots have to be cut, a sharp tool (defined as spade, narrow spade, fork, breaker bar, secateurs, handsaw, post hole shoveller, hand trowel) should be used.

#### **Backfilling**

Reinstatement of street works must comply with the code of practice New Roads and Streetworks Act 1991 (Specification for the reinstatement of openings in highways), but where tree roots are involved backfilling should be carefully carried out to avoid direct damage to retained roots and excessive compaction of the soil around them.

The backfill should incorporate an inert granular material mixed with top soil or sharp sand (not builder's sand) around the retained roots. This will allow a measure of compaction for resurfacing whilst creating an aerated zone around the roots.

Roots and in particular fine roots, are vulnerable to desiccation on exposure to air. The roots are at greatest risk when there are rapid fluctuations in the air temperature around them (especially winter diurnal temperatures). It is vitally important that the roots are covered with sacking whilst the trench is open. The sacking should be removed once the trench is backfilled.

#### Planning of services

When laying new or replacement services it is wise to plan ahead to prevent future direct damage to the services from root growth by placing the services within a duct.

If roots have grown into a drain or duct and proliferated to cause a blockage, removal of the root mass will only have a temporary affect and the root will regrow. The fault is in the pipe or duct, not the tree roots and the only answer is to repair or replace the damaged area. Particular problems occur with old salt glazed pipes where clay has been used to seal the joints and has subsequently dried out leaving a gap for the roots to infiltrate.

A popular myth has arisen that tree roots are attracted to water or nutrients within piped systems, this is not so. Roots are adventitious and grow in all directions proliferating in areas where moisture or nutrients are present. They tend to grow near to the pipe to make use of the condensation or moisture build up on the outside of the pipe but will enter the pipe through any crack or damaged joint. They are not capable of breaking into sound pipes.



Unit B10 Durham Dales Centre Castle Gardens Stanhope Co Durham DL13 2FJ

Telephone 0191 3739494 / 01388 529200 Facsimile 01388 529200

Email – <u>info@allabouttrees.co.uk</u> www.allabouttrees.co.uk

Registered in England & Wales No. 5301671
Registered Office: Unit B10 Durham Dales Centre, Castle Gardens, Stanhope,
Co Durham DL13 2FJ