

LEVEL MONITORING

for SMS (AVI, PRE)

12 West Meadows Road, , Sunderland, SR6 7TX

Client:	SMS (AVI, PRE)
Client Contact:	Lou Tickle
Claim Number:	10569036
Client Reference:	IFS-AVI-SUB-25-0119858
Policy Holder:	Mr Robert Whitelaw
Report Date:	22 June 2026
Our Ref:	M24530

Level Monitoring Readings



The following table shows the reading levels of the various Level Monitoring Station points.


Date	1	2	3	4	5	6	7	8	9	10
22/09/2025	10.0467	9.9986	9.9197	9.8937	9.9202	10.1773	9.8360	9.8663	9.9538	9.9597
03/12/2025	10.0482	10.0001	9.9194	9.8960	9.9228	10.1777	9.8367	9.8734	9.9575	9.9608
24/02/2026	10.0492	10.0014	9.9203	9.8981	9.9252	10.1783	9.8370		9.9586	9.9607
22/04/2026	10.0489	10.0016	9.9206	9.8986	9.9260	10.1794	9.8383		9.9590	9.9612
18/06/2026	10.0413	10.0015	9.9206	9.8984	9.9253	10.1792	9.8382		9.9576	9.9607

Date	8a
22/09/2025	
03/12/2025	
24/02/2026	9.8720
22/04/2026	9.8735
18/06/2026	9.8724

Level Monitoring Difference Graphs



The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.

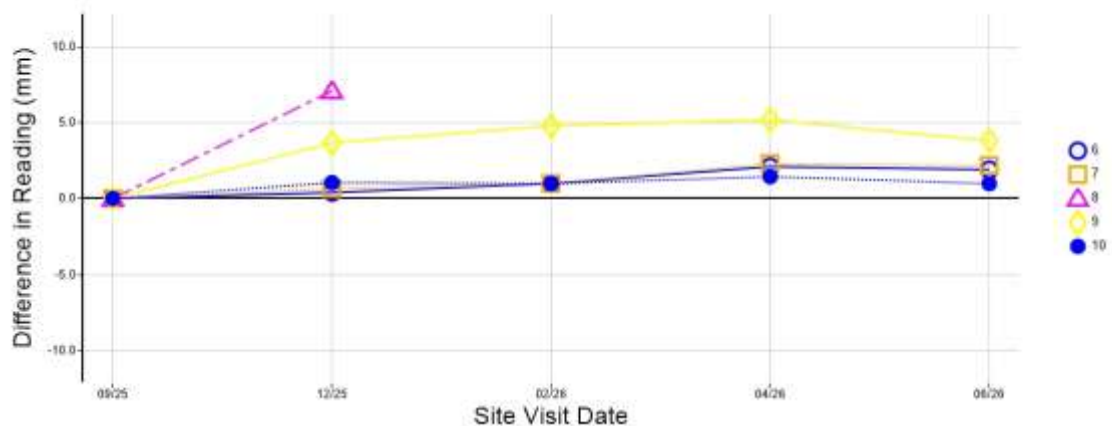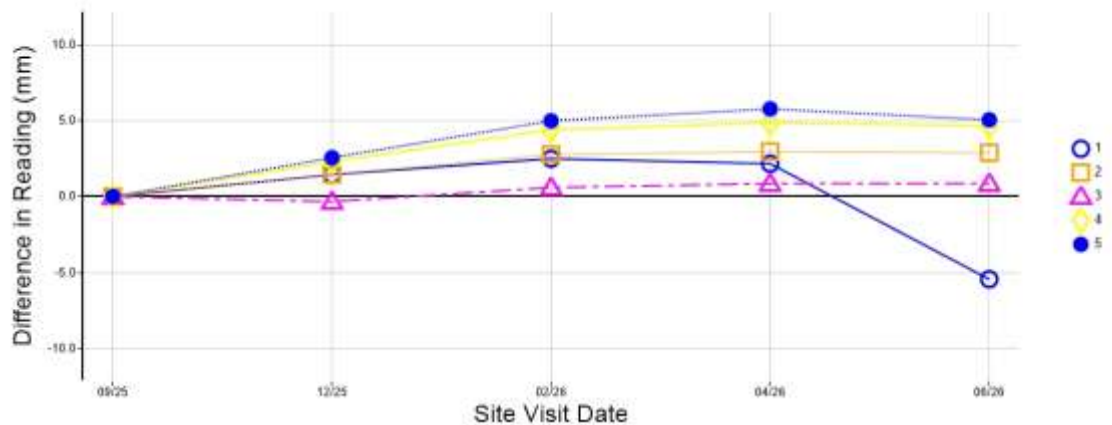

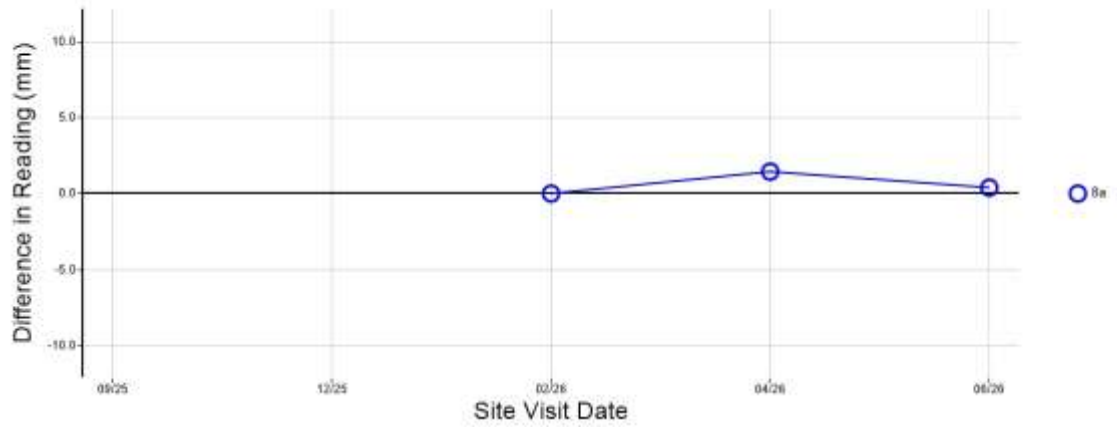

Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

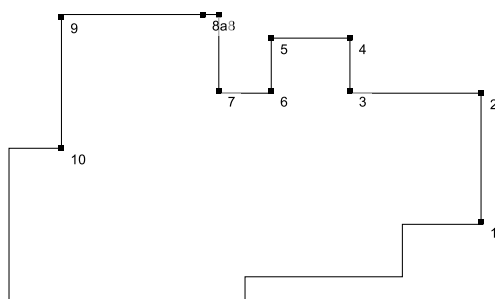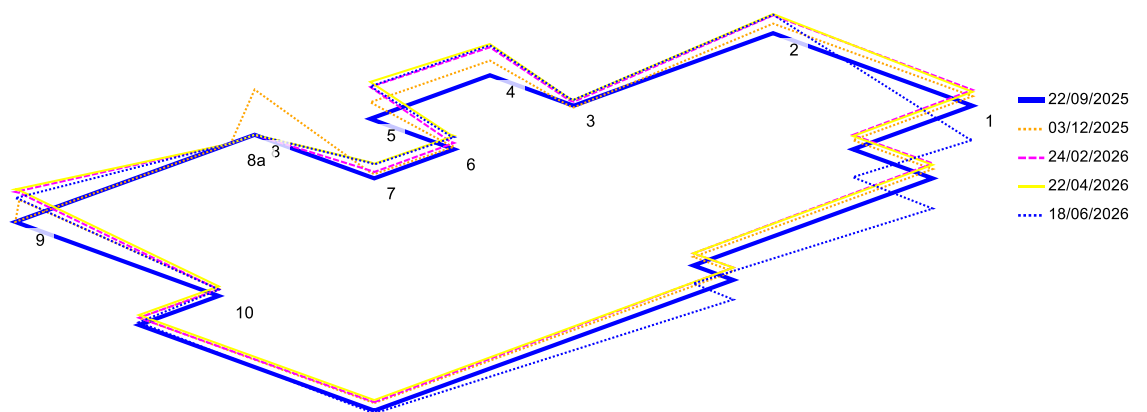

FRONT

Site Visit Notes

Datum has been fixed to the front right and corner of the main property. This is away from the area of damage. The datum has an assumed value of 10.0000. No remote datum is appropriate, a deep datum would be recommended if the datum on the house is not appropriate.

Site Visit: 24 February 2026

Point 8 snapped, refitted as 8a.