



TRANSPORT ASSESSMENT PROPOSED RESIDENTIAL DEVELOPMENT

Holborn Riverside, South Shields

February 2021

Cussins & Keepmoat Homes

TPS Transport Consultants Ltd | TPS Business Hub | Stonebridge Court | 151-153 Wakefield Road | Wakefield | WF4 5HQ



tpsconsultants.co.uk



info@tpsconsultants.co.uk



+44 1924 664638

Registered number: 05973261



Document Record

Project Name	5065-TPS-XX-SU-Z-20210209			
	Issue 1	Revision 1	Revision 2	Revision 3
Date:	02/11/2020	08/02/2021		
Prepared by:	GH	GH		
Checked by:	GS	GS		
Authorised by:	GS	GS		

Copyright Statement

This report is the copyright of TPS Transport Consultants Ltd.

The information, ideas and other intellectual property set out in this report and supporting technical appendices are the property of TPS Transport Consultants Ltd and are for the sole benefit Cussins & Keepmoat Homes in respect of a planning application for residential development at Holborn Riverside, South Shields.

TPS Transport Consultants Ltd. requires that the information, ideas and other intellectual property set out in this report are:

- Not shared with third parties and particularly with direct or indirect competitors of TPS Transport Consultants Ltd;
 - Not conveyed to other consultants or personnel without the prior approval of TPS Transport Consultants Ltd; and
 - Not copied in part or in whole.
-



Contents

Chapter	Title	Page
1.	INTRODUCTION	1
	Introduction	1
	Site Location	1
	Report Structure	3
2.	POLICY REVIEW	5
	Introduction	5
	National Policy Context	5
	Local Policy	6
	Summary	15
3.	ACCESSIBILITY	16
	Introduction	16
	Active Travel Options	16
	Public Transport	21
	Car Club	24
	Local Facilities	25
	Summary of Accessibility	27
4.	LOCAL HIGHWAY NETWORK	28
	Introduction	28
	Highway Network	28
	Road Safety	30
5.	TRIP GENERATION & DISTRIBUTION	36
	Introduction	36
	Development Proposals	36
	Trip Rates & Resultant Trip Generation	36
	Trip Distribution	40
	Materiality	41
6.	ACCESS, PARKING AND SERVICING	45
	Introduction	45
	Access	45
	Parking	45
	Servicing	46
7.	SUMMARY & CONCLUSIONS	48
	Summary	48
	Conclusion	49

1. INTRODUCTION

Introduction

- 1.1 TPS Transport Consultants Ltd (TPS) has been commissioned by Cussins & Keepmoat Homes to prepare a Transport Assessment in support of an application for a proposed residential development of 350 dwellings (known as Holborn Riverside), located at the former Holborn Docklands to the west of Commercial Road, South Shields.

Site Location

- 1.2 The site is bound to the north by South Shields town centre, the west by the River Tyne and to the east and south by a mixture of residential and commercial uses. The location of the development is shown in **Figure 1.1**; **Appendix A** includes an indicative masterplan for the proposals.

Figure 1.1: Site Location



(Source : Google Maps)

Development Proposals

- 1.3 The development proposals comprise a residential development of 350no. dwellings, which will form part of the regeneration of the former docklands. There is intended to be three phases of development; phase 1 will comprise 48no dwellings, phase 2 will comprise 109no. dwellings and phase 3 will comprise 193no. dwellings; a total of 350 dwellings (15%) will be

affordable; it is anticipated each phase of development will take between 12 – 18 months to complete. **Table 1.1** provides a breakdown of accommodation type by phase.

Table 1.1: Proposed Accommodation Breakdown by Development Phase

Accommodation Type	Number of Units
Phase One	
2 Bedroom House	5
3 Bedroom House	23
4 Bedroom House	13
Affordable Units	7
Phase One Total	48
Phase Two	
1 Bedroom Apartment	6
2 Bedroom Apartment	20
2 Bedroom House	17
3 Bedroom House	28
4 Bedroom House	38
Affordable Units	16
Phase Two Total	109
Phase Three	
1 Bedroom Apartment	19
2 Bedroom Apartment	86
2 Bedroom House	20
3 Bedroom House	42
4 Bedroom House	26
Affordable Units	29
Phase Three Total	193
Total	
Total Units	350

(Source: Cussins & Keepmoat Homes)

- 1.4 Access to the site will be taken from 5no access points; four onto Commercial Road, on the eastern boundary of the site, and one onto West Holborn, on the southern boundary. The 4no. access points onto Commercial Road will re-use existing access points to the former docklands at Cone Street, Nile Street, Hill Street and Laygate Street. Alongside the vehicle access points, a total of a 4no. pedestrian links are proposed which will serve to increase

pedestrian permeability from the existing footway network, external to the site. **Figure 1.2** shows the various access points for motorised / non-motorised users.

Figure 1.2: Motorised / Non-motorised Vehicle Access Points



(Source: Google Maps / Cussins & Keepmoat Homes)

- 1.5 The development proposals will contribute towards the wider regeneration of the Riverside area of South Shields and will transform the derelict industrial land into a high-quality residential area. Given the nature and scale of the development proposals as a catalyst for the wider regeneration of the former industrial area, the site has been allocated for residential development by South Tyne Council as part of "*The South Tyneside Strategic Housing Land Availability Assessment*" (reference: SOS014 Holborn - South Shields Riverside).
- 1.6 The allocation of the site for residential development highlights an acceptance of the principle of development in the order of the quantum / type proposed, and the associated traffic impacts.

Report Structure

- 1.7 Following this introductory section:

Section 2 describes the transport planning policy context within which the proposals will be assessed with reference to site-specific policy documents;



Section 3 details the accessibility of the development site, identifying opportunities for active and sustainable travel from the site;

Section 4 describes the existing highway network in the vicinity of the development and key routes to the site, with reference to historic road safety records;

Section 5 summarises the trip generation and distribution of trips associated with the proposed residential dwellings;

Section 6 considers the access, parking and servicing arrangements; and

Section 7 offers a summary and conclusion.



2. POLICY REVIEW

Introduction

- 2.1 This section of the Transport Assessment identifies the policy context within which the development proposals have been assessed; it clearly demonstrates how the proposed development would contribute to the overarching principles of national and local transport policy and land use planning.

National Policy Context

National Planning Policy Framework (NPPF – DCLG, February 2019)

- 2.2 The revised National Planning Policy Framework was published in February 2019 and sets out the government's planning policies for England and how these are expected to be applied.
- 2.3 The NPPF encourages development through the planning system, with a presumption in favour of sustainable development.
- 2.4 The NPPF states that *“Development should only be prevented or refused on highways grounds if there would be an unacceptable impact on highway safety, or the residual cumulative impacts on the road network would be severe”* (Paragraph 109). Paragraph 110 sets out that development proposals should seek to:
- Give priority first to pedestrian and cycle movements, both within the scheme and connecting with neighbouring areas and second – so far as possible – to facilitate access to high quality public transport, with layouts that maximise the catchment area for bus or other public transport services, and appropriate facilities that encourage public transport use;
 - Address the needs of people with disabilities and reduced mobility in relation to all modes of transport;
 - Create places that are safe, secure and attractive – which minimise the scope for conflicts between pedestrians, cyclists and vehicles, avoid unnecessary street clutter, and respond to local character and design standards;
 - Allow for the efficient delivery of goods, and access by service and emergency vehicles; and
 - Be designed to enable charging of plug-in and other ultra-low emission vehicles in safe, accessible and convenient locations.



- 2.5 This Transport Assessment will demonstrate that the development proposals take full advantage of existing facilities for sustainable travel, locally, will not result in a significant traffic impact on the local road network and will, therefore, satisfy the requirements of NPPF.

Local Policy

North East Transport Plan (NETP) – December 2016

- 2.1 The North East Transport Plan serves as the joint transport plan between the seven Councils in the north east (Durham, Gateshead, Newcastle, Northumberland, North Tyneside, South Tyneside and Sunderland), which together form the North East Combined Authority. The document primarily serves as a manifesto for the Combined Authority for the 20-year period to 2036. One area which the plan focuses on is sustainable transport; specifically stating that new developments will be designed to integrate walking.
- 2.2 The NETP was subject to public consultation in 2018, meaning that a revised version is to be expected in the near future. However, until an update is published, the 2016 document remains of relevance.

Tyne and Wear Local Transport Plan 2011-2021 (LTP3)

- 2.3 The Local Transport Plan (LTP3) for Tyne and Wear comprises a ten-year strategy (2011 - 2021) covering all forms of transport in Tyne and Wear and is underpinned by a series of three-year delivery plans. The delivery plans set out how the strategy will be put into effect at a local level.
- 2.4 The vision of the LTP3 is as follows:
- "Tyne and Wear will have a fully integrated and sustainable transport network, allowing everyone the opportunity to achieve their full potential and have a high quality of life. Our strategic networks will support the efficient movement of people and goods within and beyond Tyne and Wear, and a comprehensive network of pedestrian, cycle and passenger transport links will ensure that everyone has access to employment, training, community services and facilities."*
- 2.5 The following goals are set out within the LTP3 to achieve the vision above:
- To support the economic development, regeneration and competitiveness of Tyne and Wear, improving the efficiency, reliability and integration of transport networks across all modes;



- To reduce carbon emissions produced by local transport movements, and to strengthen our networks against the effects of climate change and extreme weather events;
- To contribute to healthier and safer communities in Tyne and Wear, with higher levels of physical activity and personal security; and
- To create a fairer Tyne and Wear, providing everyone with the opportunity to achieve their full potential and access a wide range of employment, training, facilities and services.

2.6 The development proposals complement the policy aspirations of LTP3. The accessible location of the site will help create a healthier community and contribute towards a reduction in carbon emissions, as future residents will be able to walk or cycle to many nearby amenities and use public transport to readily travel throughout the wider Tyne & Wear region.

The South Tyneside Local Plan

2.7 The South Tyneside Local Plan forms part of the council's latest development plan to help shape the Borough to 2036. This will influence how the region's towns, villages, coast and countryside may change, where people live, work and shop and play, and how people move around. Once adopted, the Plan will provide:

- A framework to meet the needs of South Tyneside's communities in a positive, managed and sustainable way;
- Those priorities for investment in jobs, homes and the timely delivery of the infrastructure necessary to support growth;
- The starting point for making decisions on day to day planning applications;
- A strategic policy framework for the preparation of Neighbourhood Plans.

2.8 The plan will replace the following adopted Development Plan documents:

- Core Strategy Development Plan Document (June 2007);
- South Shields Town Centre & Waterfront Area Action Plan (November 2008);
- Hebburn Town Centre Area Action Plan (October 2008);
- Central Jarrow Area Action Plan (September 2010);
- Development Management Policies (December 2011);



- Site-Specific Allocations (April 2012).

2.9 The draft policies of relevance to the current application are referred to in more detail below.

Policy RG1: South Shields Riverside (Strategic Policy)

2.10 Regeneration will be supported at the following sites in order to achieve an active and vibrant South Shields Riverside that contributes to the prosperity of the Borough:

2.11 Holborn Middle Dock and Windmill Hill

a) The former Holborn Middle Dock and associated land will deliver a mixed-use residential (approximately 400 homes) and office (approximately 200,000 sq. ft.) development. In taking forward the allocation we will require the developer to provide a comprehensive masterplan to address ecology, flooding, environmental remediation and transport. Key considerations for the developer are:

- i. Proposals should be supported by a site specific transport assessment, with particular focus on Commercial Road, South Eldon Street, A194 and Hudson Street.

2.12 As a regionally significant site, Holborn Middle Dock and Windmill Hill has the potential for a flagship mixed-use development including high quality office space. Proposals for the site are intended to capitalise on the Enterprise Zone status of the upper tier of the site and will deliver high quality office space and significant jobs. It is envisaged the new commercial office development will be augmented with 200,000 sq. ft. of office space, as well as new high quality residential units which will create new neighbourhoods and provide a range of house types and tenures providing a balanced and mixed community. South Tyneside see this sites as a significant asset to the Borough particularly in terms of providing appropriate accommodation for new and growing business service companies and digital and tech companies.

Policy IN6: Travel - New Development (Strategic Policy)

2.13 Accessibility will be improved, and transport choice widened, by ensuring that all new development is well serviced by a range of transport modes, including public transport, footpaths and cycle routes that are fully integrated into existing networks.

a) Proposals for new development should:



- i. Where appropriate, be supported by a Transport Statement or Transport Assessment and a Travel Plan, to assist consideration of travel impacts, improve accessibility and safety for all modes of travel associated with development proposals; and
- ii. Ensure that development proposals mitigate impacts on the strategic and/or local highway network, arising from the development itself or the cumulative impacts of development, through the provision of, or contribution towards necessary and relevant transport improvements, including those secured by legal agreement; and
- iii. Ensure that development proposals provide, or contribute to the provision of, new and/or improved (as appropriate) sustainable travel infrastructure where the predicted number of additional trips will lead to a cumulative increase in car-based trips; and
- iv. Give first priority to pedestrian and cycle movements, both within the proposal and to neighbouring areas, and ensuring that the scheme layout addresses the need for public transport connectivity at the outset; and,
- v. Incorporate safe and secure layouts which minimises conflict between traffic, cyclists and pedestrians including taking the needs of cyclists into account in traffic calming schemes; and
- vi. Where appropriate, improve locations that are less attractive to pedestrians and cyclists, including crossing points at roads; and
- vii. Ensure sufficient conveniently sited and secure cycle spaces will be provided having regard to the Parking Standards SPD (or its successor document), together with, where appropriate, showers and changing facilities; and
- viii. Ensure that proposals in terms of their layout do not compromise the potential for the future development of adjoining sites; and
- ix. Protect and where possible enhance access to public rights of way; and
- x. Consider appropriate road safety solutions where applicable; and
- xi. Ensure that sufficient car parking spaces will be provided having regard to the Parking Standards SPD (or its successor document); and



- xii. With respect to the highway management and adoption process, developments should have regard to our Highways and Design Standards (or its successor document).

b) Development proposals must be designed to meet the needs of ultra-low emission vehicle users. In particular:

- i. All major development will incorporate charging infrastructure for ultra-low emission vehicles; and
- ii. Minor development should incorporate charging infrastructure for ultra-low emission vehicles where it is practicable to do so; and
- iii. With reference to proposals that require the provision of ultra-low emission vehicle infrastructure, applicants should also have regard to the Parking SPD.

c) Development proposals must be designed to meet the needs of public transport users. In particular:

- i. Road layouts must include direct, convenient and safe bus routes which are not obstructed by on-street parking; and
- ii. Bus priority measures must be implemented, where appropriate; and
- iii. Where appropriate and necessary, all new homes and commercial development must be no more than 400m from a bus stop; and
- iv. Bus stops must have appropriately designed shelters, good pedestrian access and be open to public supervision; and
- v. Proposals must demonstrate how they have sought to maximise opportunities to improve accessibility to metro stations.

2.14 Policy IN7 "Accessible and Sustainable Travel", seeks to ensure the delivery of an accessible and sustainable travel network. The need for pedestrian and cyclist connectivity has been specifically referenced in this policy because of the particular importance the Council attaches to ensuring strong linkages both within the riverside area and between it and South Shields Town Centre. Strong linkages between the town centre and the riverside area has the potential to be mutually supporting for achieving vibrancy in both areas and will complement the new Public Transport Interchange in South Shields Town Centre.



South Tyneside Local Development Framework SPD8 – South Shields Riverside Regeneration, August 2009

- 2.15 Supplementary Planning Document No 8 - South Shields Riverside Regeneration, was adopted in 2009 and remains relevant to South Tyneside's vision for the regeneration of the riverside. The SPD has been prepared in support of the Local Development Framework Policy ST1 and the adopted South Shields Town Centre & Waterfront Area Action Plan Policies SS1 – SS14.
- 2.16 The document seeks to set out a sustainable long-term policy framework for the South Shields Riverside Regeneration Area, complementing the spatial vision and policies of the Core Strategy, the South Shields Town Centre & Waterfront Area Action Plan and the emerging Site-Specific Allocations Development Plan Document.
- 2.17 The strategic vision for the South Shields Town Centre & Waterfront Area Action Plan (which is discussed in the following part of this section) is to:
- “redevelop the riverside as a high-quality new location for urban living, leisure, education and working restoring the link between local communities and the river, and attracting highly skilled jobs.”*
- 2.18 The SPD provides further detail for this vision, with an aspiration:
- “To seek a more sustainable, longer-term view towards the regeneration of the riverfront that balances the desire for an active waterfront with the ambitions of a growing residential community. It is driven by five principle uses that prioritise to maximise the potential of the area. These uses are housing, offices, research and development including the knowledge economy, tourism, culture and leisure”.*
- 2.19 In addition to the strategic vision, six key objectives which form the basis of the SPD are identified, which are:
- Objective 1 – To improve access to the waterfront for everyone;
 - Objective 2 – To connect the waterfront to the town centre, new neighbourhoods, and communities;
 - Objective 3 – To improve links between the existing fragmented neighbourhoods;
 - Objective 4 – To support businesses and promote a mix of employment opportunities;
 - Objective 5 – To establish a sustainable living environment through mixed housing tenures and design innovation; and



- Objective 6 – To create a sustainable community through a mix of uses.

2.20 A range of principles are outlined within the SPD, the most relevant of these to the proposals can be summarised as:

Principle SSR4: Pedestrian and Cycle Movement – High quality pedestrian and cycling environments should be created by:

- Reconnecting the riverside with the wider development area through the creation of a number of main walks and views, including the Cliff Walk, the Board Walk and the High Line in accordance with Policy SS3 (E) of the adopted Area Action Plan;
- Connecting communities to the waterfront and overcoming level differences between the riverside and its hinterland through a tiered or terraced embankment to the rear of the Middle Docks site as part the New Shore Park; and
- Re-connecting South Shields Riverside to the wider South Shields area, to enable access to major public transport hubs, community services and facilities.

2.21 Principle SSR4 establishes a desire to include pedestrian / cycle routes as a key part of the redevelopment of the waterfront area. As can be seen on the proposed masterplan for the site, there is an intention to include additional pedestrian / cycle facilities within the site, whilst **Section 3** identifies the existing pedestrian / cycle networks which residents and visitors of the site will be able to access.

South Shields Town Centre & Waterfront Area Action Plan

2.22 The South Shields Town Centre & Waterfront Area Action Plan (AAP) was the detailed development plan document for the South Shields area in the northeast of the Borough, which is due to be superseded by the South Tyneside Local Plan, once formally adopted. Nonetheless at this stage it remains a material consideration in policy terms . It sets out the more detailed strategy and vision, policies and site-specific land allocations for South Shields town centre, riverside and foreshore.

2.23 This AAP broadly covers the area to the north of the Westoe footpath / cycleway and is bounded by the northern and eastern edges of the Westoe Crown Village development. It includes:

- The wider South Shields town centre area;



- Associated key development sites along the Tyne Riverside, north from McNulty Offshore yard to the mouth of the River Tyne; and
- The more developed coastal foreshore area as far south as Gypsies Green at the northern end of the coastal Leas.

2.24 The development site is located within the AAP area, being located in a strategic waterfront site on the Tyne Riverside to the northeast of Westoe and the southwest of the South Shields town centre.

2.25 The document states that the overall approach to the future development and regeneration of the South Shields town centre and waterfront area is based on:

- Creating a town centre that expresses local identity, is vibrant, with a diverse range of retail, leisure and cultural facilities that are accessible to all;
- Promoting the regeneration of the riverside, providing opportunities for high quality mixed-use office, commercial, leisure, public services and residential development, expanding the town centre community; and
- promoting and enhancing the foreshore, the seaside resort of South Tyneside, as a key focus for leisure and recreation, consolidating and diversifying existing uses, upgrading the environment, and protecting the designated 'developed coast' from the sea.

2.26 The Riverside Regeneration area is sub-divided into 'neighbourhoods'. Four of these – Harton Staithes, Holborn, Windmill Hill and High Shields – are allocated in this Area Action Plan. It is noted that a fifth and separate 'neighbourhood' – Trinity South – adjacent to Frederick Street district shopping centre, will be allocated in the Site-Specific Allocations DPD. Specific policies within the AAP that are of relevance to the proposals are detailed further below.

Policy SS3 Improving the Physical Accessibility of South Shields Town Centre and Waterfront

2.27 The accessibility of existing and proposed development sites within the South Shields town centre, riverside and foreshore areas will be improved for all modes of travel, giving priority to sustainable travel, by:

- A) improving visual and physical infrastructure links between the riverside, town centre and foreshore / seafront, particularly along the King Street / Ocean Road axis;
- B) improving pedestrian connections between the King Street and Waterloo Square / Coronation Street primary shopping areas, and with the Metro / bus station



interchange, and between the Market Place and the Shields Ferry landing and Customs House on the riverside;

- C) encouraging improvements at the Metro station and bus stands along Keppel Street and Chapter Row / Church Way;
- D) improving links between the Arbeia World Heritage Site and the town centre, riverside and foreshore areas;
- E) creating and improving pedestrian / cycle routes to and alongside the river to facilitate a continuous riverside walkway / cycleway, linking with the town centre and foreshore;
- F) improving connections between attractions along the length of the foreshore;
- G) improving traffic movement, circulation and management, including the focusing of road traffic for the town centre and riverside towards main gateways at the Crossgate / Station Road roundabout and at the Station Road / Coronation Street roundabout beside Harton Quay, and with a secondary gateway at the Crossgate / Westoe Road junction outside the Town Hall; and
- H) improving connections and signage between town centre car parks, including improving links between the Coronation Street / Waterloo Square area and rationalised and consolidated provision in the area to the west of Fowler Street (by 2015).

2.28 All development proposals should be in accordance with the Council's adopted car and cycle parking standards. The level of car parking provision should be sufficient to serve the needs of the town centre without adversely impacting on the viability of public transport or other sustainable travel initiatives.

2.29 Transport Assessments or Statements may also be necessary to assess traffic movements associated with proposed major redevelopment sites, including taking into account the implications for air quality and noise pollution. Sustainable travel plans may also be required (also to be detailed in a Supplementary Planning Document).

Policy SS11 Living in South Shields

2.30 South Tyneside Council will promote the provision of a sustainable mix and choice of housing in the South Shields town centre and riverside areas that meets the needs of everyone. Improvements to the quality of residential areas in the town will be encouraged, including



proposals for the restoration of existing properties, bringing upper floors of premises back into viable use, and the reclamation and regeneration of disused sites.

2.31 The release of the following sites for residential development will be managed by South Tyneside Council, to bring forward net additional housing completions phased to the following RSS plan periods, where appropriate as part of a mixed-use development scheme:

A) 2011-2016 priority sites [Sub-total = approx.640 net additional dwellings]:

- i) land to the west of Fowler Street- approx.40 dwellings
- ii) the designated Riverside Regeneration area - approx.600 dwellings
 - Harton Staithes (approx.100 dwellings / approx.8,500sqm)
 - Holborn (approx.500 dwellings / approx.61,000sqm)

2.32 All proposals take into consideration the identified housing needs of the area, focusing primarily on providing 2-bed starter and 3-bed family homes, semi-detached and terraced houses and bungalows and upper-floor flats for owner-occupation. Proposals also include provision for affordable housing that contributes substantially to meeting the identified need for at least 359 additional affordable homes in the South Shields area in accordance with Core Strategy Policy SC4.

Summary

2.33 This Transport Assessment has been prepared to take into account the overarching themes of both national and local policy guidance, which seeks to encourage development that is readily accessible by means other than the private car.

2.34 It recognises that the proposed development site is allocated for residential development and as such, the principle of the suitability of the proposals in policy terms has been previously approved.

2.35 The accompanying Travel Plan identifies how Cussins & Keepmoat Homes will further support and encourage residents to take advantage of local active / sustainable travel modes, with a view to minimising the traffic impact of the proposals as far as possible.

3. ACCESSIBILITY

Introduction

- 3.1 This section of the Transport Assessment describes the existing infrastructure that will facilitate and encourage future residents to walk, cycle or use public transport, rather than to travel by car. A range of amenities that can be accessed locally, by non-car modes, will also be identified.

Active Travel Options

Pedestrian Facilities

- 3.2 The Institution for Highways & Transportation (IHT) offers guidance on walking distance by journey purpose, as shown in **Table 3.1**, below.


Table 3.1: Walking Distances by Journey Type

Criteria	Commuting / School	Town Centre	Elsewhere
Desirable	500m	200m	400m
Acceptable	1000m	400m	800m
Preferred Maximum	2000m	800m	1200m

(Source: IHT)

- 3.3 As can be seen in **Table 3.1**, the preferred maximum walking distance for 'walking / commuting' is 2km. A 2km walking catchment from the site would, therefore, include the entirety of South Shields as well as, Westoe and Cauldwell. **Figure 3.1** illustrates a 2km walking catchment from the site.


Figure 3.1: 2km Walking Catchment

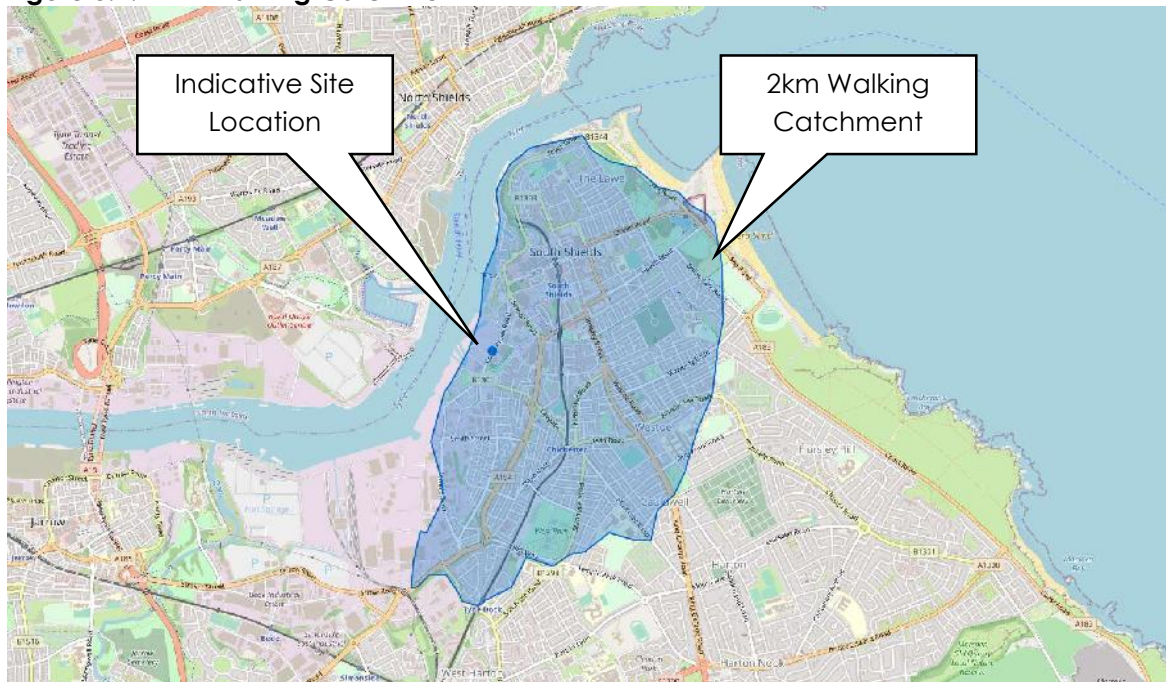

(Source: Open Street Map)

- 3.4 As can be seen on the proposed site masterplan, provided at **Appendix A**, pedestrian access to the site will be taken from a number of points on the northern, eastern, and southern boundaries of the site. As discussed previously, there are vehicle access points onto Commercial Street and West Holborn on the eastern and southern site boundaries, which will offer pedestrian access also.
- 3.5 On the northern boundary, 2no. pedestrian links are proposed, which will connect to the existing quayside and onto Riverside Court, on the eastern boundary a pedestrian link will be provided to the north of Cone Street, whilst another pedestrian access is proposed onto Commercial Road, close to the south-eastern corner of the site. The locations of the access points for pedestrians are illustrated in **Figure 3.2**.

Figure 3.2: Proposed Pedestrian Access Points

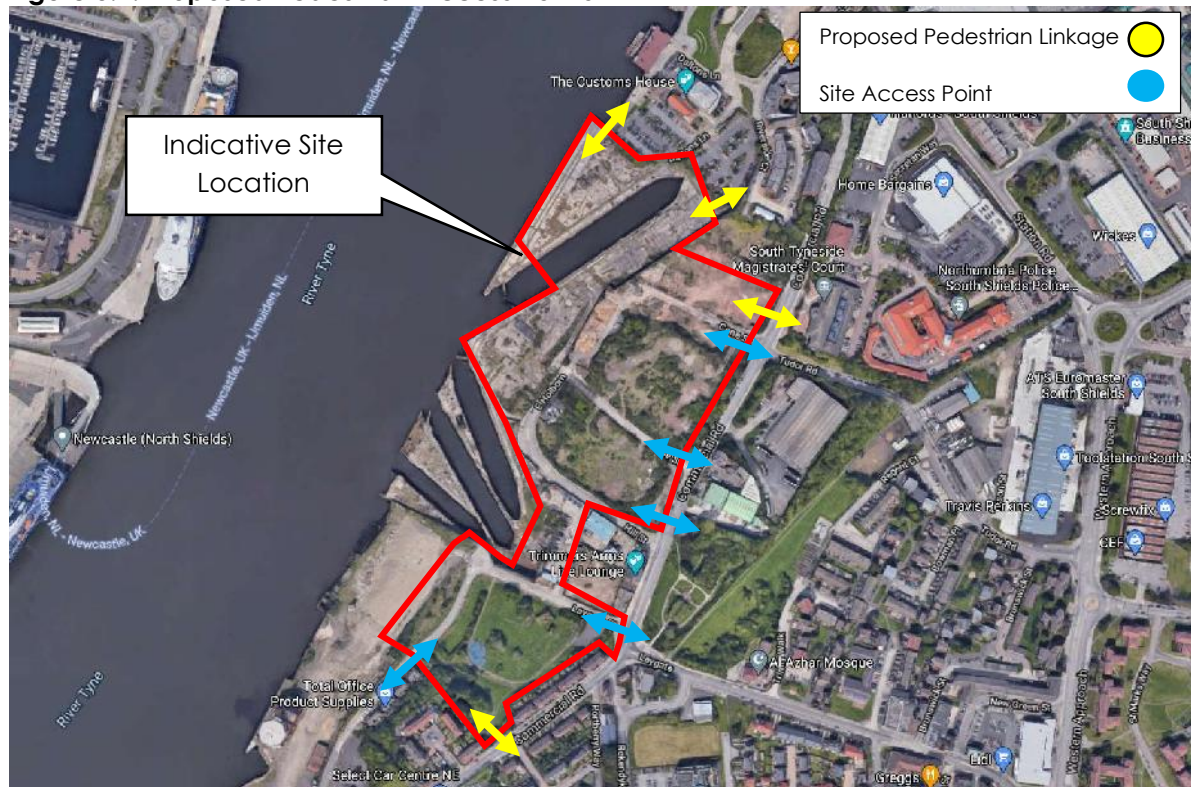

(Source: Google Maps)


- 3.6 There are continuous, lit, footways on both sides of Commercial Road, which facilitate a pedestrian route north – south through the surrounding area, as well as to South Shields town centre, which is located to the northeast of the site. It is anticipated that Commercial Road would be used to reach the wide range of leisure, retail and commercial uses located in South Shields town centre. The two pedestrian links on the northern boundary of the site, onto Riverside Court and the existing quayside, could also be used to access South Shields town centre.
- 3.7 Further footways can be accessed on Laygate, which is located in the south-eastern corner of the site. An uncontrolled crossing point is located to the north of the proposed Laygate Street access. There are footways on both sides of Laygate, which facilitate an east – west pedestrian route towards the Fredrick Street local centre, which offers a range of amenities including a LIDL supermarket, shops and a Post Office. The footways on Laygate also benefit from street lighting.
- 3.8 A shared footway / cycleway provides a traffic-free route between Laygate and Station Road and would offer a more direct route for future residents living in the southern part of the site, than via Commercial Road alone.

- 3.9 Given the existing facilities to support pedestrian journeys locally, and the enhancements to be delivered as part of the development. It is considered that many local trips will be made on foot. Details of the amenities accessible within walking distance of the site are discussed in the later part of this section.

Cycle Routes

- 3.10 In addition to the wide range of amenities found within the town centre which are readily accessible on foot, the site is well located for access to the wider area by bike. It is generally accepted that destinations within a distance of 5km can be considered accessible by bike; likely destinations within 5km are detailed later in this section. A 5km cycle catchment of the site includes the entirety of South Shields, alongside Westoe, Cauldwell, Horsley Hill, Harton, Cleadon Park and West Harton; this catchment is illustrated in **Figure 3.3** below.


Figure 3.3: 5km Cycle Catchment

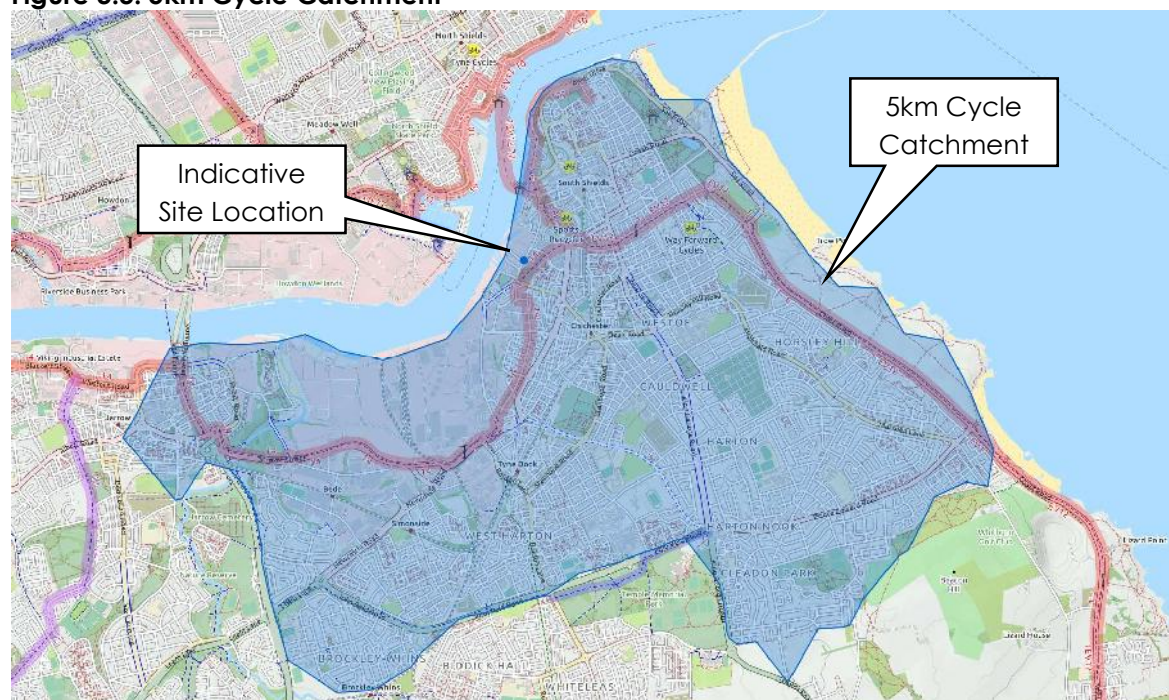

(Source: Open Cycle Map)

- 3.11 As can be seen in **Figure 3.3**, there are a number of cycle routes in the vicinity of the site which could be utilised by future residents and visitors. **Figure 3.4** illustrates the cycle routes in the vicinity of the site.

Figure 3.4: Local Cycle Routes

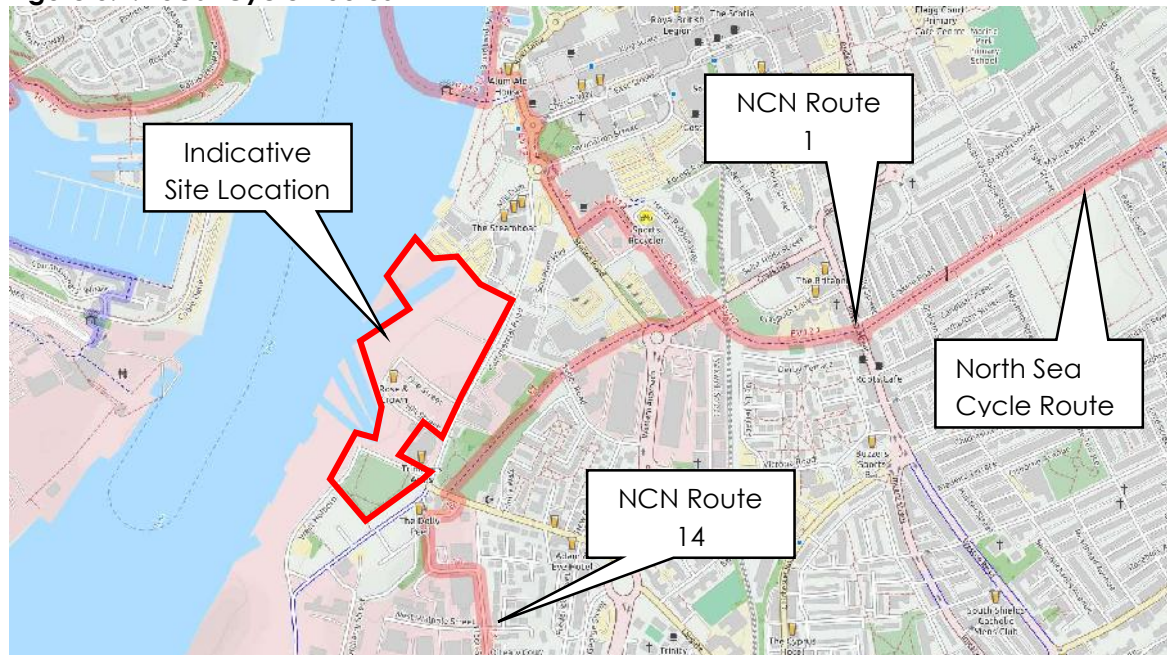

(Source: Open Cycle Map)

- 3.12 As can be seen in **Figure 3.4**, the closest cycle route to the site is National Cycle Network (NCN) Route 14 which runs along the traffic-free route that can be accessed from Laygate, to the southeast. NCN Route 14 is also known as the Three Rivers Cycle Route and connects a number of regional destinations including: Middlesbrough, Stockton-on-Tees, Hartlepool, Durham, Consett, Newcastle and South Shields.
- 3.13 In addition to NCN Route 14, further cycle facilities are located approximately 4 minutes north of the site on Crossgate; here NCN Route 1 and the North Sea Cycle Route can be accessed (as the two routes follow the same route). NCN Route 1 is a major national cycle route running north – south between Shetland and Dover, whilst passing through local destinations including Sunderland, Whitburn, and Seaham. The North Sea Cycle Route (which shares a route with NCN Route 1 locally) forms a north – south cycle route between South Shields and Staithes, which runs along the North Sea Coastline.
- 3.14 Given the proximity of the site to a number of local cycle facilities and amenities, it is considered that cycling will be an attractive option for future residents and visitors to the site. Details of the amenities located within cycling distance of the site are provided in the latter part of this section.



Public Transport

- 3.15 Whilst many local trips are likely to be undertaken on foot or by bike, it is nonetheless important to consider the options for travel by public transport, available within the vicinity of the site, particularly given the proximity of a number of urban centres that are readily accessible.

Bus Services

- 3.16 IHT's 'Planning for Public Transport in Developments' report suggests 500m is the maximum distance people will walk to a bus stop, this is in circumstances where bus stops have a number of high frequency services. **Table 3.1** shows the IHT guidelines for the recommended maximum walking distances to bus stops, based on service frequency.

Table 3.2: Recommended Maximum Walking Distances to Bus Stops

Situation	Maximum Walking Distance
Core bus corridors with high-frequency services	500 metres
Single high-frequency routes	400 metres
Less frequent routes	300 metres
Town/city centres	250 metres

(Source: IHT)

- 3.17 The closest bus stops to the site are located on Commercial Road, on the eastern boundary of the site and in close proximity to the Laygate Street, Cone Street and Hill Street access points onto Commercial Road; with bus stops located within approximately 50m of each access point. Each bus stop on Commercial Road benefits from a flag and timetable information. For residents of the northern sections of the site, services from the B1344 and Coronation Street can be accessed in approximately 400m of the Cone Street access and the northern pedestrian access points (around a 5-minute walk); for residents living in the southern sections of the site, these services are located approximately 9 minutes' walk (700m). The bus stop on the B1344 offers a flag and timetable information; whilst from the Coronation Street stop, there is a shelter, raised kerbs, bus cage and timetable information.
- 3.18 It is noted that further bus services are available from Western Approach, approximately 650m east of the centre of site, which are accessible within around an 8-minute walk. Although further than the 500m preferred maximum distance to a core bus corridor, it would be anticipated that future residents and visitors would be willing to walk an additional 150m to access a wider range of frequent services. The bus stops on Western Approach can be accessed via the footways on Commercial Road and Tudor Road (which is located to the

immediate east of Cone Street) and benefit from a bus layby and timetable information; there is a shelter at the southbound stop.

- 3.19 **Figure 3.5** illustrates the locations of bus stops on Commercial Road, the B1344, Coronation Street and on Western Approach. A summary of the services available from these stops is provided in **Table 3.3**.

Figure 3.5: Bus Stop Locations



(Source: Google Maps)

Table 3.3: Bus Service Summary

Service	Route	Frequency		
		Mon - Fri	Saturday	Sunday
Commercial Road				
T503	South Shields - Boldon	60 mins	60 mins	-
B1344				
10	South Shields – Jarrow	30 mins	30 mins	30 mins
E1	Sunderland – South Shields	20 mins	30 mins	60 mins
Coronation Street				
2	South Shields Town Centre – Biddick Hall Estate	-	3 Services	5 Services
3	South Shields Town Centre – Biddick Hall Estate	12 mins	12 mins	30 mins
12	South Shields Mile End Road – South Shields The Lonnen	30 mins	30 mins	60 mins

18	South Shields Town Centre – Brockley Wins	12 mins	12 mins	30 mins
26	Jarrow – South Shields via Chichester	30 mins	30 mins	30 mins
27	Newcastle – South Shields via Gateshead – Heworth Metro – Hebburn – Jarrow – Tyne Dock	15 mins	15 mins	20 mins
960	South Shields – HMRC Waterview Park	2 Services	-	-
X20	South Shields – Fellgate	60 mins	60 mins	60 mins
Western Approach				
8	South Shields Market – Marsden	12 mins	12 mins	30 mins
17	South Shields Market – Whiteleas	12 mins	12 mins	30 mins
E2	Sunderland – South Shields	20 mins	30 mins	60 mins

(Source: PT Operators)

- 3.20 As can be seen in **Table 3.3**, the site is located within proximity of a number of frequent bus services. Bus services from Coronation Street and Western Approach in particular offer of high frequency services to a range of destinations including Newcastle, Sunderland, and Gateshead.

Metro and Rail Services

- 3.21 The closest Metro stations to the site are South Shields and Chichester, which are both located approximately 1.2km from the site. The South Shields Metro station would likely be more attractive for residents of the northern areas of the site, whilst the Chichester Metro station would be more attractive for residents of the southern sections of the site (dependent on the direction of travel).
- 3.22 South Shields Metro station can be accessed in around a 15-minute walk from the northern part of the site, a 4-minute cycle or in a 10-minute bus journey on the T503 service from Commercial Road. The station is a terminus station, which is located on the Yellow Line of the Tyne and Wear Metro. Regular services can be accessed from the station to destinations including Hebburn, Gateshead, Newcastle city centre, Whitley Bay, Jesmond, and Gosforth. Facilities at the station include ticket machines, shelters, emergency help points, bakery and Nexus Travel Shop; the platforms also have step-free access. It should also be noted that the station serves as an interchange, meaning that a wide range of bus services can also be accessed from the Metro station.
- 3.23 Chichester Metro station is accessible from the southern part of the site in around a 15-minute walk, 5-minute cycle ride or in a 6-minute journey on the T503 bus service from Commercial Road. The station is also located on the Yellow Line of the Tyne and Wear



Metro, benefitting from regular services to South Shields, Hebburn, Gateshead, Newcastle city centre, Whitley Bay, Jesmond, and Gosforth. Facilities at Chichester Metro station include ticket machines, 4no. bicycle lockers, help point, newsagent and step-free access.

- 3.24 Services from South Shields and Chichester can be utilised to access national rail services, from the Heworth Interchange, which is around an 18-minute journey from South Shields Metro. Heworth Interchange is on the Durham Coast Line, with regular services between Middlesbrough and Newcastle via Sunderland, Metrocentre, Hartlepool and Whitby. In addition, services on the Green Line of the Tyne and Wear Metro can be accessed from Heworth Interchange (as well as at the preceding station, Pelaw); services on the Green Line run between Newcastle Airport and Sunderland.

Ferry Services

- 3.25 The Shields Ferry is located approximately 700m north of the centre of the site and can be accessed in around a 10-minute walk or in a couple of minutes by bike (with the shortest route via the northern pedestrian access points onto the existing quayside). The Shields Ferry is a regular ferry service (which permits pedestrians and cyclists) which connects North and South Shields, crossing the River Tyne, and runs at a 30-minute frequency Monday – Sunday. The ferry represents a much shorter route across the River Tyne between North Shields and South Shields with an approximate 7-minute journey time, whilst the same journey would take 22 minutes by car or 37 minutes on the Metro.
- 3.26 It should be noted that the ferry service is operated by NEXUS, meaning that ticketing is integrated with other public transport services (including the Tyne and Wear Metro). The Shields Ferry would represent an attractive, regular, travel option for future residents and visitors wishing to access destinations including North Shields and Tynemouth, which is more direct than other public transport services.

Car Club

- 3.27 Car clubs provide those who do not have access to a private car with the ability to use a vehicle over short rental periods, and at short notice. They are ideal for those who do not need to use a car on a regular basis, but who wish to have access to a car for occasional trips. This, for many people, can avoid the need to own and pay for a car. They also have the potential to bring about wider benefits to the environment and result in less congestion, by reducing the number of private cars on the road.

- 3.28 The closest car club vehicle to the site is located at the South Tyneside Council offices, which are located approximately 1km northeast of the centre of the site. From the site, the car club vehicle can be accessed in around a 12-minute walk, or in a few minutes cycle. The car club vehicle is operated by Co-wheels which provides a BMW I3 EV for hire by registered users, prices for use of the vehicle start at £5.50 per hour (with no mileage charge). The location of the Co-wheels Car Club vehicle is provided in **Figure 3.6** below.

Figure 3.6: Co-Wheels Car Club Location



(Source: Co-Wheels Car Club)

Local Facilities

- 3.29 A wide range of local facilities are available within the preferred maximum walking (2km) or cycling (5km) distance; these are summarised in **Table 3.4**. It should be noted that these journey times have been taken from the centre of the site.

Table 3.4: Facilities Accessible by Sustainable Transport

Amenity	Distance	Walk Time	Cycle Time
Education			
The Yemeni School	300m	4 mins	1 min
Laygate Community School	750m	10 mins	3 mins
St Bede's RC Primary	850m	11 mins	4 mins
Marine Park Primary School	1.5km	19 mins	7 mins
Mortimer Community College	1.8km	23 mins	7 mins



Hadrian Primary School	1.9km	25 mins	7 mins
Westoe Crown Primary School	1.9km	25 mins	7 mins
South Tyneside College	1.9km	25 mins	7 mins
Mortimer Primary School	2km	23 mins	7 mins
Park View School / Ashley Primary School	2.2km	29 mins	9 mins
St Wilfred's RC College	2.7km	33 mins	10 mins
Harton Academy	3.4km	44 mins	13 mins
Bamburgh School	3.5km	45 mins	15 mins
Health			
Lloyds Pharmacy	600m	7 mins	2 mins
Trinity Medical / St George Medical Centre	700m	8 mins	2 mins
Asda Pharmacy	700m	8 mins	2 mins
MyDentist Westoe Road	1.1km	14 mins	4 mins
The Westoe Practice	1.2km	15 mins	5 mins
1A Dentist	1.2km	15 mins	5 mins
MyDentist Dean Road	1.3km	18 mins	6 mins
Wawn Street Surgery	1.4km	19 mins	7 mins
Stanhope Parade Health Centre	1.4km	19 mins	7 mins
Imeary Street Surgery	1.4km	19 mins	8 mins
Flagg Court Dental Practice	1.6km	20 mins	8 mins
Flagg Court Health Centre	1.6km	20 mins	9 mins
Ravensworth Surgery	1.7km	23 mins	9 mins
South Tyneside District Hospital	2.9km	38 mins	13 mins
Retail / Leisure			
The Trimmers Arms Pub / Music Venue	50m	1 min	1 min
Chinese Takeaway	80m	1 min	1 min
Green Street Local Centre (Shops / Post Office / Greggs / Lidl)	400m	5 mins	1 min
The Steamboat / River View / The Waterfront Milldam (Pubs and Bars)	600m	7 mins	2 mins
The Customs House Theatre	650m	8 mins	2 mins
Asda South Shields Superstore	700m	9 mins	3 mins
Home Bargains / Halfords	950m	12 mins	4 mins
Aldi / KFC / Iceland	1km	13 mins	4 mins
Chichester Local Shops (Pub / Takeaways / Shops)	1km	13 mins	4 mins
South Shields High Street (Shops / Cafes / Local Services)	1.1km	13 mins	4 mins
Waterloo Square (Next / River Island / Debenhams / B&M)	1.1km	13 mins	4 mins

Powerhouse Gym	1.1km	13 mins	4 mins
Morrison's Supermarket	1.4km	17 mins	5 mins
Imeary Street Local Shops	1.4km	19 mins	5 mins
South Shields Library	1.5km	19 mins	5 mins
Sainsbury's Local	1.5km	20 mins	6 mins
West Park	1.7km	22 mins	6 mins
Haven Point Leisure Centre	2.1km	26 mins	7 mins
Starbucks Coffee	2.1km	26 mins	7 mins
South Marine Park	2.1km	26 mins	9 mins
South Shields Beach / Ocean Beach Pleasure Park	2.3km	29 mins	9 mins
Tesco Superstore / McDonalds / Burger King	3.3km	41 mins	13 mins
Employment			
Rekendyke Industrial Estate	600m	7 mins	2 mins
South Shields Business Works	850m	11 mins	4 mins
Waverley Business Park	1km	13 mins	4 mins
Mitre Place Industrial Units	1.2km	15 mins	4 mins
Port of Tyne	1.6km	20 mins	6 mins
Wapping Street	2km	25 mins	7 mins
Bede Industrial Estate	3.1km	38 mins	12 mins

(Source: Google Maps)

Summary of Accessibility

- 3.30 As has been discussed in this section, the site is located in a highly accessible location close to South Shields town centre. A range of local opportunities for walking, cycling and travel by public transport have been identified, demonstrating that future residents of the site would not require the use of a car to access amenities such as education, health, retail & leisure and employment.
- 3.31 Furthermore, the local public transport options include high-frequency bus services and regular Tyne and Wear Metro services, meaning that a range of local and regional destinations can be accessed. It is, therefore, considered that the development of the site for residential use is consistent with national and local policy objectives.

4. LOCAL HIGHWAY NETWORK


Introduction

- 4.1 This section of the Transport Assessment considers the nature of the existing highway network, and summaries the historic accident data for the area surrounding the site.

Highway Network

- 4.2 A description is provided below of the key routes in the vicinity of the site; for ease, it is also shown in **Figure 4.1**.

Figure 4.1: Existing Highway Network

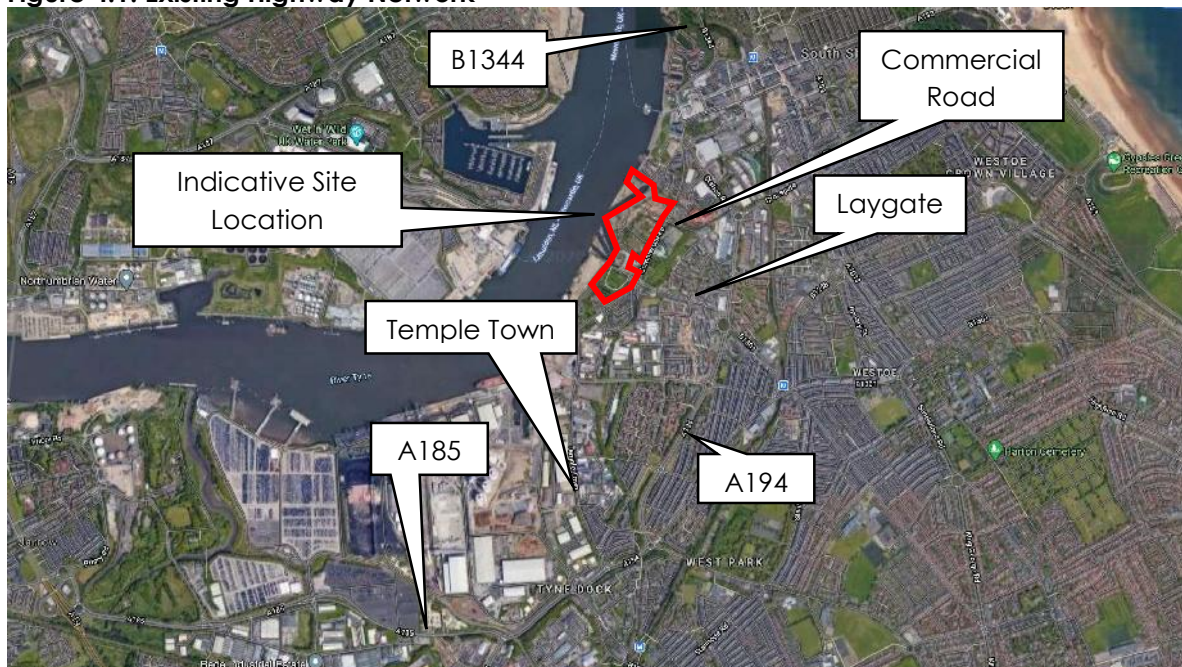

(Source: Google Maps)

Commercial Road

- 4.3 As discussed previously, access to the site is predominantly taken from Commercial Road, via 4no junctions on the eastern boundary of the site. Commercial Road runs broadly northeast – southwest between the Harton Quay / B1344 / Coronation Street / Station Road / Commercial Road roundabout and Corstophine Town. It is approximately 8.9m wide in the vicinity of the site and is subject to a 30mph speed limit.
- 4.4 In the vicinity of the site access points, there are a number of traffic regulation orders (TROs). At the Cone Street access point (the most northern vehicle access onto Commercial Road), there is double yellow lining which prohibits stopping, waiting, and loading at all times.



Double yellow lining is also in place at the Nile Street, Hill Street and Laygate Street access points on the western side of the carriageway only. To the south of the Cone Street access, there is a single yellow line restriction, which prohibits stopping Monday – Saturday 08:00 – 18:00 this restriction continues for approximately 240m along the eastern side of the carriageway beginning to the south of Cone Street and terminating opposite the Trimmers Arms which is located to the south of the Hill Street access; double yellow lining is then in place at the staggered T-junction of Laygate / Commercial Road and Laygate Street.

B1344

- 4.5 The B1344 forms the northern approach to the Harton Quay / B1344 / Coronation Street / Station Road / Commercial Road roundabout, located to the north of the site. The B1344 broadly follows the coastline of South Shields, terminating to the east close to the Ocean Beach Pleasure Park. In the vicinity of the site, it is approximately 7.4m wide and is subject to a 30mph speed limit. There is double yellow lining in place, to prohibit stopping or waiting at all times in the vicinity of Commercial Road.

Corstophine Town / Temple Town

- 4.6 Corstophine Town forms the southern terminus of Commercial Road at a junction with West Holborn (from which an additional access to the development is proposed). Corstophine Town runs broadly north – south between the West Holborn / Commercial Road / Corstophine Town junction and Smith Street; it then continues southward as Temple Town, towards the A194. Both Corstophine Town and Temple Town form a direct route between the site and the A194; whilst more broadly they form a direct route between the A194 and South Shields town centre via Commercial Road and serve as an access to the industrial and residential areas to the south of the site.
- 4.7 In the vicinity of the site, Corstophine Town is approximately 6.8m wide and subject to a 30mph speed limit. There is double yellow lining, which prohibits stopping and waiting at all times on both sides of Corstophine Town and Temple Town.

Laygate

- 4.8 Laygate forms the eastern approach to the staggered T-junction of Laygate Street (a site access) / Commercial Road / Laygate located to the southeast of the site. Broadly Laygate runs east – west between Commercial Road and the Laygate / Western Approach / B1301 / A194 / New George Street roundabout (forming the western approach). It is approximately 7.8m wide and subject to a 30mph speed limit. Double yellow lining, which prohibits stopping or waiting at all times is in place on both sides of the carriageway, however, there are



sections of on-street parking available on the southern side of the carriageway between Rekendyke Lane and Havelock Street.

A194

- 4.9 The A194 forms the southern approach to the Laygate / Western Approach / B1301 / A194 / New George Street roundabout and runs broadly northeast – southwest and facilitates one of the main routes into South Shields town centre and also runs to Washington in the west; it can also be used to access the A19 at the Lindisfarne Roundabout. It forms part of Highways England's Strategic Road Network (SRN) and is a dual-carriageway with a 40mph speed limit in the vicinity of the site.


A185

- 4.10 The A185 meets the A194 at the A185 / A194 Newcastle Road junction, located to the south of the site. Broadly, the A185 runs east – west between Tyne Dock and Heworth via Jarrow and forms one of the primary routes within the area. The A185 would also represent an attractive route for vehicles wishing to access destinations to the west and to the A19. It is approximately 7.3m wide and subject to a 30mph speed limit.

Road Safety

- 4.11 Accident data for the most recent 5-year period (2015 - 2020) has been obtained from the Traffic Accident Data Unit (TADU), which provides accident data for the Tyne and Wear district. The extent of the scope of accident data requested from TADU is illustrated in **Figure 4.2** overleaf, however, this scope was selected to include the following routes / junctions located in the vicinity of the site, including:
- Commercial Road / Corstophine Town / Temple Town;
 - Laygate / Western Approach / B1301 / A194 / New George Street roundabout;
 - A194 and Lindisfarne Roundabout; and
 - A185.

Figure 4.2: Scope of Accident Data Requested

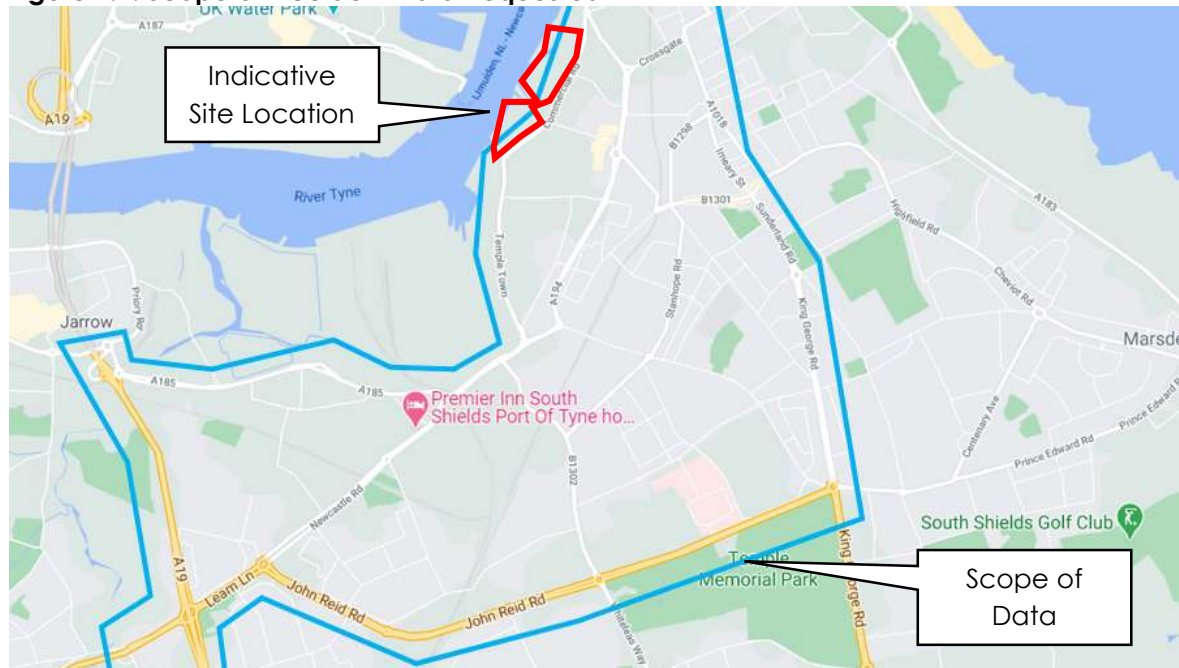

(Source: Google Maps)

- 4.12 As can be seen in **Figure 4.2**, the scope of the accident data requested is extensive and covers a significant part of the local highway network in South Shields as well as major routes, including the A194, A185 and A19. Given the scale of the network identified, the assessment of accident analysis has focused on the primary routes and junctions in the vicinity of the site where development trips would likely travel (based on the gravity model discussed in **Section 5**). The full accident dataset is provided at **Appendix B**.

Commercial Road / Corstophine Town / Temple Town

- 4.13 In the immediate vicinity of the site, at the proposed access points on Commercial Road; a total of 5 slight accidents were recorded across the most recent 5-year period. Of the 5 accidents, 3no were recorded close to the staggered T-junction of Laygate Street / Commercial Road / Laygate , 1no was recorded to the south of the Hill Street access whilst 1no accident was recorded close to the Cone Street access. A total of 5 accidents along Commercial Road does not indicate an existing road safety issue, equating to an average of just 1 accident per year. To the south of Commercial Road, a total of 3no slight accidents have been recorded on Corstophine Town and Temple Town. Of the accidents recorded, all were recorded at the junction with the A194 at the southern terminus of Temple Town. Again, the number of accidents does not suggest a significant existing road safety issue, with an average of less than 1 accident per year.



Laygate / Western Approach / B1301 / A194 / New George Street roundabout

- 4.14 To the east of the site, at the Laygate / Western Approach / B1301 / A194 / New George Street roundabout a total of 15 accidents were recorded over the most recent 5-year period. Of the accidents recorded, 14 were slight in nature, whilst 1 was serious (ref: 0185423). The serious accident was recorded on the A194 on the southern approach to the roundabout and occurred when a pedestrian (who ran out into the road to cross), was struck by a vehicle travelling westwards on the A194 whilst speeding. Furthermore, it should be noted that no accidents were recorded on Laygate, which connects the junction to Commercial Road (where access to the site is primarily taken).
- 4.15 In terms of the 14 slight accidents, these were predominately recorded at the northern (Western Approach) and western (Laygate) approaches, however, there is no significant clustering of accidents at the roundabout.

A194

- 4.16 As has been discussed previously, the A194 is one of the main routes into South Shields and runs to the east and south of the site; it is an attractive route for those wishing to travel westward towards the A19 and on to Washington. In total, 61 accidents were recorded along the A194 between the Laygate / Western Approach / B1301 / A194 / New George Street roundabout and the A194 Leam Lane / A19 (Lindisfarne Roundabout) over a distance of approximately 3.5km, including 8 key junctions.
- 4.17 Of these, 56 were slight and 5 were serious, with no fatalities recorded. A total of 7 accidents (6 slight, 1 serious) were recorded away from junctions, whilst the remaining 54 accidents were recorded at junctions along the A194. The serious accident recorded on the A194 carriageway (away from a junction) was recorded to the east of the Lindisfarne Roundabout on 13/06/2018 (ref: 0301030) and occurred when a motorcycle collided with the rear of a car which was stationary in traffic.
- 4.18 The junction which had the highest number of accidents recorded along the A194, was the A194 Leam Lane / A194 Hadrian Road / A1300 John Reid Road junction, where 14 slight accidents were recorded; equating to an average of around 3 accidents per year, with no serious or fatal accidents recorded. At the A194 Newcastle Road / Henderson Road / Shaftesbury Avenue staggered T-junction (which is used to access a Tesco Superstore, McDonald's, and Burger King) a total of 9 accidents were recorded, of which 8 were slight



and 1 was serious. The serious accident at the junction occurred 01/03/2017 (ref: 0159363) and was attributed to a vehicle disobeying an automated traffic signal and colliding with another vehicle, which was crossing the carriageway on the Shaftesbury Avenue approach. At the A185 / A194 Jarrow Road / A194 Newcastle Road junction, 6 accidents were recorded, of which 5 were slight and 1 was serious.

- 4.19 The serious accident recorded at the A185 / A194 Jarrow Road / A194 Newcastle Road junction was recorded on the A185 approach on 06/07/2019 (ref: 0859294); it was caused when a stolen vehicle (whose driver was impaired by alcohol) collided with a raised area after losing control.
- 4.20 There have been 7 accidents recorded at the A194 Jarrow Road / Port of Tyne Access / B1302 roundabout junction; 5 were slight and 2 were serious. The first serious accident was recorded 22/08/2019 (ref: 0870785) and occurred when a vehicle travelling around the roundabout at speed lost control and collided with a pedestrian. The second serious accident was recorded 05/07/2020 (ref: 0962075) and occurred when a vehicle collided with the external wall of the Port of Tyne, no causation factor is provided for this collision.
- 4.21 Additional accidents on the A194 were also recorded at the junctions with Temple Town, West Way, Barnes Road and Reed Street. At the A194 / Temple Town junction, 3 slight accidents occurred; at the A194 / West Way junction, 2 slight accidents occurred and at the A194 / Barnes Road junction 5 slight accidents occurred. No accidents have been recorded at the A194 / Reed Street junction in the most recent 5-year period.
- 4.22 In summary, the total quantum of 64 accidents recorded along the A194 in the vicinity of the site represents an average of around 13 accidents per year, over a stretch of carriageway which is approximately 3.5km in length and includes 8 junctions. Accidents recorded along the A194 were predominantly slight in nature, with only 5 serious accidents recorded and no fatalities. Considering the above, it is not anticipated that there is a notable road safety issue along the A194 in the vicinity of the development site.

Lindisfarne Roundabout (A194 Leam Lane / A19)

- 4.23 The Lindisfarne Roundabout is the junction of the A194 Leam Lane / Lindisfarne Road / A19. Over the most recent 5-year period a total of 18 accidents were recorded, of which 16 were slight and 2 serious. The first serious accident at the junction was recorded on the northbound off-slip from the A19 to the roundabout on 11/03/2016 (ref: 0050799) and



occurred when a vehicle lost control on the off-slip and collided with a tree. The second serious accident at the junction was recorded on 04/09/2017 on the eastern A194 Leam Lane approach (ref: 0256716); this accident occurred when a vehicle suddenly braked, causing another vehicle to collide with the rear end. Given the nature of the junction and the routes which meet at it (the A19 and A194) as well as high level of traffic, a total of 18 accidents with an average of around 4 accidents per year would not suggest a significant road safety issue.

A185

- 4.24 The A185 is located broadly south of the site and represents another major route into South Shields; it is an attractive route for those wishing to travel west to areas including Jarrow, and onto the A19 Tyne Tunnel. Over the most recent 5-year period, a total of 18 accidents have been recorded along the A185 between the A185 / A194 Jarrow Road / A194 Newcastle Road junction and the A185 / Priory Road / A19 junction; of these 12 were slight, 5 were serious and 1 was fatal. The level of recorded accidents along this section of the A185 is relatively low given the nature of the route (as a primary route westwards to the A19).
- 4.25 A total of 9 accidents were identified as occurring within the carriageway of the A185 or at minor junctions with the A185; of these 6 were slight, 2 were serious and there was 1 fatality. The first serious accident recorded along the carriageway of the A185 occurred on 11/07/2016 (ref: 0084551) when a vehicle travelling eastwards unexpectedly swerved into the path of the oncoming westbound traffic (with no reasoning provided) and collided head on with the oncoming westbound vehicle. The second serious accident occurred on 20/07/2016 (ref: 0088213), the accident involved a vehicle exiting the nursery carpark onto A185 and colliding with a motorcycle, which was travelling westwards along the A185. A fatality occurred along the A185 on 28/07/2019 (ref: 0864486) when a motorcyclist lost control for reasons unknown and collided with a lamp post.
- 4.26 At the junction of the A185 / Church Bank, 3 accidents were recorded, of which 1 was slight and 2 were serious. The first serious accident occurred 05/02/2018 (ref: 0265255) and involved a vehicle turning right into Church Bank failing to see an oncoming motorcycle travelling eastbound. The second serious accident occurred on 12/11/2018 (ref: 0343737) when a vehicle exiting Church Bank also collided with a motorcycle that was travelling along the A185.

- 4.27 The junction of the A185 / Priory Road / A19 is located at the western extent of the scope of data obtained from TADU. It was identified that a total of 5 accidents were recorded at the junction in the most recent 5-year period; of which 4 were slight and 1 was serious. Given the nature of the junction as a route onto the A19 and as a route westwards from South Shields, this level of accidents is low with an average of less than 1 accident per year. The serious accident recorded at the junction was recorded at the Priory Road approach and occurred 20/10/2016 (ref: 0117968); the accident occurred when a vehicle turning onto Priory Road from the A185 collided with a cyclist who was crossing Priory Road.

Summary

- 4.28 This section of the Transport Assessment provides a description of the local road network in the vicinity of the site. It also includes an analysis of accident trends occurring on significant local routes and junctions, to establish whether there are any existing road safety issues, which might be exacerbated by development traffic.
- 4.29 A total of 118 accidents have been recorded across the network; the majority (61) were recorded along the A194, which forms the primary route within the study area and the largest section which incorporated the most carriageway and junctions of that assessed. Only 5 accidents were recorded along Commercial Road where access to the site will be predominately taken (all of which were slight), indicating no pre-existing threat to road safety in the immediate vicinity of the proposed site access locations.
- 4.30 **Table 4.1** summarises the total number of accidents by year and severity across the network assessed.

Table 4.1: Accidents by Year and Severity

	2015	2016	2017	2018	2019	2020	Total
Slight	12	16	29	25	12	11	105
Serious	0	4	3	3	3	0	13
Fatal	0	0	0	0	1	0	1
Total	12	20	31	38	16	12	118

(Source: TADU)

- 4.31 Given the overall quantum and severity of accidents identified across the network and the low level of accidents recorded in the immediate vicinity of the site; it is not considered that there are any significant road safety issues, which might be exacerbated by the addition of development traffic.



5. TRIP GENERATION & DISTRIBUTION

Introduction

- 5.1 This section of the Transport Assessment sets out the trip generation associated with the proposed 350 dwellings and the likely distribution of these trips on the local highway network. The latter part of this section discusses the resultant impact of the anticipated development trips on the highway network.

Development Proposals

- 5.2 As can be seen on the proposed site masterplan, provided at **Appendix A**, the Holborn Riverside development will comprise 350 dwellings, which will be a mix of privately owned and affordable houses and apartments. In summary, the following quantum of dwellings are proposed:

Houses

- 194 – Privately Owned; and
- 25 – Affordable.

Apartments

- 103 – Privately Owned; and
- 28 – Affordable.

Trip Rates & Resultant Trip Generation

Privately Owned Houses

- 5.3 The TRICS database has been used to determine the trip rates and resultant traffic generation associated with the 194 privately owned houses. The following TRICS parameters have been used:
- Land Use: Residential, Housing Privately Owned;
 - Number of Dwellings: 5 – 500 Dwellings;
 - Date Range: 01/01/2011 – 19/11/2019; and
 - Location: Edge of Town Centre.

- 5.4 **Table 5.1** summarises the trip rates and resultant vehicle trip generation associated with the proposed dwellings, whilst the TRICS output is provided at **Appendix C**.

Table 5.1: Vehicle Trip Rates & Resultant Trip Generation (Privately Owned Houses)

	AM			PM		
	Arrival	Departure	Two-Way	Arrival	Departure	Two-Way
Trip Rates	0.142	0.246	0.388	0.284	0.148	0.432
Trip Generation	28	48	75	55	29	84

(Source: TRICS)

- 5.5 As can be seen in **Table 5.1**, the 194 privately owned houses at the site would be anticipated to generate 75 two-way vehicle trips in the AM peak hour and 84 two-way vehicle trips in the PM peak hour.

Affordable Houses

- 5.6 The TRICS database has been interrogated to obtain representative vehicle trip rates for the 24 affordable houses proposed at the site. The following TRICS parameters have been used:
- Land Use: Residential, Affordable / Local Authority Houses;
 - Number of Dwellings: 11 – 516 Dwellings;
 - Date Range: 01/01/2012 – 19/10/2018; and
 - Location: Edge of Town Centre, Suburban Area.

- 5.7 The vehicle trip rates, and resultant trip generation associated with the 25 affordable houses is summarised in **Table 5.2** below; whilst the TRICS output is provided at **Appendix C**.

Table 5.2: Vehicle Trip Rates & Resultant Trip Generation (Affordable Houses)

	AM			PM		
	Arrival	Departure	Two-Way	Arrival	Departure	Two-Way
Trip Rates	0.131	0.164	0.295	0.239	0.194	0.433
Trip Generation	3	4	7	6	5	11

(Source: TRICS)

- 5.8 As can be seen in **Table 5.2**, the proposed 24 affordable dwellings are anticipated to generate 7 two-way vehicle trips in the AM peak and 11 two-way vehicle trips in the PM peak.

Privately Owned Apartments

5.9 The TRICS database has been interrogated to obtain representative vehicle trip rates for the proposed 103 privately owned apartments which are proposed at the site. The following TRICS parameters have been used:

- Land Use: Residential, Flats Privately Owned;
- Number of Dwellings: 6 – 215 Dwellings;
- Date Range: 01/01/2012 – 18/11/2019; and
- Location: Edge of Town Centre

5.10 **Table 5.3** summarises the representative vehicle trip rates and resultant trip generation associated with the 103 privately owned apartments proposed at the site. The full TRICS output is provided at **Appendix C**.

Table 5.3: Vehicle Trip Rates & Resultant Trip Generation (Privately Owned Apartments)

	AM			PM		
	Arrival	Departure	Two-Way	Arrival	Departure	Two-Way
Trip Rates	0.040	0.194	0.234	0.142	0.080	0.222
Trip Generation	4	20	24	15	8	23

(Source: TRICS)

5.11 As can be seen in **Table 5.3**, the 103 privately owned apartments proposed at the site would be anticipated to generate 24 two-way vehicle trips in the AM peak hour and 23 two-way vehicle trips in the PM peak hour.

Affordable Apartments

5.12 The TRICS database has been interrogated to obtain representative vehicle trip rates and resultant trip generation associated with the 28 affordable apartments. In order to derive representative vehicle trip rates, the following parameters of the TRICS database have been selected:

- Land Use: Residential, Affordable / Local Authority Flats;
- Number of Dwellings: 6 – 234 Units;
- Date Range: 01/01/2012 – 28/06/2019; and
- Location: Edge of Town Centre, Suburban Area.

- 5.13 The vehicle trip rates, and resultant vehicle trip generation associated with the 28 affordable apartments is summarised in **Table 5.4**; the full TRICS output is provided at **Appendix C**.

Table 5.4: Vehicle Trip Rates & Resultant Trip Generation (Affordable Apartments)

	AM			PM		
	Arrival	Departure	Two-Way	Arrival	Departure	Two-Way
Trip Rates	0.103	0.150	0.253	0.125	0.128	0.253
Trip Generation	3	4	7	4	4	8

(Source: TRICS)

- 5.14 As can be seen above, the proposed 28 affordable apartments at the site are anticipated to generate 7 two-way vehicle trips in the AM peak hour and 8 two-way vehicle trips in the PM peak hour.

Total Vehicle Trip Generation – Houses and Apartments

- 5.15 **Table 5.5** summarises the total vehicle trip generation associated with the proposed 350 dwellings.

Table 5.5: Vehicle Trip Generation (Total Development)

	AM			PM		
	Arrival	Departure	Two-Way	Arrival	Departure	Two-Way
Proposed Houses						
194 Privately Owned Houses	28	48	75	55	29	84
25 Affordable Houses	3	4	7	6	5	11
Proposed Apartments						
103 Privately Owned Apartments	4	20	24	15	8	23
28 Affordable Apartments	3	4	7	4	4	8
Total Development (350 Dwellings)						
Total Development	38	76	114	80	46	126

(Source: TRICS / Consultant Calculation)

- 5.16 As can be seen in **Table 5.5**, in total the development is anticipated to generate 114 two-way vehicle trips in the AM peak and 126 two-way vehicle trips in the PM peak. The remainder of this section discusses the anticipated distribution of these vehicle trips across the highway network.

Trip Distribution

- 5.17 In order to distribute the trips associated with the proposed development on the local road network, a gravity model has been prepared. Census 2011 data 'Location of Usual Residence and Place of Work' has been used to determine the employment locations of existing residents in the vicinity of the site (MSOA South Tyneside 002), given that it is reasonable to assume that future residents will exhibit similar commuting patterns to existing residents.
- 5.18 A journey planner has then been used to identify the most direct route between the MSOA within which the site is located and each of the employment destination MSOAs. Where there is more than one practical route, traffic has been split according to the relative attractiveness of each route.
- 5.19 A summary of the routes and the proportion of development trips likely to use them is provided in **Table 5.6**; the full details are provided at **Appendix D**, whilst network flow diagrams showing the distribution are provided at **Appendix E**.

Table 5.6: Summary of Gravity Model Distribution

Route	Proportion
Commercial Road N – B1344 N	34%
Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W	24%
Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - B1302 S	9%
Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW	8%
Commercial Rd S - Laygate E - B1301 E	8%
Commercial Rd S - Corstophine Town S - Temple Town S	7%
Commercial Rd S - Laygate E - A194 S - Westway E	5%
Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A19 S	3%
Commercial Rd S - Laygate E - A194 S - Westway E - King George Rd S	2%
Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW	1%
Total	100%

(Source: Consultant Calculation)

Materiality

- 5.20 **Table 5.7** summarises the anticipated levels of development trips by junction based on the aforementioned gravity model distribution. The distribution of development trips across the highway network is illustrated in the network flow diagrams provided at **Appendix E**.

Table 5.7: Development Trips by Junction

Junction	Development Trips	
	AM	PM
Commercial Road / Cone Street - Site Access	32	35
Commercial Road / Nile Street – Site Access	32	35
Commercial Road / Hill Street - Site Access	32	35
Commercial Road / Laygate Street - Site Access	9	11
West Holborn / Site Access	9	11
Laygate Street / Commercial Road / Laygate	76	83
Temple Town / A194	59	66
A194/ B1302	50	55
B1344 / Coronation Street / Station Road / Commercial Road	39	43
A194 / A185 / A194 Newcastle Road	39	44
A185 / B1297 Priory Road / A19	27	30
A194 Newcastle Road / Auckland Terrace / A1300 John Reid Road / A194 Leam Lane	12	14
A194 Leam Lane / Hadrian Road / A19 (Lindisfarne Roundabout)	13	13
Laygate / Western Approach / B1301 / A194 / New George Street	16	18
A194 / Dean Road / West Way	15	16

(Source: Consultant Calculation / Gravity Model)

- 5.21 As can be seen in **Table 5.7** above, the development proposals could potentially have a material impact (typically regarded as above 30 two-way vehicle trips in either peak hour) at a number of junctions. Further consideration has been given to each off-site junction, in turn.
- 5.22 It should be noted that the above figures provide very much a worst-case scenario; firstly they assume that all trips reach the extremities of the study network; in reality, given the geographical extents of the study area and the density of the built up area, a significant proportion of trips would be 'lost' within the network itself, with traffic dissipating at local junctions. The further a junction is located from the development site, the more pronounced this affect will be.



- 5.23 Secondly, the figures take no account of the likely impact of travel planning activities that will be delivered at the site; a comprehensive package of measures is proposed that seek to limit the traffic impact of the development proposals.
- 5.24 It should also be borne in mind that at the time of preparing this Transport Assessment, the UK was in the midst of the COVID-19 pandemic (and in a third national lock-down as a consequence). It is not possible, therefore, to collect valid traffic counts. Reference has been made to both the planning portal and TADU / DfT counters to determine whether any suitable, historic, traffic data could be obtained. Similarly, a number of survey companies were contacted to determine whether they hold any data for the junctions within the study area. However, available data was either deemed to be too old or did not relate to the areas of the network where the likely impact of the proposals might be material. A first principles approach has therefore been taken, which considers the likely historic traffic movements (at a high level) and the relative impact of the development proposals.

Laygate Street / Commercial Road / Laygate

- 5.25 The junction is a staggered cross-roads incorporating back-to-back right-turn ghost island facilities. Laygate Street, which forms the eastern arm, previously provided a principal vehicle access route to the southern docklands area. As such it would have previously catered for a significant volumes of vehicle trips (including by large vehicles). Whilst the docklands are now derelict, clearly the junction has previously operated with much higher traffic movements than it currently does.
- 5.26 The development proposals are anticipated to add 76 two-way trips through this junction in the AM peak hour and 83 two-way trips in the PM peak hour; this is equivalent to just over one additional vehicle per hour in either peak. In the context of the former uses served off this junction, it is reasonable to conclude that with the addition of development trips, the junction will continue to operate satisfactorily (with a greater level of reserve capacity than it might have done historically).

Temple Town / A194

- 5.27 This is a four-arm roundabout junction, located over 1km south of the development site. Temple Town follows the route of the River Tyne, north via an established industrial area, towards the former docklands site, where the proposed development will be located.
- 5.28 The proposals are anticipated to generate 59 two-way trips through the junction in the AM peak hour and 66 two-way trips in the PM peak hour, equivalent to one additional vehicle per minute. Again, this is very much a worst-case scenario, given the lack of discounting for



the impact of Travel Plan measures and the fact that the junction is located some distance from the development and thus traffic will likely have dissipated somewhat before it reaches here.

- 5.29 In the context of the role this junction would have previously played in providing a vehicular route to the docklands area, it is considered that the additional traffic as a consequence of the development proposals will not result in any capacity issues of note.

A194 / B1302

- 5.30 This 4-arm roundabout is located to the south east of the aforementioned Temple Town junction, well over 1km from the site, and provides access to the Port of Tyne. The impact here is 50 two-way trips in the AM peak and 55 in the PM peak.
- 5.31 As with the previous junctions, this is very much a worst-case scenario, and it is considered that less than one additional trip per minute through the junction (in the context of the role this junction would have previously played in providing a vehicular route to the docklands area) is unlikely to have a discernible impact on capacity.

B1344 / Coronation Street / Station Road / Commercial Road

- 5.32 This is a large 5-arm roundabout within the centre of South Shields; the proposals would result in an anticipated uplift of just 39 two-way trips in the AM peak and 43 two-way trips in the PM peak at this location, i.e. marginally in excess of the 30 two-way trip materiality threshold. Once due consideration has been given to the impact of proposed travel planning activities, the proposals are likely to generate in the order of one additional vehicle through the junction every two minutes in either peak hour. This could not be considered to have a noticeable impact on junction capacity.

A194/ A185 / A194 Newcastle Road

- 5.33 This 3-arm roundabout is located around 2km south west of the development site, with both the A194 and Newcastle Road providing access to the A19. In the worst case scenario, 39 additional two-way trips would be anticipated at this junction in the AM peak, with 44 additional two-way trips in the PM peak.
- 5.34 Given the distance between the site and this junction, in reality a proportion of trips will have dissipated throughout the local network and would not, therefore, reach this junction. Furthermore, on the basis that the junction would have previously been used by a significant volume of traffic travelling to / from the docklands, it is considered that the development-



related traffic could be accommodated without an undue detrimental impact on capacity.

Summary of Traffic Impact

- 5.35 It has been clearly demonstrated that the development site benefits from an excellent location, in terms of access to sustainable modes of transport. Furthermore, Cussins & Keepmoat Homes are committed to maximising the use of these modes amongst future residents of the development, as set out in the accompanying Travel Plan, by promoting and incentivising alternative modes to the car for local / regional trips.
- 5.36 The likely trip generation of the proposals has been estimated on the basis of representative TRICS sites, with distribution reflecting 2011 Census Journey to Work data. Junctions at which the proposals are anticipated to result in an uplift in peak hour trips of 30 or more have been given further consideration. Taking account of the potential impact of travel planning measures, the previous (extensive) docklands development use on the site and the likely traffic associated with this, along with the likelihood that traffic will dissipate through the local road network (and thus not all trips will reach the extremities of the network), it has been demonstrated that the (net) impact of the proposals is likely to be minimal at any given off-site junction and thus no further operational assessments have been undertaken.



6. ACCESS, PARKING AND SERVICING

Introduction

- 6.1 This section of the Transport Assessment considers the proposed access, parking and servicing arrangements for the site.

Access

- 6.2 Given the scale of the development proposals and the historic layout, access to the site will be taken from a number of locations.
- 6.3 Vehicle access to the site will be predominantly taken from Commercial Road which runs along the eastern boundary of the site; where 4no. access points are proposed. A further vehicle access point is proposed onto West Holborn on the southern boundary of the site. The vehicle access points onto Commercial Road will broadly retain the existing access points used previously by the docklands at the site, which are known as Cone Street, Nile Street, Hill Street and Laygate Street.
- 6.4 In addition to the vehicle access points to the site (where pedestrian access will also be taken), further pedestrian links onto the surrounding footway network are proposed. On the northern boundary, 2no pedestrian links are proposed, which will connect to the existing quayside and on to Riverside Court. On the eastern boundary an access point will be provided to the north of Cone Street, whilst a further pedestrian access is proposed onto Commercial Road, close to the south-eastern corner of the site. The inclusion of the additional pedestrian links into the site will increase pedestrian permeability to the site and improve connectivity with local amenities.
- 6.5 The locations of the proposed vehicle and pedestrian access points have been previously illustrated in **Section 3** of this Transport Assessment and can be found at **Figure 3.2**.

Parking

Car Parking

- 6.6 Residential parking standards are provided by South Tyneside Council in SPD6 'Parking Standards (December 2010)'; these standards state that for all residential developments in the 'urban area', the following maximum standard applies:
- 2 spaces per dwelling; and



- 1 space per 3 dwellings for visitor parking.

6.7 Considering the maximum parking standards provided by South Tyneside Council, the development will be permitted a maximum of 700 resident parking spaces and 117 visitor parking spaces; with a maximum total of 717 spaces permitted. The proposals have been designed to accord with standards, as shown on the Plan at **Appendix A**.

Cycle Parking

6.8 Cycle parking standards for residential developments are also provided by South Tyneside Council in SPD6 'Parking Standards' (December 2010), these standards include the following requirements:

- Dwelling Houses and Flats: 1 cycle space per dwelling.
- Local Authority / Housing Association Dwellings: 1 cycle space per dwelling plus 1 space per 5 dwellings for visitors.

6.9 Cycle parking will, be provided across the site in accordance with the cycle parking standards set by South Tyneside Council. This will serve to encourage local trips by bike, thereby reducing the traffic impact of the proposals.

Servicing

6.10 General servicing and deliveries will take place within the site; the internal layout is provided at **Appendix A** and has been designed in accordance with local standards; servicing will be undertaken from the roadside.

Refuse

6.11 Refuse collection will be undertaken by South Tyneside Council in line with the refuse collection in the surrounding residential areas.

Fire Appliance Access

6.12 Manual for Streets (MfS) indicates that the access requirement for emergency vehicles are generally stipulated by the Fire Service. Consulting national guidance, *The Building Regulations 2010 'Fire Safety' (2013) Approved Document B Section 5 'Access and Facilities for the Fire and Rescue Service'*, Table 8 of the document sets out that 'Typical Fire and Rescue Service Vehicle Access Route Specification' which stipulates that a minimum road width of 3.7m be provided and turning facilities should be provided in any cul-de-sac that



is more than 20m long. Fire tenders and emergency vehicles will access the site from the vehicle access points on Commercial Road and West Holborn.



7. SUMMARY & CONCLUSIONS

Summary

7.1 This Transport Assessment has been prepared to accompany a planning application for a planning application for a residential development comprising 350 dwellings at Holborn Riverside located to the west of Commercial Road, South Shields. The following summarises the key findings:

- The development proposals form a major part of the regeneration of the Holborn Riverside, located to the southwest of South Shields. The proposals seek to provide a mixture of affordable and privately owned houses and apartments on the site which will contribute towards the regeneration of Holborn and the wider South Shields area;
- The site has been allocated for residential development by South Tyneside Council as part of "The South Tyneside Strategic Housing Land Availability Assessment" (reference: SOS014 Holborn - South Shields Riverside);
- The allocation of the site for residential development highlights an acceptance of the principle of development in the order of the quantum / type proposed, and the associated traffic impacts;
- The site benefits from good connectivity with the facilities and amenities available in the local area, including in South Shields town centre, with opportunities for residents to travel by active / sustainable travel modes to reach these;
- Furthermore, the new pedestrian links to / from the site will enhance connectivity and permeability of the site;
- An analysis of contemporary accident data suggests that there are no significant accident trends that might be exacerbated by the addition of development-related traffic;
- The development proposals are anticipated to generate 114 two-way vehicle trips in the AM peak hour and 126 two-way vehicle trips in the PM peak hour;
- Development trips have been distributed in accordance with a gravity model, based on 2011 Census origin – destination travel to work data;
- A materiality assessment has been undertaken; this has highlighted a number of off-site junctions at which the proposals might have a material impact on highway capacity. Where this is the case, further consideration has been given to the relative impact of the development traffic;



- It is considered that in the context of the previous (historic) uses of the development site, the dissipation of traffic through the local road network and the positive consequences of a package of travel planning measures being delivered at the site, that the residual traffic impact of the proposals would not be severe (thereby satisfying the requirements of NPPF).

Conclusion

- 7.2 Given the findings of this Transport Assessment, there are considered to be no substantive highways grounds why the development should not be granted consent.



Appendix A

Indicative Site Layout



Appendix B

Accident Data

Slight Accident

Involving 2 Vehicle, 1 Casualty

P674815

Location	South Tyneside A 185 434047E, 564856N	Date/Time	Thursday 05 November 2015 17:00
Road	Single Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Male, 52 Not requested Postcode: NE49 9HB Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 37 Not requested Postcode: NE34 7JN Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	37	Not a bus or coach passenger
NE34 7JN		

***Description
of Location***

SWINBURNE STREET APPROX 50 MTRS EAST OF CHURCH BANK JARROW

***Description
of Accident***

V2 TRAV NORTH EAST ON SWINBURNE STREET WHEN IT HAS STOPPED IN TRAFFIC DUE TO LIGHTS. V1 TRAV BEHIND FAILED TO SEE V2 HAS STOPPED AND TRIED TO AVOID A COLLISION BY STEERING LEFT BUT COLLIDED WITH V2 REAR NEAR SIDE.

Slight Accident

Involving 3 Vehicle, 1 Casualty

P697715

Location	South Tyneside A 19 433664E, 564158N	Date/Time	Monday 16 November 2015 07:40
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (B) Failed to look properly (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 31 Driver not contacted at time of accident Postcode: DH1 2QT Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 26 Driver not contacted at time of accident Postcode: SR8 2HD Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 3 Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Female, 49
Negative
Postcode: SR8 3ST
Commuting to/from work

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit vehicle 2
Back
None
None

Movement Vehicle moving from South to North
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Driver or rider
Female 49
SR8 3ST

Not a car passenger
Not a bus or coach passenger

Description of Location A19 200M N OF J/W A194 ONSLIP, JARROW

Description of Accident V2 AND V3 HELD UP IN TRAFFIC. V1 FAILED TO STOP AND COLLIDED WITH THE REAR OF V2 PUSHING V2 INTO THE REAR OF V3.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P710315

Location	South Tyneside A 194 435551E, 565020N	Date/Time	Friday 20 November 2015 22:05
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (A) Failed to look properly (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 18 Negative Postcode: NE34 0QY Commuting to/from work	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South West Turning right Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	18	Not a bus or coach passenger
NE34 0QY		

<i>Description of Location</i>	TYNE DOCK J/W A194 SOUTH SHIELDS
<i>Description of Accident</i>	V1 TRAV NORTH EAST ON A194 ENTERS ROUNDABOUT J/W TYNE DOCK ROAD AND HAS FAILED TO SEE V2 TRAV SOUTH FROM TYNE DOCK ALREADY ON R/ABOUT V1 HAS COLLIDED WITH THE REAR OF V2 CAUSING RIDER TO FALL OFF.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P722015

Location	South Tyneside A 194 433769E, 563507N	Date/Time	Friday 20 November 2015 12:25
Road	Roundabout 30	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit vehicle 2 Offside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 32 Not requested Postcode: DL10 7TW Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South West to North East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	32	Not a bus or coach passenger
DL10 7TW		

<i>Description of Location</i>	LEAM LANE J/W A19 SOUTH SHIELDS
<i>Description of Accident</i>	V2 TRAV NORTH WEST LEAVES A19 AND APPROACHED LINDISFARNE R/ABOUT V2 ENTERS R/ABOUT AS LIGHTS GREEN AND V1 TRAV WEST ON R/ABOUT EXITING COLLIDES WITH OFFSIDE OF V2.

Slight Accident

Involving 2 Vehicle, 2 Casualties

P721015

Location	South Tyneside A 1300 437474E, 564295N	Date/Time	Friday 13 November 2015 13:10
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Distraction in vehicle (B) Careless, reckless or in a hurry (A) Following too close (B)

Vehicle 1

Driver	Not traced, Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 53 Not requested Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 53	Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male

50

Not a bus or coach passenger

Description of Location

PRINCE EDWARD ROAD J/W KING GEORGE ROAD SOUTH SHIELDS

Description of Accident

V2 TRAV WEST ON PRINCE EDWARD ROAD AND STOPPED AT THE R/ABOUT J/W KING GEORGE ROAD. V1 TRAV BEHIND V2 HAS FAILED TO STOP AND COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P731115

Location	South Tyneside A 194 435220E, 564783N	Date/Time	Friday 27 November 2015 10:14
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 185
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 60 Negative Postcode: Journey as part of work	Vehicle	Goods vehicle 7.5 tonnes mgw and over Articulated Vehicle
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 52 Negative Postcode: NE32 5SQ Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	52	Not a bus or coach passenger
NE32 5SQ		

***Description
of Location***

JARROW ROAD J/W NEWCASTLE ROAD SOUTH SHIELDS

***Description
of Accident***

V2 TRAV NORTH EAST ON NEWCASTLE ROAD APPROACHING THE R/ABOUT J/W JARROW ROAD AND STOPPED TO GIVE WAY.
V1 TRAV BEHIND V2 FAILED TO STOP AND COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P752115

Location	South Tyneside A 1300 437376E, 564274N	Date/Time	Saturday 05 December 2015 18:55
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine with high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Loss of Control (A) Learner or inexperienced driver/rider (A)

Vehicle 1

Driver	Male, 17 Not requested Postcode: SR1 2QF Not known	Vehicle	Car No tow or articulation
Collisions	Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 17	Not a bus or coach passenger
SR1 2QF	

Description of Location	JOHN REID ROAD APPROACHING J/W KING EDWARD ROAD SOUTH SHIELDS

Description of Accident	V1 TRAV NORTH EAST ON JOHN REID ROAD WHEN FOR REASONS YET TO BE ESTABLISHED V1 HAS LOST CONTROL AND CRASHED.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P759115

Location	South Tyneside C 408 436078E, 565137N	Date/Time	Friday 04 December 2015 09:44
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3127
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Failed to look properly (B) Careless, reckless or in a hurry (A) Failed to look properly (B)

Vehicle 1

Driver	Female, 84 Not requested Postcode: SR6 7RD Other	Vehicle	Car No tow or articulation
Collisions	Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male 21	Crossing from driver's nearside
NE33 4TD	South

Description of Location WEST WAY J/W WEST PARK VIEW SOUTH SHIELDS

Description of Accident V1 TRAV NORTH WEST ON WEST WAY WHEN A PEDESTRIAN HAS WALKED INTO THE ROAD ONTO THE CROSSING AGAINST THE LIGHT JUST AFTER THE J/W WEST PARK VIEW GIVING V1 NO CHANCE TO AVOID PEDESTRIAN.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P767015

Location	South Tyneside C 402 435584E, 565318N	Date/Time	Thursday 10 December 2015 07:15
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled C 402
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 44 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 31 Driver not contacted at time of accident Postcode: NE33 1SD Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	31	Not a bus or coach passenger
NE33 1SD		

***Description
of Location***

THORNTON AVENUE J/W TEMPLETOWN SOUTH SHIELDS

***Description
of Accident***

V2 TRAV SOUTH EAST ON TEMPLETOWN PASSING THORNTON AVENUE WHEN V1 WHO HAS BEEN PARKED AT THE SIDE OF THE ROAD PULLED OUT INTO THE PATH OF V2 COLLIDING WITH THE NEARSIDE OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P767115

Location	South Tyneside A 1018 437346E, 564862N	Date/Time	Friday 11 December 2015 13:10
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 414
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Dazzling sun (A) Failed to look properly (A)

Vehicle 1

Driver	Female, 27 Not requested Postcode: NE33 3EP Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 50 Not requested Postcode: NE33 4AG Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 21	Not a bus or coach passenger

<i>Description of Location</i>	KING GEORGE ROAD J/W HARTON LANE SOUTH SHIELDS
<i>Description of Accident</i>	V1 TRAV SOUTH EAST ON KING GEORGE ROAD ENTERS ROUNDABOUT & COLLIDED WITH V2 TRAV NORTH EAST ACROSS THE ROUNDABOUT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P771915

Location	South Tyneside A 194 435936E, 565542N	Date/Time	Thursday 10 December 2015 13:40
Road	Roundabout 70	Junction	Roundabout Give way or uncontrolled C 407
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Vehicle blind spot (B)

Vehicle 1

Driver	Female, 51 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 49 Not applicable Postcode: Journey as part of work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit vehicle 1 Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	49	Not a bus or coach passenger

***Description
of Location***

WESTERN APPROACH J/W BARNES ROAD SOUTH SHIELDS

***Description
of Accident***

V1 TRAV SOUTH WEST ON WESTERN APPROACH SLOWED DUE TO R/ABOUT AHEAD THEN PULLED ONTO THE ROUNDABOUT THINKING IT WAS CLEAR. V2 A PEDAL CYCLE TRAV SOUTH EAST ACROSS THE ROUNDABOUT HAS BEEN STRUCK BY V1 AS V1 DID NOT SEE V2.

Serious Accident

Involving 1 Vehicle, 2 Casualties

P778715

Location	South Tyneside C 406 434989E, 564276N	Date/Time	Friday 11 December 2015 09:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3092
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	70	Crossing from driver's nearside
NE34 9AH		South West

Casualty 2 - Serious

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	70	Crossing from driver's nearside
NE34 9AH		South West

Description of Location	WENLOCK ROAD J/W FENWICK AVENUE SOUTH SHIELDS

Description of Accident	V1 TRAV SOUTH EAST ON WENLOCK ROAD WHEN V1 HAS FAILED TO STOP FOR PEDESTRIANS CROSSING ON PED CROSSING FROM EAST TO WEST AND HAS COLLIDED WITH THEM THEN V1 HAS FAILED TO STOP.

Slight Accident

Involving 1 Vehicle, 3 Casualties

P779615

Location	South Tyneside U 3050 434092E, 563626N	Date/Time	Sunday 06 December 2015 19:50
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3050
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Illness or disability, mental or physical (A)

Vehicle 1

Driver	Male, 25 Negative Postcode: NE33 4SB Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Front Kerb Other permanent object	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 25	Not a bus or coach passenger
NE33 4SB	

Casualty 2 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 34	Not a bus or coach passenger
NE32 4AP	

Casualty 3 - Slight

Vehicle or pillion passenger	Rear seat passenger
Female 29	Not a bus or coach passenger
NE32 4AP	

Description of Location EDINBURGH ROAD J/W GLASGOW ROAD JARROW

Description of Accident V1 TRAV SOUTH EAST ON EDINBURGH ROAD WITH FARES ON BOARD WHEN THE DRIVER HAS LOST CONSCIOUSNESS AND COLLIDED WITH A CONCRETE PED CROSSING CAUSING INJURIES.

Slight Accident

Involving 3 Vehicle, 2 Casualties

P779715

Location	South Tyneside A 194 433499E, 563381N	Date/Time	Thursday 10 December 2015 07:40
Road	Dual Carriageway 70	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 43 Negative Postcode: DH8 0RG Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 43	Not a bus or coach passenger
DH8 0RG	

Vehicle 2

Driver	Male, 31 Negative Postcode: DH7 7LB Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male 31	Not a bus or coach passenger
DH7 7LB	

Vehicle 3

Driver Male, 48
Negative
Postcode: NE38 0QB
Other

Collisions Hit vehicle 1
Back
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Movement Vehicle moving from South West to North East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location LEAM LANE 400M W OF LINDISFARNE R/ABOUT, JARROW

Description of Accident V1 V2 AND V3 ALL TRAV NORTH EAST ON A194. V2 AND V3 IN INSIDE LANE IN SLOW MOVING TRAFFIC. V1 IN OUTSIDE LANE SAW TRAFFIC AHEAD AND MOVED INTO INSIDE LANE COLLIDING WITH THE REAR OF V2 PUSING V2 INTO THE REAR OF V3.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P782415

Location	South Tyneside U 3106 435905E, 564638N	Date/Time	Monday 07 December 2015 09:19
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3106
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 31 Not requested Postcode: NE34 0JZ Taking pupil to/from school	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 49 Not requested Postcode: NE33 4LF Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle was Parked Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	49	Not a bus or coach passenger
NE33 4LF		

<i>Description of Location</i>	BELLE VUE CRESCENT J/W VINE STREET SOUTH SHIELDS
<i>Description of Accident</i>	V1 FACING NORTH WEST ON BELLE VUE CRESCENT REVERSED AND COLLIDED INTO THE FRONT OF V2 PARKED BEHIND V1.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P797315

Location	South Tyneside B 1298 436089E, 564723N	Date/Time	Tuesday 29 December 2015 21:56
Road	Single Carriageway 30	Junction	Other junction Give way or uncontrolled U 3084
Conditions	Darkness - Street Lights present and lit Fine with high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (A) Impaired by alcohol (A) Pedestrian wearing dark clothing at night (B)

Vehicle 1

Driver	Female, 52 Negative Postcode: NE34 7PD Not known	Vehicle	Car No tow or articulation
Collisions	Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	29	Crossing from driver's offside
NE33 5NQ		North West

Description of Location	STANHOPE ROAD J/W FARNHAM ROAD SOUTH SHIELDS

Description of Accident	V1 TRAV NORTH EAST ON STAHHOPE ROAD WHEN A PEDESTRIAN WHO WAS CROSSING THE ROAD HAS WALKED INTO THE OFFSIDE OF V1.

Slight Accident

Involving 4 Vehicle, 4 Casualties

P811215

Location	South Tyneside A 194 433653E, 563457N	Date/Time	Thursday 24 December 2015 14:58
Road	Dual Carriageway 70	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None Other object in carriageway None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (A) Driver using mobile phone (A) Sudden braking (A)

Vehicle 1

Driver	Female, 26 Negative Postcode: NE34 8DB Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 26	Not a bus or coach passenger
NE34 8DB	

Vehicle 2

Driver	Male, 27 Negative Postcode: NE34 8DB Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male 27	Not a bus or coach passenger
NE34 8DB	

Vehicle 3

Driver Male, 47
Negative
Postcode: NE10 8DP
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit vehicle 4
Back
None
None

Movement Vehicle moving from North East to South West
Slowing or stopping
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 3 - Slight

Driver or rider
Male 47
NE10 8DP

Not a car passenger
Not a bus or coach passenger

Vehicle 4

Driver Male, 29
Negative
Postcode: DH1 1HH
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit vehicle 3
Back
None
None

Movement Vehicle moving from North East to South West
Slowing or stopping
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 4 - Slight

Driver or rider
Male 29
DH1 1HH

Not a car passenger
Not a bus or coach passenger

Description of Location LEAM LANE 100YRDS W OF LINDISFARNE R/ABOUT, JARROW

Description of Accident V4 TRAV SOUTH WEST ON LEAM LANE SLOWS DUE TO TRAFFIC AHEAD V3 TRAV BEHIND ALSO SLOWS. V1 TRAV IN SAME DIRECTION FAILED TO SLOW AND COLLIDED WITH THE REAR OF V3 PUSHING V3 INTO THE REAR OF V4. V2 THEN COLLIDES WITH THE REAR OF V1.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P813315

Location	South Tyneside A 1300 434706E, 563580N	Date/Time	Saturday 19 December 2015 12:48
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled U 3070
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Junction overshoot (B) Poor turn or manoeuvre (B) Failed to look properly (B)

Vehicle 1

Driver	Female, 26 Not requested Postcode: NE34 8HT Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 26 Not requested Postcode: NE34 0TB Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	26	Not a bus or coach passenger
NE34 0TB		

*Description
of Location*

JOHN REID ROAD J/W WINSKELL ROAD SOUTH SHIELDS

*Description
of Accident*

V2 TRAV SOUTH WEST ON JOHN REID ROAD WHEN V1 HAS TURNED RIGHT FROM WINSKELL ROAD INTO THE PATH OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P814215

Location	South Tyneside A 194 436213E, 566200N	Date/Time	Monday 14 December 2015 15:03
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	Poor turn or manoeuvre (B) Failed to look properly (B) Failed to judge other person's path or speed (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 46 Not requested Postcode: NE33 5PZ Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	46	Not a bus or coach passenger
NE33 5PZ		

***Description
of Location***

WESTERN APPROACH J/W LAYGATE SOUTH SHIELDS

***Description
of Accident***

V2 WAS STATIONARY ON WESTERN APPROACH AT THE J/W LAYGATE IN A SOUTH DIRECTION WHEN V1 TRAV IN SAME DIRECTION HAS FAILED TO STOPPED AND COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 3 Vehicle, 1 Casualty

P836015

Location	South Tyneside C 406 435883E, 564032N	Date/Time	Thursday 05 November 2015 15:15
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3092
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Sudden braking (A) Travelling too fast for conditions (B) Following too close (B)

Vehicle 1

Driver	Female, 18 Not requested Postcode: NE34 9AG Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Slowing or stopping Skidded Did not leave carriageway

Vehicle 2

Driver	Male, 56 Not requested Postcode: NE34 8UF Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Female, 43
Not requested
Postcode: NE34 0BZ
Taking pupil to/from school

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit vehicle 2
Back
None
None

Movement Vehicle moving from North East to North West
Waiting to turn right
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger
Female 5
NE34 0BZ

Rear seat passenger
Not a bus or coach passenger

Description of Location GREEN LANE J/W LAVENDER LANE SOUTH SHIELDS

Description of Accident V3 TRAV SOUTH WEST ON GREEN LANE WAITING TO TURN RIGHT ONTO LAVENDER LANE. V2 TRAV BEHIND V3 STOPPED HOWEVER, V1 HAS FAILED TO STOP AND HAS COLLIDED WITH THE REAR OF V2 PUSHING V2 INTO THE REAR OF V3.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P011616

Location	South Tyneside B 1301 436318E, 566071N	Date/Time	Sunday 10 January 2016 14:50
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Crossing road masked by stationary or parked vehicle (A) Failed to look properly (A) Failed to judge vehicle's path or speed (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 25 Negative Postcode: NE34 0BQ Other	Vehicle	Car No tow or articulation
Collisions	Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	14	Crossing from driver's nearside - masked by parked or stationary vehicle
NE33 4QJ		South West

Description of Location LAYGATE O/S NO 283 SOUTH SHIELDS

Description of Accident V1 TRAV SOUTH EAST ON LAYGATE WHEN A PEDESTRIAN HAS RAN OUT FROM BETWEEN PARKED CARS INTO THE VEHICLES NEARSIDE.

Serious Accident

Involving 1 Vehicle, 1 Casualty

P011716

Location	South Tyneside A 1300 437377E, 564274N	Date/Time	Tuesday 12 January 2016 16:45
Road	Dual Carriageway 60	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 20 Negative Postcode: NE33 3AH Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	11	Crossing from driver's nearside
NE34 0HW		South East

Description of Location	JOHN REID ROAD SOUTH SHIELDS APPROACH KING GEORGE ROAD

Description of Accident	V1 TRAV NORTH EAST ON JOHN REID ROAD TOWARDS THE R/ABOUT KING GEORGE ROAD WHEN A PEDESTRIAN HAS RAN ACROSS THE ROAD. V1 HAS BRAKED BUT THE PEDESTRIAN HAS MADE CONTACT WITH THE FRONT OF V1.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P012016

Location	South Tyneside C 402 435944E, 566622N	Date/Time	Friday 08 January 2016 04:00
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3157
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (B) Aggressive driving (A) Impaired by alcohol (B)

Vehicle 1

Driver	Male, 27 Driver not contacted at time of accident Postcode: NE32 3QA Not known	Vehicle	Car No tow or articulation
Collisions	Front None Entered ditch	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Left carriageway nearside

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 18	Not a bus or coach passenger
NE33 5RS	

Description of Location COMMERCIAL ROAD J/W TUDOR ROAD SOUTH SHIELDS

Description of Accident V1 TRAV SOUTH ON COMMERCIAL ROAD APPROACHING J/W TUDOR ROAD WHEN V1 HAS LOST CONTROL AND LEFT THE ROAD TO THE OFFSIDE MOUNTING THE FOOTPATH AND COLLIDING WITH A STONE WALL CAUSING INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P012316

Location	South Tyneside A 185 433276E, 565052N	Date/Time	Saturday 09 January 2016 19:32
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1297
Conditions	Darkness - Street Lights present and lit Raining with high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (A) Slippery road (due to weather) (B) Unfamiliar with model of vehicle (A) Slippery road (due to weather) (B)

Vehicle 1

Driver	Male, 44 Negative Postcode: NE33 4HT Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Waiting to go ahead but held up Skidded Did not leave carriageway

Vehicle 2

Driver	Male, 50 Negative Postcode: Journey as part of work	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Waiting to go ahead but held up Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	50	Not a bus or coach passenger

<i>Description of Location</i>	A185 J/W B1297 JARROW
<i>Description of Accident</i>	V2 TRAV EAST ON A185 STOPPED TO GIVE WAY AT ROUNDABOUT J/W B1297 WHEN V1 TRAV BEHIND V2 HAS FAILED TO STOP AND HAS COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 2 Vehicle, 3 Casualties

P019716

Location	South Tyneside A 19 433881E, 563332N	Date/Time	Wednesday 06 January 2016 18:12
Road	Slip Road 60	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Failed to judge other person's path or speed (B)

Vehicle 1

Driver	Male, 23 Negative Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front Parked vehicle Entered ditch	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North West to South East Going ahead other Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 23	Not a bus or coach passenger

Vehicle 2

Driver	Female, 58 Negative Postcode: NE37 1TE Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle was Parked Parked No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 2 - Slight

Driver or rider	Not a car passenger
Female 58 NE37 1TE	Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 50

Not a bus or coach passenger

Description of Location

TYNE TUNNEL APPROACH ROAD SOUTH SHIELDS

Description of Accident

V1 TRAV SOUTH EAST ON SLIP ROAD FROM A194 TOWARDS A19 WHEN IT HAS COLLIDED WITH STATIONARY V2 WHICH WAS PARKED IN THE INSIDE LANE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P047016

Location	South Tyneside B 1301 436474E, 563879N	Date/Time	Thursday 14 January 2016 08:10
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres Zebra Crossing	Contributory	Junction restart (moving off at junction) (A) Failed to look properly (A) Careless, reckless or in a hurry (B) Rain, sleet, snow or fog (A) Vehicle blind spot (B) Pedestrian wearing dark clothing at night (B)

Vehicle 1

Driver	Male, 58 Driver not contacted at time of accident Postcode: NE33 1LN Not known	Vehicle	Car No tow or articulation
Collisions	Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	21	Crossing from driver's nearside
NE34 6JQ		North West

Description of Location	DEAN ROAD J/W MORTIMER ROAD SOUTH SHIELDS

Description of Accident	V1 TRAV NORTH WEST ON DEAN ROAD WHEN IT HAS STOPPED AT PEDESTRIAN CROSSING TO ALLOW PED TO CROSS. AS PED STARTED TO CROSS V1 MOVED FORWARD AND COLLIDED WITH THE PEDESTRIAN.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P049416

Location	South Tyneside A 194 435887E, 565215N	Date/Time	Tuesday 12 January 2016 17:34
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled C 408
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Failed to look properly (B) Inadequate or masked signs or road markings (A)

Vehicle 1

Driver	Female, 37 Not requested Postcode: DH6 3ET Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 48 Not requested Postcode: NE34 9DX Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	48	Not a bus or coach passenger
NE34 9DX		

***Description
of Location***

WESTERN APPROACH J/W WEST WAY SOUTH SHIELDS

***Description
of Accident***

V1 TRAV SOUTH EAST ON WESTERN APPROACH IN LANE 1 APPROACHING R/ABOUT J/W WEST WAY INTENDING TO TURN RIGHT AND STAY ON WESTERN APPROACH V2 DOING THE SAME BUT IN LANE 2. AS BOTH VEHICLES ENTER R/ABOUT V1 ENTERS LANE 2 COLLIDING WITH V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P081116

Location	South Tyneside B 1301 436526E, 565888N	Date/Time	Sunday 31 January 2016 10:15
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Zebra Crossing	Contributory	Following too close (A) Failed to look properly (A)

Vehicle 1

Driver	Female, 29 Negative Postcode: NE33 5RU Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 40 Negative Postcode: NE32 4AG Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	40	Not a bus or coach passenger
NE32 4AG		

***Description
of Location***

DEAN ROAD J/W CHICHESTER ROAD SOUTH SHIELDS

***Description
of Accident***

V1 AND V2 BOTH TRAV SOUTH WEST ON DEAN ROAD. V2 STOPS AT PED CROSSING TO ALLOW SOMEBODY TO CROSS V1 TRAV BEHIND V2 FAILED TO STOP AND COLLIDED WITH THE REAR OF V2.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0049189

Location	South Tyneside B 1289 436389E, 565009N	Date/Time	Friday 04 March 2016 21:26
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 408
Conditions	Darkness - Street Lights present and lit Other Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Impaired by alcohol (A) Exceeding speed limit (A)

Vehicle 1

Driver	Male, 20 Not provided (medical reasons) Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Central island of roundabout None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other Skidded and overturned Left carriageway straight ahead at junction

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 20	Not a bus or coach passenger

Description of Location	STANHOPE ROAD B1289 AT JN WITH TEMPLE PARK ROAD C408

Description of Accident	VEHICLE 1 TRAVELLING ALONG STANHOPE ROAD FAIL TO SLOW/SLOW AT ROUNDABOUT JUNCTION WITH TEMPLEPARK ROAD, CROSS OVER ROUNDABOUT COLLIDING WITH ROADSIDE FURNITURE, LEAVE CARRIAGEWAY COLLIDING THROUGH BRICK WALL AND RAILING FENCE, COMING TO REST IN PLAY AREA OF CHILDRENS NURSERY

Slight Accident

Involving 1 Vehicle, 1 Casualty

0051831

Location	South Tyneside B 1298 435973E, 564620N	Date/Time	Sunday 06 March 2016 19:25
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Other (A)

Vehicle 1

Driver	Not traced, 33 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 23	Seated passenger
NE34 0BF	

Description of Location STANHOPE ROAD B1298 NEAR JN WITH B1302

Description of Accident THE STAGECOACH BUS FLEET NUMBER 37318 WAS TRAVELLING ALONG STANHOPE ROAD IN THE DIRECTION OF BOLDON LANE WHEN THE DRIVER APPLIED HIS BREAKS TO A STOP AT THE BUS STOP. A PASSENGER ALLEGED THAT THE DRIVER HAD BRAKED SHARPLY CAUSING HER TO NIP HER FINGER ON THE SEAT HANDLE.. THE BUSES ARE FITTED WITH GREEN ROAD CONTROL WHICH SHOWS ON A REMOTE SYSTEM IF THERE IS ANY EXCESSIVE BREAKING, THIS SHOWS ON A RED AMBER GREEN SYSTEM, I HAVE CHECKED THIS AND THERE IS NO ISSUES WITH THE BREAKING. CCTV SHOWS

Slight Accident

Involving 1 Vehicle, 1 Casualty

0049516

Location	South Tyneside 436385E, 566942N	Date/Time	Friday 04 March 2016 13:11
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Other Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		On footway or verge
Male	47	Walking along in carriageway - back to traffic
NE34 6AS		North

**Description
of Location** GARDEN LANE

**Description
of Accident** PEDESTRIAN WAS WALKING ON PATHWAY THROUGH UNDERPASS ON GARDEN LANE V1 TRAV WEST ON GARDEN LANE WING MIRROR COLLIDES WITH THE PEDESTRIAN. V1 LEFT THE SCENE

Slight Accident

Involving 1 Vehicle, 1 Casualty

0055069

Location	South Tyneside A 1298 436565E, 565732N	Date/Time	Saturday 02 April 2016 16:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	Wrong use of pedestrian crossing facility (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	19	Crossing from driver's offside
		North East

Description of Location	STANHOPE PARADE A1298

Description of Accident	IP , RITANSHU ANAND HAS TOLD FRIENDS WHILE CROSSING THE ROAD ON STANHOPE ROAD HE HAS BEEN STRUCK BY AN U/K CAR. IP CANNPOT GINVE ANY COLOUR , MAE OR MODEL OF THE CAR.IP CANNOT RECALL ANY OTHER INFORMATION. HE CANNOT REMEMBER HOW HE GOT HOME FROM THE SCENE.THE OFFENDING VEHICLE HAS FAILED TO STOP AT THE SCENE.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0053009

Location	South Tyneside A 1018 437077E, 565786N	Date/Time	Friday 18 March 2016 22:28
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Impaired by alcohol (A)

Vehicle 1

Driver	Female, 29 Positive Postcode: NE33 8LU Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 30 Negative Postcode: NE34 9HB Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	30	Not a bus or coach passenger
NE34 9HB		

Vehicle 3

Driver Male, 21
Negative
Postcode: NE34 0SQ
Other

Collisions Hit no other vehicle
Back
None
None

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from North West to South East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location SUNERLAND ROAD A1018 NEAR JN WITH COLLEGE DRIVE

Description of Accident VEHICLES 2 AND 3 SLOWING FOR TRAFFIC LIGHTS ON SUNDERLAND ROAD, SOUTH SHIELDS AT THE JUNCTION WITH GROSVENOR ROAD, TRAVELLING SOUTH. VEHICLE 1 HAS COLLIDED WITH THE REAR OF VEH 2, SHUNTING IT INTO VEH 3.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0050295

Location	South Tyneside C 408 435898E, 565187N	Date/Time	Tuesday 08 March 2016 09:25
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Poor turn or manoeuvre (A)

Vehicle 1

Driver	Female, 27 Not requested Postcode: SR6 0NX Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North West to South East Turning left Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	27	Not a bus or coach passenger
SR6 0NX		

Vehicle 2

Driver	Male, 38 Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North West to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

WEST WAY C408 NEAR JN WITH WESTERN APPROACH A194

***Description
of Accident***

V2 TRAV WEST ON WEST WAY IN LEFT LANE APPROACHING J/W WESTERN APPROACH, V1 TRAV IN RIGHT LANE. V2 INTENDING TO TURN RIGHT ONTO A194 V1 INTENDING TO TURN LEFT. V1 V2 COLLIDE WHEN SIDE BY SIDE. V1 SPINS AROUND AS RESULT OF IMPACT FACING ONCOMING TRAFFIC

Slight Accident

Involving 3 Vehicle, 1 Casualty

0053069

Location South Tyneside
B 1298
436234E, 564874N

Date/Time Friday
04 March 2016
14:50

Road Single Carriageway
30

Junction T or staggered junction
Give way or uncontrolled

Conditions Daylight - Street Lights Present
Fine without high winds
Dry
None
None

None within 50 metres
Zebra Crossing

Contributory
Failed to look properly (A)
Failed to judge other person's path or speed (B)

Vehicle 1

Driver Male, 49
Not requested
Postcode: NE34 7TF
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Entering main road

Collisions Hit no other vehicle
Nearside
None
None

Movement Vehicle moving from North West to North East
Turning right
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 2

Driver Male, 62
Not requested
Postcode: NE34 7PP
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Mid junction - on roundabout or on main road

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from South West to North East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 3

Driver Male, 71
Not requested
Postcode: NE34 9UA
Other

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Offside
None
None

Movement Vehicle moving from North East to South West
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger
Female 61
NE34 9UA
Front seat passenger
Not a bus or coach passenger

Description of Location STANHOPE ROAD B1298 AT JN WITH TALBOT ROAD

Description of Accident DRIVER OF VEHICLE 1 HAS FAILED TO LOOK CORRECTLY WHEN PULLING AWAY FROM JUNCTION OF TALBOT ROAD (TURNING RIGHT). HE HAS STRUCK THE REAR OF VEHICLE 2 TRAVELING NORTH EAST ON STANHOPE ROAD CAUSING THE DRIVER TO LOSE CONTROL AND SUBSEQUENTLY COLLIDE WITH VEHICLE 3 WHICH WAS TRAVELING SOUTH WEST.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0058924

Location	South Tyneside A 1300 436138E, 563760N	Date/Time	Sunday 13 March 2016 15:19
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None Involvement with previous accident None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (A) Other (B)

Vehicle 1

Driver	Female, 27 Not requested Postcode: NE33 5HS Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North East to South West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 27	Not a bus or coach passenger
NE33 5HS	

Vehicle 2

Driver	Female, 33 Negative Postcode: NE31 1EA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead right hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 36
Not requested
Postcode:
Journey as part of work

Collisions Hit no other vehicle

Did not impact
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Movement Vehicle was Parked
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location JOHN REID ROAD A1300 AT JN WITH WHITELEAS WAY B1298

Description of Accident V3 (POL VEH) PARKED ON WHITELEAS WAY, BLOCKING TRAFFIC FROM ENTERING FROM JOHN REID RD R/ABOUT, V3 HAD EMERGENCY ROOF BEACONS AND HAZARD LIGHT ACTIVATED. V1 TRAV. S/W ON R/ABOUT APP. J/W WHITELEAS WAY, V1 ATTEMPTS TO TURN LEFT ONTO WHITLEAS WAY, SEES V3 AND ATTEMPTS TO GO ROUND R/ABOUT IN LANE 1 TOWARDS BOLDON LANE, V2 TRAV. S/W FROM BOLDON LANE TOWARDS J/W JOHN REID RD IN LANE 2, F/N/S OF V2 COLLIDES WITH O/S OF V1. V1 STOPS IN LANE 2 ON B1300, CLIMBS OUT OF V1 AND COMPLAINS OF INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0055449

Location	South Tyneside C 402 435814E, 566355N	Date/Time	Saturday 02 April 2016 11:21
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (A) Slippery road (due to weather) (A) Failed to look properly (B)

Vehicle 1

Driver	Male, 28 Not requested Postcode: NE6 4RH Other	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from South East to South West Turning right Skidded Did not leave carriageway

Vehicle 2

Driver	Male, 60 Not requested Postcode: NE33 4UP Other	Vehicle	Motorcycle - Unknown cc No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 63	Not a bus or coach passenger
NE33 4UP	

***Description
of Location***

COMMERCIAL ROAD C402 NEAR JN WITH LAYGATE B1301

***Description
of Accident***

VEHICLE 2 WAS TRAVELING ALONG COMMERCIAL ROAD 1 SOUTH SHIELDS IN A NORTHERLY DIRECTION HEADING TOWARDS THE MARKET PLACE. VEHICLE 1 HAS BEEN TRAVELING IN AN EASTERLY DIRECTION FROM LAYGATE STREET INTENDING TO TURN RIGHT ONTO COMMERCIAL ROAD. VEHICLE 1 HAS SLOWLY PULLED OUT FROM THE JUNCTION AND APPLIED HIS BRAKES, VEHICLE 2 WHICH IS A MOTORCYCLE HAS TRIED TO AVOID HITTING VEHICLE 1 RESULTING IN BOTH RIDER AND PILLION PASSENGER FALLING FROM THE MOTORCYCLE CAUSING INJURY TO THE PILLION PASSENGER OF

Slight Accident

Involving 1 Vehicle, 1 Casualty

0061397

Location	South Tyneside A 1018 436708E, 566482N	Date/Time	Tuesday 19 April 2016 18:00
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 56 Driver not contacted at time of accident Postcode: SR5 4PX Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 65	Standing passenger
NE33 2PT	

Description of Location	WESTOE ROAD A1018 AT JN WITH IMEARY STREET A1018

Description of Accident	V1 TRAV. S/E ON WESTOE RD, SLOWS ON APPROACH TO R/ABOUT J/W IMEARY ST, PASSENGER STOOD UP WHEN V1 APPROACHED R/ABOUT, DRIVER OF V1 BREAKS AGAIN DUE TO VEHICLE COMING OUT OF BLIND SPOT, CAUSING PASSENGER TO FALL OVER

Slight Accident

Involving 1 Vehicle, 1 Casualty

0057166

Location	South Tyneside B 1298 436578E, 566292N	Date/Time	Saturday 09 April 2016 14:15
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Passing too close to cyclist, horse rider or pedestrian (A)

Vehicle 1

Driver	Male, 58 Driver not contacted at time of accident Postcode: DL3 0UW Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North West to South West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		On footway or verge
Female	30	Unknown or other
NE34 9LH		Standing Still

Description of Location	EXIT ROAD FROM ALDI CAR PARK CHICHESTER ROAD B1298

Description of Accident	PEDESTRIAN WAS STANDING ON PAVEMENT DIRECTLY OPPOSITE LOADING BAY/CAR PARK OF ALDI, SOUTH SHIELDS WHEN V1 HAS EXITED THE LOADING BAY, V1 HAS BEGAN TO TURN RIGHT ONTO THE ROAD IN DOING SO WHEN THE FRONT CAB OF THE ARTIC HAS TURNED THE FRONT TRAILER HAS SLIGHTLY ENCROUCHED OVER THE PAVEMENT CONNTECTING SLIGHTLY WITH THE PEDESTRIANS RIGHT SHOULDER/UPPER ARM. V1 HAS THEN CONTINUED TO TURN ONTO CHICHESTER ROAD WITHOUT STOPPING.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0063752

Location	South Tyneside A 1300 435609E, 563594N	Date/Time	Wednesday 04 May 2016 23:15
Road	Dual Carriageway 40	Junction	T or staggered junction Automatic traffic signal
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	

Vehicle 1

Driver	Male, 65 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 21 Not applicable Postcode: Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 21	Not a bus or coach passenger

***Description
of Location***

JOHN REID ROAD A1300

***Description
of Accident***

VEHICLE 1 WAS HEADING SOUTH WEST ON THE JOHN REID ROAD, APPROACHING JUNCTION WITH CHESTERTON ROAD. AS VEH1 HAS PROCEEDED THROUGH THE JUNCTION, THE CYCLIST HAS CONTRAVENED A RED LIGHT, AND RODE INTO THE PATH OF VEH1 CAUSING COLLISION.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0063719

Location	South Tyneside A 194 434468E, 564067N	Date/Time	Friday 29 April 2016 16:50
Road	Dual Carriageway 40	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (B) Nervous, uncertain or panic (B) Failed to look properly (B)

Vehicle 1

Driver	Female, 29 Not applicable Postcode: NE32 4JB Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 29	Not a bus or coach passenger
NE32 4JB	

Vehicle 2

Driver	Male, 53 Negative Postcode: NE34 9RH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

O/S TESCO NEWCASTLE ROAD A194 AT JN WITH HENDERSON ROAD

***Description
of Accident***

VEHICLE 2 - KN58ZKT CITROEN C3 WAS TRAVELING IN THE OUTSIDE LANE OF NEWCASTLE EASTBOUND TOWARDS SOUTH SHIELDS. THE VEHICLE BEGAN TO SLOW AS IT WAS THE DRIVER'S INTENTION TO TURN RIGHT IN ORDER TO DRIVE ONTO HENDERSON ROAD. IN THE NEAR SIDE LANE THERE WAS A VAN (DETAILS UNKNOWN) THAT WAS DRIVING NEXT TO VEHICLE 2 ALTHOUGH IT WAS SLIGHTLY AHEAD. THE VAN THEN BROKE QUITE SUDDENLY AND A PEDAL CYCLE (VEHICLE 1) CAME OUT INTO THE CARRIAGEWAY IN FRONT OF THE VAN AND COLLIDED WITH VEHICLE 2 TO THE REAR

Slight Accident

Involving 2 Vehicle, 1 Casualty

0064237

Location	South Tyneside B 1301 436515E, 565884N	Date/Time	Saturday 23 April 2016 11:00
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 41 Not applicable Postcode: NE33 5QE Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 41	Not a bus or coach passenger
NE33 5QE	

Vehicle 2

Driver	Male, 46 Driver not contacted at time of accident Postcode: NE34 7HG Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

DEAN ROAD B1301 AT JN WITH CHICHESTER ROAD B1298

***Description
of Accident***

V1 TRAV. S/W ON DEAN RD APP. R/ABOUT J/W CHICHESTER RD, V2 TRAV. S ON CHICHESTER RD, ENTERS R/ABOUT J/W DEAN RD INTENDING TO TRAV. S ONTO STANHOPE RD, V1 FAILS TO SEE V2, ENTERS R/ABOUT, FRONT OF V1 COLLIDING WITH NEAR SIDE OF V2

Serious Accident

Involving 1 Vehicle, 6 Casualties

0050799

Location	South Tyneside A 19 433843E, 563295N	Date/Time	Friday 11 March 2016 23:27
Road	Slip Road 70	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine with high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Loss of Control (A) Aggressive driving (B)

Vehicle 1

Driver	Male, 18 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Tree	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Changing lane to left Skidded Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 18	Not a bus or coach passenger

Casualty 2 - Serious

Vehicle or pillion passenger	Rear seat passenger
Male 15	Not a bus or coach passenger

Casualty 5 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 16	Not a bus or coach passenger

Casualty 6 - Serious

Vehicle or pillion passenger	Rear seat passenger
Male 16	Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger

Female 16

Rear seat passenger

Not a bus or coach passenger

Casualty 4 - Slight

Vehicle or pillion passenger

Male 16

Rear seat passenger

Not a bus or coach passenger

Description of Location

A19

Description of Accident

V1 WAS TRAVELLING NORTHBOUND ON THE A19 IN LANE 2, FOR REASONS YET TO BE ESTABLISHED WHEN V1 APPROACHED THE OFF-SLIP FOR LINDISFARNE ROUNDABOUT THE DRIVER OF V1 LOST CONTROL OF HIS VEHICLE WHICH RESULTED IN V1 COLLIDING WITH A TREE AND THEN A LAMPPOST WHICH CAUSED SIGNIFICANT DAMAGE TO V1.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0068361

Location	South Tyneside C 408 436361E, 565039N	Date/Time	Wednesday 11 May 2016 15:15
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (B) Failed to judge other person's path or speed (B)

Vehicle 1

Driver	Female, Driver not contacted at time of accident Postcode: NE34 0BQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 19 Driver not contacted at time of accident Postcode: NE31 1DH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back Previous accident None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	19	Not a bus or coach passenger
NE31 1DH		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 18

Not a bus or coach passenger

NE35 9D

Description of Location

WEST WAY C408 AT JN WITH STANHOPE ROAD B1298

Description of Accident

VEHS TRAV. S/E ON WEST WAY APP. J/W STANHOPE RD, V1 TRAV. BEHIND V2, UNKNOWN VEH INFRONT OF V2 BRAKES SUDDENLY ON APP. TO ROUNDABOUT CAUSING V2 TO BRAKE SHARPLY, V1 FAILED TO STOP IN TIME, COLLIDING WITH REAR OF V2.

Slight Accident

Involving 6 Vehicle, 2 Casualties

0057436

Location	South Tyneside B 1298 436506E, 566037N	Date/Time	Tuesday 12 April 2016 13:05
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Travelling too fast for conditions (A)

Vehicle 1

Driver	Female, 35 Negative Postcode: NE33 4HS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Parked vehicle None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 35	Not a bus or coach passenger
NE33 4HS	

Casualty 2 - Slight

Vehicle or pillion passenger	Rear seat passenger
Female 6	Not a bus or coach passenger

Vehicle 2

Driver	Male, 44 Negative Postcode: DD07 7AS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Not traced,
Not applicable
Postcode:
Not known

Collisions Hit no other vehicle

Offside
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Approaching junction or waiting/parked at junction exit

Movement Vehicle moving from North to South
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 4

Driver Not traced,
Not applicable
Postcode:
Not known

Collisions Hit no other vehicle

Offside
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Approaching junction or waiting/parked at junction exit

Movement Vehicle moving from North to South
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 5

Driver Not traced,
Not applicable
Postcode:
Not known

Collisions Hit no other vehicle

Front
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Approaching junction or waiting/parked at junction exit

Movement Vehicle moving from North to South
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 6

Driver Not traced,
Not applicable
Postcode:
Not known

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle moving from East to North
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location CHICHESTER ROAD B1298 AT JN WITH WEST GEORGE POTTS STREET

Description of Accident VEHICLE 2 A BLACK FORD MONDEO WAS EMERGING FROM A SIDE ROAD ONTO THE B1298 CHICHESTER ROAD , SOUTH SHIELDS. VEHICLE 1 A RENAULT MEGANE SCENIC DUE SOUTH WEST ALONG CHICHESTER ROAD. THE FORD MONDEO WOULD BE TO THE NEAR SIDE OF VEHICLE 1. VEHICLE 1 WAS STRUCK BY VEHICLE 2 WHICH CAUSED VEHICLE 1 TO ROTATE AND COLLIDE WITH FOUR PARKED CARS TO THE NEAR SIDE. THERE IS A SUGGESTION THAT VEHICLE 1 WAS TRAVELLING TOO QUICKLY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P065216

Location	South Tyneside A 185 435234E, 564801N	Date/Time	Monday 01 February 2016 10:50
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: NN9 5QQ Journey as part of work	Vehicle	Goods vehicle 7.5 tonnes mgw and over No tow or articulation
Collisions	Hit vehicle 2 Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 20 Driver not contacted at time of accident Postcode: NE11 9ER Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Offside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	20	Not a bus or coach passenger
NE11 9ER		

<i>Description of Location</i>	JARROW ROAD J/W NEWCASTLE ROAD SOUTH SHIELDS
<i>Description of Accident</i>	V1 AND V2 BOTH TRAV NORTH EAST ON NEWCASTLE ROAD AND BOTH ENTER THE R/ABOUT J/W JARROW ROAD V1 IN INSIDE LANE AND V2 IN OUTSIDE LANE. V1 HAS THEN MOVED ACROSS INTO OUTSIDE LANE COLLIDING WITH THE FRONT OFFSIDE OF V2.

Serious Accident

Involving 1 Vehicle, 1 Casualty

P076216

Location	South Tyneside B 1301 436347E, 565781N	Date/Time	Tuesday 02 February 2016 14:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (A) Failed to look properly (A)

Vehicle 1

Driver	Female, 50 Not requested Postcode: NE33 5PE Other	Vehicle	Car No tow or articulation
Collisions	Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Male	26	Crossing from driver's nearside
NE33 1SE		South West

Description of Location	DEAN ROAD NR DACRE STREET SOUTH SHIELDS

Description of Accident	V1 TRAV SOUTH WEST ON DEAN ROAD TOWARD DACRE STREET WHEN THE PED WHO HAD BEEN RUNNING ALONG THE FOOTPATH TO THE NEAR SIDE OF V1 RAN OUT INTO THE ROAD COLLIDING WITH THE NEAR SIDE OF V1.

Slight Accident

Involving 1 Vehicle, 1 Casualty

P076916

Location	South Tyneside A 194 436517E, 566792N	Date/Time	Thursday 11 February 2016 07:18
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Stationary or parked vehicle(s) (A)

Vehicle 1

Driver	Male, 33 Negative Postcode: NE33 2EZ Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Overtaking stationary vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In centre of carriageway, not on refuge, central island or central reservation
Female	25	Crossing from driver's nearside - masked by parked or stationary vehicle
NE4 8TR		North West

Description of Location	CROSSGATE SOUTH SHIELDS

Description of Accident	V1 TRAV WESTOE ROAD TURNING RIGHT TO TRAV SOUTH WEST ON CROSSGATE. A BUS HAD PULLED OVER ON NEARSIDE TO ALLOW PASSENGER TO ALIGHT. THE IP HAS ALIGHTED AND THEN CROSSED IN FRONT OF THE BUS INTO THE PATH OF V1 AS IT OVERTOOK THE STATIONARY BUS.

Slight Accident

Involving 3 Vehicle, 1 Casualty

P090116

Location	South Tyneside U 3061 434990E, 563536N	Date/Time	Tuesday 09 February 2016 13:00
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 38 Driver not contacted at time of accident Postcode: NE34 0AL Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 3 Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	38	Not a bus or coach passenger
NE34 0AL		

Vehicle 3

Driver Male,
Driver not contacted at time of accident
Postcode:
Not known

Collisions Hit vehicle 2
Back
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Movement Vehicle moving from North East to South West
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location WINSKELL ROAD SOUTH SHIELDS O/S NO 107

Description of Accident V3 TRAV SOUTH WEST ON WINSKELL AVENUE STOPPED TO ALLOW A BUS PASSED IN OPP CARRIAGEWAY. V2 STOPPED BEHIND V3 BUT V1 FAILED TO STOP IN TIME AND COLLIDED WITH THE REAR OF V2 PUSHING V2 INTO THE REAR OF V3.

Slight Accident

Involving 2 Vehicle, 1 Casualty

P099516

Location	South Tyneside B 1302 435707E, 564724N	Date/Time	Thursday 11 February 2016 11:15
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3092
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Nearside None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from North West to South West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 30 Not applicable Postcode: NE32 3PU Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit vehicle 1 Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	30	Not a bus or coach passenger
NE32 3PU		

***Description
of Location***

BOLDON LANE J/W HEDDON WAY SOUTH SHIELDS

***Description
of Accident***

V1 TRAV SOUTH EAST ON BOLDON LANE TURNING RIGHT INTO HEDDON WAY COLLIDES WITH V2 TRAV NORTH WEST ON BOLDON LANE.

Slight Accident

Involving 3 Vehicle, 2 Casualties

P102316

Location	South Tyneside A 194 433878E, 563606N	Date/Time	Saturday 20 February 2016 18:24
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A) Failed to look properly (A) Swerved (A) Loss of Control (A) Aggressive driving (A)

Vehicle 1

Driver	Male, 27 Negative Postcode: NE35 9DG Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 27	Not a bus or coach passenger
NE35 9DG	

Vehicle 2

Driver	Male, 35 Negative Postcode: NE34 7JA Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 58
Negative
Postcode: SR6 9DW
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit vehicle 1
Back
None
None

Movement Vehicle moving from North East to South West
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 2 - Slight

Driver or rider
Male 58
SR6 9DW

Not a car passenger
Not a bus or coach passenger

Description of Location A194 50M EAST OF LINDISFARNE JUNCTION

Description of Accident V1 TRAV SOUTH WEST ON A194 AT SPEED. V1 HAS BRAKED DUE TO STATIONARY TRAFFIC AHEAD AT THE R/ABOUT AND HAS LOST CONTROL AND SKIDDED SIDEWAYS INTO V2 AND V3 WAITING IN OUTSIDE LANE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

P109116

Location	South Tyneside C 408 436529E, 564996N	Date/Time	Friday 19 February 2016 07:25
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3129
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Failed to judge other person's path or speed (B) Exceeding speed limit (B)

Vehicle 1

Driver	Male, 62 Not requested Postcode: NE34 0SG Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North East to North West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 28 Not requested Postcode: NE34 7HX Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 30	Not a bus or coach passenger

Casualty 1 - Slight

Vehicle or pillion passenger

Rear seat passenger

Female

5

Not a bus or coach passenger

Description of Location

TEMPLE PARK ROAD J/W READING ROAD SOUTH SHIELDS

Description of Accident

V1 TRAV SOUTH ON READING ROAD TURNS RIGHT ONTO TEMPLE PARK RD INTO THE PATH OF V2 TRAV WEST ON TEMPLE PARK RD

Slight Accident

Involving 4 Vehicle, 1 Casualty

P109516

Location	South Tyneside A 194 433959E, 563658N	Date/Time	Wednesday 17 February 2016 10:19
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry Automatic Traffic Signal partially defective None None within 50 metres Footbridge or subway	Contributory	Driver using mobile phone (B) Distraction in vehicle (B) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Male, 36 Negative Postcode: SR8 3TQ Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit vehicle 2 Front Kerb Road sign/Traffic Signal	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Left carriageway nearside

Vehicle 2

Driver	Male, 45 Not provided (medical reasons) Postcode: NE32 5YQ Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Back None Central crash barrier	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Left carriageway offside

Casualty 1 - Slight

Vehicle or pillion passenger	Rear seat passenger
Male 10	Not a bus or coach passenger

Vehicle 3

Driver Male, 41
Negative
Postcode: NE37 2QZ
Journey as part of work

Collisions Hit vehicle 4

Back
None
None

Vehicle Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under
No tow or articulation

Location On main carriageway - not in restricted lane

Not at, or within 20 metres of junction

Movement Vehicle moving from North East to South West
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 4

Driver Male, 61
Negative
Postcode: DH4 7JX
Journey as part of work

Collisions Hit vehicle 3

Back
None
None

Vehicle Goods vehicle 7.5 tonnes mgw and over
No tow or articulation

Location On main carriageway - not in restricted lane

Not at, or within 20 metres of junction

Movement Vehicle moving from North East to South West
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location LEAM LANE 100M PRIOR TO LINDISFARNE R/A

Description of Accident V2 V3 V4 TRAV SW ON A194 APPROACHING LINDISFARNE R/A IN SLOW MOVING TRAFFIC. V1 TRAV BEHIND COLLIDES WITH THE REAR OF V2 PUSHING IT INTO V3, V3 INTO V4

Slight Accident

Involving 2 Vehicle, 1 Casualty

P111016

Location	South Tyneside B 1298 436144E, 564786N	Date/Time	Saturday 20 February 2016 18:05
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled U 3084
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 47 Negative Postcode: NE34 9TW Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Offside None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from South West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 25 Negative Postcode: NE33 5DF Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit vehicle 1 Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	25	Not a bus or coach passenger
NE33 5DF		

<i>Description of Location</i>	STANHOPE ROAD J/W EGERTON ROAD SOUTH SHIELDS
<i>Description of Accident</i>	V1 TRAV NORTH ON STANHOPE RD TURNS RIGHT ONTO EGERTON ROAD ACROSS THE PATH OF V2 TRAV SOUTH ON STANHOPE RD

Slight Accident

Involving 1 Vehicle, 1 Casualty

P118416

<i>Location</i>	South Tyneside B 1301 436374E, 566001N	<i>Date/Time</i>	Monday 29 February 2016 09:00
<i>Road</i>	Single Carriageway 30	<i>Junction</i>	Not at or within 20 metres of junction
<i>Conditions</i>	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Zebra Crossing	<i>Contributory</i>	

Vehicle 1

<i>Driver</i>	Male, 65 Negative Postcode: NE34 8BN Other	<i>Vehicle</i>	Car No tow or articulation
<i>Collisions</i>	Front None None	<i>Location</i>	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		<i>Movement</i>	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	9	Crossing from driver's nearside
NE33 5QD		North East

Description of Location LAYGATE SOUTH SHIELDS

Description of Accident V1 TRAV NW ON LAYGATE COLLIDES WITH A PEDESTRIAN ON A ZEBRA CROSSING

Slight Accident

Involving 2 Vehicle, 2 Casualties

P120716

Location	South Tyneside A 1018 437332E, 564934N	Date/Time	Friday 26 February 2016 16:44
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled C 413
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Road layout (eg. bend, hill, narrow carriageway) (B) Vegetation (A) Failed to look properly (A)

Vehicle 1

Driver	Female, 78 Not requested Postcode: NE34 7QX Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 2 Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from West to South Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Not traced, Not requested Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit vehicle 1 Offside Kerb Bus Stop/Bus Shelter	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other Skidded Left carriageway offside onto central reservation

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 45	Not a bus or coach passenger
NE33 2EH	

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male

39

Not a bus or coach passenger

Description of Location

KING GEORGE ROAD J/W MORTIMER ROAD SOUTH SHIELDS

Description of Accident

V1 TRAV EAST ON MORTIMER RD TURNS RIGHT ONTO KING GEORGE RD INTO THE PATH OF V2 TRAV SOUTH ON KING GEORGE RD. V2 SPINS AROUND MOUNTS THE KERB OF THE CENTRAL RESERVATION AND A SMALL TREE

Slight Accident

Involving 2 Vehicle, 1 Casualty

P128316

Location	South Tyneside B 1298 435957E, 564427N	Date/Time	Friday 12 February 2016 16:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled U 3092
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Failed to judge other person's path or speed (B) Junction restart (moving off at junction) (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit vehicle 2 Did not impact None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 27 Driver not contacted at time of accident Postcode: NE34 9LP Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit vehicle 1 Did not impact None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 5	Seated passenger
NE32 4HT	

***Description
of Location***

BOLDON LANE J/W LIDL SOUTH SHIELDS

***Description
of Accident***

V2 TRAV NORTH ON BOLDON LANE, DRIVER APPLIES BRAKES AS BELIEVES V1 IS GOING TO ENTER THE CARRIAGEWAY FROM LIDL CAR PARK

Slight Accident

Involving 1 Vehicle, 1 Casualty

P129516

Location	South Tyneside A 194 436112E, 565855N	Date/Time	Sunday 28 February 2016 20:27
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Frost/Ice None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (A) Loss of Control (B) Exceeding speed limit (B)

Vehicle 1

Driver	Male, 25 Negative Postcode: NE33 2EY Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Front None Lamp Post	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 25	Not a bus or coach passenger
NE33 2EY	

Description of Location	WESTERN APPROACH APP. 50M FROM J/W REED ST, SOUTH SHIELDS

Description of Accident	V1 TRAV SOUTH WEST ON WESTERN APPROACH HAVING LEFT THE R/ABOUT J/W REED STREET V1 HAS LOST CONTROL ON SLIPPERY ROAD SURFACE LEFT THE ROAD TO THE NEAR SIDE AND COLLIDED WITH A LAMP POST.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0075655

Location	South Tyneside B 1298 436110E, 563805N	Date/Time	Saturday 04 June 2016 03:47
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Impaired by alcohol (A) Other (A)

Vehicle 1

Driver	Male, 28 Not provided (medical reasons) Postcode: NE32 5TH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Tree	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North East Turning left Skidded Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 28	Not a bus or coach passenger
NE32 5TH	

Vehicle 2

Driver	Male, 42 Negative Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

BOLDON LANE B1298 AT JN WITH JOHN REID ROAD A1300

***Description
of Accident***

VEHS TRAV. S/W ON WESTERN APPROACH APP. R/ABOUT J/W BOLDON LANE, V2 (POLICE VEH) FOLLOWING V1, ILLUMINATES BLUE LIGHTS FOR V1 TO STOP, V1 FAILS TO STOP, MAKING OFF AT SPEED, V1 INCREASED DISTANCE, ON APPROACH TO R/ABOUT J/W JOHN REID ROAD, TURNS LEFT TO SOON, LEAVING CARRIAGEWAY TO N/S, TRAV. DOWN EMBANKMENT, DRIVER MAKES OFF FROM SCENE. DRIVER OF V1 DETAINED BY POLICE DOG A SHORT DISTANCE AWAY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0077267

Location	South Tyneside 434416E, 564302N	Date/Time	Tuesday 07 June 2016 14:40
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Distraction in vehicle (A)

Vehicle 1

Driver	Female, 51 Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Parked No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 34 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 52	Not a bus or coach passenger

***Description
of Location***

SHAFTESBURY AVENUE

***Description
of Accident***

V2 PARKED ON SHAFTESBURY AVENUE WITH 3 OCCUPANTS FACING NORTH WEST. V1 PULLS UP BEHIND V2, DRIVER OF V1 DOES NOT PUT HANDBRAKE ON VEHICLE, DRIVER REACHES TO PICK SOMETHING UP FROM FLOOR KEEPING FOOT BRAKE APPLIED WITH AUTOMATIC GEAR IN DRIVE, EDGES FORWARD AND AT SLOW SPEED AND LOW IMPACT HITS REAR OF V2.

Slight Accident

Involving 2 Vehicle, 4 Casualties

0072407

Location	South Tyneside B 1298 436524E, 565385N	Date/Time	Monday 30 May 2016 04:00
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 33 Driver not contacted at time of accident Postcode: NE33 4SB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 4 - Slight

Driver or rider	Not a car passenger
Male 33	Not a bus or coach passenger
NE33 4SB	

Vehicle 2

Driver	Male, 53 Not requested Postcode: NE34 9JA Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 53	Not a bus or coach passenger
NE34 9JA	

Casualty 2 - Slight

Vehicle or pillion passenger

Female 23

NE35 9DP

Front seat passenger

Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger

Female 20

NE35 9DP

Rear seat passenger

Not a bus or coach passenger

Description of Location

STANHOPE ROAD B1298 NEAR JN WITH WEST PARK ROAD

Description of Accident

V2 IS A TAXI AND HAD 2 PASSENGERS ON BOARD. HE HAS BEEN DRIVING ALONG STANHOPE ROAD, SOUTH SHIELDS TOWARDS BOLDON LANE AND AS HE HAS APPROACHED THE JUNCTION WITH WEST PARK ROAD HE HAS SEEN V1 STOPPED AT THE JUNCTION. V1 HAS THEN SUDDENLY PULLED OUT FROM THE WEST PARK ROAD IN FRONT OF V2 WHO HAS TRIED TO STOP HOWEVER COULDN'T AND HIT THE SIDE OF V1. V1 WHEN HIT HAS BEEN SPUN ROUND. THE DRIVER OF V1 HAS THEN STARTED HIS ENGINE AFTER 3 TO 4 ATTEMPTS THEN DROVE OFF WITHOUT SPEAKING TO THE DRIVER OF

Serious Accident

Involving 2 Vehicle, 1 Casualty

0070556

Location	South Tyneside A 194 435569E, 565004N	Date/Time	Friday 27 May 2016 07:10
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1302
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 61 Negative Postcode: NE34 0QQ Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 42 Not applicable Postcode: NE33 4TH Journey as part of work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	42	Not a bus or coach passenger
NE33 4TH		

***Description
of Location***

WESTERN APPROACH A194 NEAR JN WITH BOLDON LANE B1302

***Description
of Accident***

VEH 2 A PEDAL CYCLIST TRAVELLING WEST ON A194 WESTERN APPROACH SOUTH SHIELDS, VEH 1 APPROACHES ROUNDABOUT FROM HUDSON STREET FAILS TO NEGOTIATE PRESENCE OF VEH 2 ENTERING ROUNDABOUT COLLIDING WITH THE REAR WHEEL OF THE PEDAL CYCLE CAUSING RIDER TO FALL TO GROUND CAUSING MINOR INJURIES AN DAMAGE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0077183

Location	South Tyneside A 1300 434950E, 563461N	Date/Time	Saturday 18 June 2016 17:57
Road	Dual Carriageway 50	Junction	Roundabout Give way or uncontrolled
Conditions	Darkness - Street Lights present but unlit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Vehicle door opened or closed negligently (A)

Vehicle 1

Driver	Male, 52 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 22	Not a bus or coach passenger
DH5 9BG	

Description of Location	JOHN REID ROAD A1300 NEAR JN WITH WINSKELL ROAD

Description of Accident	VEHICLE 1 TRAVELLING EAST ALONG A1300 JOHN REID ROAD, NEGOTIATE ROUNDABOUT AND CONTINUE ALONG A1300, FRONT SEAT PASSENGER THEN OPEN FRONT PASSENGER DOOR AND JUMP FROM MOVING VEHICLE. SLIGHT INJURY TO HEAD AS A RESULT

Slight Accident

Involving 2 Vehicle, 1 Casualty

0052778

Location	South Tyneside A 194 435891E, 565546N	Date/Time	Friday 18 March 2016 12:00
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Disobeyed "Give Way" or "Stop" sign or markings (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 25 Driver not contacted at time of accident Postcode: NE33 5DF Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	25	Not a bus or coach passenger
NE33 5DF		

***Description
of Location***

WESTERN APPROACH A194 NEAR JN WITH BARNES ROAD

***Description
of Accident***

V2 TRAVELING APPROXIMATELY EAST ON BARNES ROAD AND ONTO THE ROUNDABOUT WITH WESTERN APPROACH. VEHICLE 1 IS TRAVELING APPROXIMATELY NORTH BOUND. PRIOR TO THE RIDER OF V2 LEAVING THE ROUND ABOUT DRIVER OF V1 ENTERS THE ROUND ABOUT MAKING CONTACT WITH V2 KNOCKING THE RIDER TO THE FLOOR. VEHICLE MAKES NO ATTEMPT TO STOP AND CONTINUES NORTH ON WESTERN APPROACH. RIDER OF V2 HAS MINOR LEG INJURY DUE TO THE FALL ONTO THE CARIDGEWAY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0087094

Location	South Tyneside 436625E, 565919N	Date/Time	Tuesday 28 June 2016 16:45
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B) Failed to look properly (B)

Vehicle 1

Driver	Female, 62 Driver not contacted at time of accident Postcode: NE33 3PD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 14 Not applicable Postcode: NE33 4EW Pupil riding to/from school	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	14	Not a bus or coach passenger
NE33 4EW		

***Description
of Location***

BYRON STREET AT JN WITH B1301 B1301

***Description
of Accident***

V1 PARKED ON BYRON ST, MOVES OFF FROM PARKING SPACE, TRAV. S TOWARDS J/W DEAN RD, V2 ENTERS BYRON ST FROM NEARSIDE PAVEMENT, V1 COLLIDES WITH V2, KNOCKING RIDER FROM V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0066183

Location	South Tyneside A 194 435681E, 565110N	Date/Time	Sunday 01 May 2016 12:57
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled C 402
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to South East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 50 Driver not contacted at time of accident Postcode: DH3 1BL Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 57	Seated passenger
NE31 2RW	

***Description
of Location***

SLAKE TERRACE A194 AT JN WITH TEMPLE TOWN C402

***Description
of Accident***

V2 TRAV. N/E ON A194 ENTERING R/ABOUT J/W TEMPLE TOWN INTENDING TO CONTINUE N/E ON A194 IN O/S LANE, V1 TRAV. S/E ON TEMPE TOWN, ENTERING R/ABOUT, TURNING LEFT INFRONT OF V2 CAUSING V2 TO BRAKE SUDDENLY, PASSENGER ON V2 FALLS FROM SEAT CAUSING INJURY.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0083657

Location	South Tyneside A 194 435152E, 564599N	Date/Time	Sunday 12 June 2016 12:15
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Loss of Control (A)

Vehicle 1

Driver	Male, 20 Negative Postcode: NE33 4RF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside Kerb None	Location	Footway (pavement) Leaving roundabout
		Movement	Vehicle moving from North East to South West Going ahead right hand bend Skidded Left carriageway nearside

Casualty 1 - Slight

Pedestrian		On footway or verge
Female	40	Unknown or other
NE34 0LJ		North West

Description of Location NEWCASTLE ROAD A194 AT JN WITH ELSWICK WAY

Description of Accident V1 LEFT THE ROAD TO THE NEAR SIDE WHILST EXITING A ROUNDABOUT JUNCTION. V1 MOUNTED THE FOOTPATH AND RAN OF THE FOOT OF A PEDESTRIAN WALKING ON THE FOOTPATH AND KNOCKED HER TO THE GROUND CAUSING MINOR INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0079824

Location	South Tyneside A 194 433987E, 563695N	Date/Time	Sunday 01 May 2016 16:10
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine with high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 56 Negative Postcode: NE32 4HY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Changing lane to right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 26 Negative Postcode: NE32 3TD Not known	Vehicle	Motorcycle - Unknown cc No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	26	Not a bus or coach passenger
NE32 3TD		

***Description
of Location***

LEAM LANE A194 NEAR JN WITH HADRIAN ROAD

***Description
of Accident***

VEHICLE 1 WAS AT THE JUNCTION LINKING HADRIAN ROAD TO THE A194 LEAM LANE WHICH IS A DUAL CARRIAGEWAY. THIS JUNCTION IS A LEFT TURN ONLY AND THERE WAS A BUILD UP OF TRAFFIC IN BOTH LANES OF THE A194. A LARGE VAN TRAVELLING ON THE A194 NORTH EAST GAVE WAY TO V1 ALLOWING HIM TO PULL OUT INTO THE 1ST LANE. V1 THEN MOVED IMMEDIATELY FROM LANE ONE INTO LANE TWO INTO THE PATH OF V2 WHO WAS TRAVELLING BEHIND. V2 HAD TO DO AN EMERGENCY STOP WHICH CAUSED THE RIDER TO FALL OFF HIS BIKE ONTO THE ROAD AND HIS

Slight Accident

Involving 1 Vehicle, 1 Casualty

0084328

Location	South Tyneside 436730E, 565361N	Date/Time	Monday 27 June 2016 08:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from West to North Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Female	13	Crossing from driver's offside
NE33 5RU		West

Description of Location	DULVERTON AVENUE NEAR JN WITH READING ROAD

Description of Accident	EDESTRIAN ONE WAS WALKING WEST ON READING ROAD, SOUTH SHIELDS. AS SHE APPROACHED IT'S JUNCTION WITH DULVERTON AVENUE, SHE WAITED AT THE KERB FOR AN ONCOMING VEHICLE. THIS VEHICLE, ONLY DESCRIBED AS LARGE AND BLACK GAVE WAY FOR HER TO CROSS. A FRIEND CALLED OUT TO HER, SHE TURNED AROUND ON THE EDGE OF THE ROAD AND VEHICLE ONE RAN OVER HER FOOT. VEHICLE ONE FAILED TO STOP.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0097036

Location	South Tyneside 434133E, 564863N	Date/Time	Wednesday 20 July 2016 12:05
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled A 185
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Loss of Control (B) Failed to judge other person's path or speed (A) Sudden braking (B) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 51 Not requested Postcode: NE34 9QT Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to West Waiting to turn left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	51	Not a bus or coach passenger
NE34 9QT		

***Description
of Location***

ABBOTSWAY AT JN WITH JARROW ROAD A185

***Description
of Accident***

VEHICLE NUMBER 2 WAS DRIVING NORTH DIRECTION ALONG ABBOTSWAY IN JARROW IN SOUTH TYNESIDE AS WAS VEHICLE NUMBER 1. VEHICLE NUMBER 2 REACHED THE JUNCTION WITH ABBOTSWAY AND THE JARROW ROAD (A185) AND STOPPED TO GIVE WAY. AT THIS POINT VEHICLE NUMBER 1 HAS COLLIDED INTO THE REAR OF VEHICLE NUMBER 2. DRIVER OF VEHICLE NUMBER 1 HAS ALIGHTED FROM HIS VEHICLE. HE HAS TOLD THE DRIVER OF VEHICLE NUMBER 2 THAT HE HAS NOT GOT ANY INSURANCE. HE HAS PASSED SOME DETAILS WHICH POLICE MAY BE FALSE. HE HAS TH

Slight Accident

Involving 1 Vehicle, 1 Casualty

0089836

Location	South Tyneside A 194 433708E, 563510N	Date/Time	Wednesday 29 June 2016 17:45
Road	Dual Carriageway 60	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (B) Sudden braking (B)

Vehicle 1

Driver	Male, 26 Not requested Postcode: Not known	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Slowing or stopping Skidded and overturned Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 26	Not a bus or coach passenger

Description of Location	LEAM LANE A194

Description of Accident	VEHICLE 1 WAS TRAVELING EASTBOUND ON THE A194 PRIOR TO LINDISFARNE ROUNDABOUT IN JARROW. THE RIDER WAS NEGOTIATING THROUGH HEAVY TRAFFIC MOVING AT UNDER 30 MPH WHEN A VEHICLE AHEAD BRAKES. V1 TO SLOW AND AS HE BRAKED HE DID SO ON THE WHITE LINES THAT DIVIDE CARRIAGEWAY. THE ROAD AT THE TIME WAS WET AFTER PROLONGED HEAVY RAIN THE WHITE LINES CONTRIBUTED TO THE COLLISION AS HE APPLIED THE FRONT AND REAR BRAKES ON THE MOTORCYCLE THEY LOCKED UP AFTER SLIDING ON THE WHITE LINES. V1 CONTROLLED THE

Slight Accident

Involving 1 Vehicle, 1 Casualty

0092088

Location	South Tyneside B 1298 436509E, 565905N	Date/Time	Sunday 10 July 2016 23:12
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Impaired by alcohol (B) Failed to look properly (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	Unknown or other
Male	48
NE33 4AA	Crossing from driver's offside East

Description of Location	CHICHESTER ARMS LAYGATE B1298

Description of Accident	THE INJURED PERSON C001 ALIGHTS V1 WHICH IS A TAXI, C001 IS VERY INTOXICATED AND STUMBLES BEHIND V1. V1 THEN REVERSES AND COLLIDES WITH C001. BOTH C001 AND V1 SPEAK WITH EACH OTHER AND SHAKE HANDS. V1 DRIVES OFF.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0089852

Location	South Tyneside	Date/Time	Wednesday
	434094E, 564237N		06 July 2016
			12:55
Road	Single Carriageway	Junction	Not at or within 20 metres of junction
	20		
Conditions	Daylight - Street Lights Present	Contributory	
	Fine without high winds		Sudden braking (A)
	Dry		
	None		
	None		
	None within 50 metres		
	No physical crossing facility within 50 metres		

Vehicle 1

Driver	Male, 46	Vehicle	Bus or coach (17 or more passenger seats)
	Not applicable		No tow or articulation
	Postcode:	Location	On main carriageway - not in restricted lane
	Journey as part of work		Not at, or within 20 metres of junction
Collisions	Hit no other vehicle	Movement	Vehicle moving from North West to South East
	Did not impact		Going ahead other
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female	68
NE32 3SQ	Seated passenger

Description of Location	TAUNTON AVENUE
Description of Accident	BUS JERKED AS APPROACHED BUS STOP CAUSING PASSENGER TO FALL AND CAUSING INJURY TO BOTTOM. BUS STAGECOACH NO 10 TICKET 49386 TRIP21 BUS 37303 DUTY 917 DRV 64284

Slight Accident

Involving 1 Vehicle, 1 Casualty

0089030

Location	South Tyneside 434786E, 563738N	Date/Time	Wednesday 06 July 2016 10:23
Road	Single Carriageway 20	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Other (B)

Vehicle 1

Driver	Male, 40 Not applicable Postcode: SR6 7PS Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 29	Alighting
NE34 9RE	

Description of Location	DAME FLORA ROBSON AVENUE

Description of Accident	THE NO 18 BUS WAS DRIVING ON DAME FLORA ROBSON AVENUE. THE IP WAS STANDING ON THE BUS WHILST IT WAS MOVING. AS THE BUS HAS COME TO A STOP IN THE BUS STOP THE IP HAS STUBBED HER RIGHT BIG TOE CAUSING INJURY TO THE NAIL.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0088213

Location	South Tyneside A 185 434265E, 564915N	Date/Time	Wednesday 20 July 2016 08:33
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Female, 35 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 32 Not requested Postcode: Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Overtaking stationary vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 32	Not a bus or coach passenger

<i>Description of Location</i>	JARROW ROAD A185 AT JN WITH LITTLE JEMS NURSERY CAR PARK
<i>Description of Accident</i>	VEHICLE 2 (MOTORBIKE) HAS BEEN TRAVELLING EAST ALONG JARROW ROAD OVERTAKING STATIONARY TRAFFIC QUEUE. V1 HAS BEEN COMING OUT OF A JUNCTION TO THE NEAR SIDE THROUGH STATIONARY QUEUE WHERE VEHICLE THEN COLLIDES WITH MOTORBIKE.

Serious Accident

Involving 2 Vehicle, 2 Casualties

0084551

Location	South Tyneside A 185 434129E, 564871N	Date/Time	Monday 11 July 2016 14:21
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 33 Negative Postcode: NE33 3HA Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 58 Negative Postcode: NE32 3QG Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	58	Not a bus or coach passenger
NE32 3QG		

Casualty 2 - Serious

Vehicle or pillion passenger

Front seat passenger

Male 45

Not a bus or coach passenger

NE31 2YN

Description of Location

STRAKER STREET A185 NEAR JN WITH ABBOTSWAY

Description of Accident

V1 TRAVELLING EASTBOUND ON A185 TOWARDS SOUTH SHIELDS IN LIGHT TRAFFIC, WITH A SMALL AMOUNT OF TRAFFIC BEHIND. V2 TRAVELLING WESTBOUND ON THE SAME ROAD TOWARDS THE TYNE TUNNEL AGAIN IN A SLIGHT QUEUE OF TRAFFIC MOVING AT NORMAL ROAD SPEEDS. V1 ON APPROACHING THE JUNCTION OF ABBOTSWAY SWERVES INTO THE WESTBOUND LANE OF TRAFFIC FOR AN UNKNOWN REASON. V1 THEN COLLIDES HEAD ON WITH V2 CAUSING EXTENSIVE FRONT END DAMAGE AND INJURIES TO OCCUPANTS OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0099806

Location	South Tyneside B 1301 436572E, 565901N	Date/Time	Monday 29 August 2016 10:40
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 49 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 46 Negative Postcode: Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	46	Not a bus or coach passenger

***Description
of Location***

DEAN ROAD B1301 NEAR JN WITH REAR LANE

***Description
of Accident***

BOTH V1 AND V2 TRAVELLING WEST ON DEAN ROAD, V2 SLOWS TO TURN RIGHT INTO REAR LANE AT LONDONDERRY HALL V1 FAILED TO REACT AND COLLIDED WITH THE REAR OF V2

Slight Accident

Involving 1 Vehicle, 1 Casualty

0104902

Location	South Tyneside B 1298 436141E, 563740N	Date/Time	Thursday 04 August 2016 14:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Failed to look properly (A) Failed to judge vehicle's path or speed (B) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 78 Negative Postcode: NE35 9HE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from North East to South East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	73	Crossing from driver's nearside
NE34 9TA		South West

Description of Location	WHITELEAS WAY B1298 AT JN WITH JOHN REID ROAD A1300

Description of Accident	V1 WAS TRAV SOUTH WEST ON JOHN REID ROAD TURNING LEFT ONTO WHITELEAS WAY WHEN A PEDESTRIAN HAS STEPPED OUT AT THE TRAFFIC LIGHT CROSSING WITHOUT LOOKING AND COLLIDED WITH THE VEHICLE. THE PEDESTRIAN ADMITTED IT WAS HER OWN FAULT AND HAD SMALL GRAZES TO HER ELBOWS AND A GRAZE TO THE RIGHT SIDE OF HER STOMACH.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0106313

Location	South Tyneside C 408 436415E, 565017N	Date/Time	Tuesday 14 June 2016 11:35
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Careless, reckless or in a hurry (A) Failed to look properly (A)

Vehicle 1

Driver	Female, 48 Negative Postcode: SR6 8DN Taking pupil to/from school	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	4	Crossing from driver's nearside
NE33 4SE		East

Description of Location	WEST WAY C408 NEAR JN WITH STANHOPE ROAD B1298

Description of Accident	VEHICLE 1 BEING DRIVEN FROM TEMPLE PARK ROAD, SOUTH SHIELDS ONTO ROUNDABOUT WITH STANHOPE ROAD EXITING ONTO WEST WAY. PEDESTRIAN STEPS OFF NEARSIDE FOOTPATH ONTO ROAD AND WALKS INTO NEARSIDE FRONT WING AREA OF VEHICLE 1 SUSTAINING SCRAPE INJURIES TO FACE. VEHICLE 1 STOPS AND CONTACTS POLICE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0092871

Location	South Tyneside A 19 433712E, 563964N	Date/Time	Friday 05 August 2016 14:45
Road	Dual Carriageway 70	Junction	Slip Road Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 31 Negative Postcode: NE32 4EQ Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	31	Not a bus or coach passenger
NE32 4EQ		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 27

Not a bus or coach passenger

NE33 3NA

Description of Location

A19 AT JN WITH A194

Description of Accident

VEHICLE 2 TRAVELLING SOUTH ON A19 IN LANE ONE IN SLOW MOVING TRAFFIC, FOR REASONS UNKNOWN V1 COLLIDES WITH THE REAR OF V2. DRIVER V1 ALIGHTS FROM VEHICLE AND MAKES OFF FROM SCENE.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0110153

Location	South Tyneside A 194 434457E, 564063N	Date/Time	Saturday 06 August 2016 22:15
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 14 Not applicable Postcode: NE33 3HA Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 14	Not a bus or coach passenger
NE33 3HA	

Vehicle 2

Driver	Male, 18 Negative Postcode: NE32 4PE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Female, 63
Negative
Postcode:
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle moving from North East to South West
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

**Description
of Location** NEWCASTLE ROAD A194

**Description
of Accident** 4 CYCLISTS CROSSED NEWCASTLE ROAD (A194 TOWARDS SOUTH SHIELDS) USING THE FOOTPATH FROM THE CENTRAL RESERVATION. THE LAST OF THE 4 CYCLISTS, VEHICLE 1, MISJUDGED THE SPEED OF THE ONCOMING TRAFFIC AND VEHICLE 2 WHICH WAS TRAVELLING IN LANE 2 CLIPPED THE REAR WHEEL OF THE BIKE WHICH CAUSED THE CYCLIST TO LOOSE CONTROL OF THE BIKE. CYCLIST LANDS ON THE BONNET OF VEHICLE 3 WHICH WAS TRAVELLING IN LANE 1

Slight Accident

Involving 4 Vehicle, 3 Casualties

0111863

Location	South Tyneside A 194 433452E, 563352N	Date/Time	Monday 03 October 2016 14:43
Road	Dual Carriageway 70	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Aggressive driving (A)

Vehicle 1

Driver	Male, 27 Negative Postcode: NE32 5HS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside Bollard/Refuge None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Changing lane to right Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 27	Not a bus or coach passenger
NE32 5HS	

Vehicle 2

Driver	Male, 60 Negative Postcode: NE33 4LH Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Changing lane to right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Female, 25
Negative
Postcode: NE34 0HP
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from West to East
Going ahead other
Skidded
Did not leave carriageway

Casualty 3 - Slight

Driver or rider
Female 25
NE34 0HP

Not a car passenger
Not a bus or coach passenger

Vehicle 4

Driver Female, 69
Not provided (medical reasons)
Postcode: NE5 5DP
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from West to East
Going ahead other
Skidded
Did not leave carriageway

Casualty 4 - Slight

Driver or rider
Female 69
NE5 5DP

Not a car passenger
Not a bus or coach passenger

**Description
of Location** A194

**Description
of Accident** IT APPEARS THAT V1 HAS BEEN TRAVELLING EAST ON A194 TOWARDS SOUTH SHIELDS , V1 HAS ATTEMPTED TO OVERTAKE V2 (BUS) WHICH HAS BEEN CHANGING LANE FROM 1 TO 2 APPROACHING THE ROAD WORK SYSTEM. V1 HAS LOST CONTROL AND COLLIDED WITH V2 , V1 HAS THEN SKIDDED OUT OF CONTROL COLLIDING WITH V3 WHICH HAS COLLIDED WITH V4.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0111436

Location	South Tyneside B 1301 436474E, 565869N	Date/Time	Sunday 02 October 2016 20:49
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	Impaired by alcohol (A) Failed to judge vehicle's path or speed (B)

Vehicle 1

Driver	Male, 53 Negative Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere within 50 metres of pedestrian crossing
Male	26	Crossing from driver's offside East

Description of Location	DEAN ROAD B1301 NEAR JN WITH CHICHESTER ROAD

Description of Accident	V1 TRAVELS SOUTH ON DEAN RD, PEDESTRIAN CROSSING WEST TO EAST ON ROAD AHEAD OF V1 THEN RUNS AT V1 AS IF PLAYING 'CHICKEN'- PEDESTRIAN IS HIT BY V1 FRONT- PEDESTRIAN IS HEAVILY INTOXICATED

Slight Accident

Involving 2 Vehicle, 1 Casualty

0114592

Location	South Tyneside A 1018 436845E, 566069N	Date/Time	Friday 12 August 2016 10:39
Road	One way street 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A) Vehicle in course of crime (B) Aggressive driving (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 20 Driver not contacted at time of accident Postcode: NE34 0TL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Kerb Lamp Post	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other Skidded Left carriageway offside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 20	Not a bus or coach passenger
NE34 0TL	

Vehicle 2

Driver	Male, 35 Negative Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

IMEARY STREET A1018 AT JN WITH GEORGE POTTS STREET

***Description
of Accident***

VEH 1 SOUTH ON BYRON ST FOLLOWED BY VEH 2 (POL VEH) WHO ILLUMINATED LIGHTS AND SIREN IN AN ATTEMPT TO STOP VEH 1, VEH 1 TURNED LEFT ONTO DEAN RD, TRAV. E AT SPEED TOWARDS R/ABOUT J/W IMEARY ST, FAILING TO STOP FOR VEH 2, VEH 2 TERMINATED PURSUIT, VEH 1 TURNED LEFT ONTO IMEARY ST APP. J/W GEORGE POTTS ST , VEH 1 SKIDS, COLLIDING WITH O/S KERB, LEAVES CARRIAGEWAY, COLLIDING WITH LAMPOST, VEH 2 TURNS LEFT ONTO IMEARY ST AND SEES VEH 1 HAS CRASHED. DRIVER OF VEH 1 RUNS FROM SCENE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0114175

Location	South Tyneside A 194 433860E, 563583N	Date/Time	Monday 22 August 2016 18:10
Road	Dual Carriageway 30	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 43 Driver not contacted at time of accident Postcode: NE10 8UW Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 43	Not a bus or coach passenger
NE10 8UW	

Casualty 2 - Slight

Vehicle or pillion passenger

Rear seat passenger

Male 11

Not a bus or coach passenger

NE10 8UW

Description of Location

A194 LEAM LANE A194 AT JN WITH A19

Description of Accident

VEHICLE 2 WAS ON ROUNDABOUT ON RIGHT HAND LANE OF A TWO LANED ROUNDABOUT HEADING STRAIGHT AHEAD. VEHICLE 1 WAS IN LEFT HAND LANE ON SAME ROAD TURNING LEFT. AS BOTH VEHICLES DROVE AT SLOW SPEED AROUND ROUNDABOUT, VEHICLE 1 CUT ACROSS PATH OF VEHICLE 2 CAUSING COLLISION AND MINOR DAMAGE TO BOTH VEHICLES AND INJURY TO DRIVER AND 1 PASSENGER IN REAR SEAT OF VEHICLE 2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0115463

Location	South Tyneside A 194 435899E, 565203N	Date/Time	Friday 26 August 2016 19:57
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled C 408
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Illness or disability, mental or physical (A) Distraction in vehicle (B) Poor turn or manoeuvre (A)

Vehicle 1

Driver	Male, 56 Not requested Postcode: NE35 9ES Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Nearside or offside crash barrier	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North to South East Going ahead other Overturned Left carriageway nearside and rebounded

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 56	Not a bus or coach passenger
NE35 9ES	

Description of Location	WESTERN APPROACH A194 NEAR JN WITH WEST WAY C408
Description of Accident	V1 TRAVELING FROM SOUTH SHIELDS ON WESTERN APPROACH(A194), ENTERS ROUNDABOUT INTENDING TO TAKE THE SECOND EXIT ONTO WESTWAY. V1 COLLIDES WITH THE METAL BARRIER ON THE PAVEMENT BETWEEN THE JUNCTION OF DEAN ROAD AND WESTWAY, CAUSING DAMAGE TO THE BARRIER AND ROLLS ONTO THE OFFSIDE OF THE VEHICLE ON WESTWAY, COMING TO A HALT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0119164

Location	South Tyneside B 1298 436553E, 565602N	Date/Time	Saturday 17 September 2016 11:18
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Exceeding speed limit (B)

Vehicle 1

Driver	Male, 25 Negative Postcode: SR3 1PX Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to East Waiting to turn right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 58 Negative Postcode: NE34 7SZ Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	58	Not a bus or coach passenger
NE34 7SZ		

***Description
of Location***

STANHOPE ROAD B1298 NEAR JN WITH OXFORD STREET

***Description
of Accident***

V1 WAS TRAVELLING NORTH ALONG STANHOPE ROAD AND INTENDED TO TAKE A RIGHT TURN EAST BOUND ALONG OXFORD ROAD, THE DRIVER OF V1 POSITIONED HIS VEHICLE TO CHECK FOR TRAFFIC. V2 WAS TRAVELLING SOUTH BOUND ALONG STANHOPE ROAD, AFTER BEING TEMPORARILY HELD UP AT TRAFFIC LIGHTS ON STANHOPE PARADE. V2 COLLIDED WITH V1 AS THE DRIVER OF V1 WAS EDGING FORWARD TO TURN RIGHT.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0116972

Location	South Tyneside C 406 435883E, 564034N	Date/Time	Monday 17 October 2016 19:29
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 26 Negative Postcode: NE34 6PE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from South to East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian	In carriageway, crossing elsewhere
Male	Crossing from driver's nearside
74	East
NE34 0TW	

Description of Location	LAVENDER LANE C406 AT JN WITH GREEN LANE

Description of Accident	IT APPEARS VEHICLE 1 TRAVELLING WEST ALONG GREEN LANE, TURN RIGHT (NORTH) INTO LAVENDER LANE, CUTTING THE CORNER, FAIL TO SEE A PEDESTRIAN CROSSING THE ROAD AND COLLIDE INTO PEDESTRIAN. HEAD INJURY RECEIVED TO PEDESTRIAN AS A RESULT. PEDESTRIAN CONVEYED TO SOUTH TYNESIDE DISTRICT HOSPITAL FOR TREATMENT.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0117968

Location	South Tyneside B 1297 433346E, 565089N	Date/Time	Thursday 20 October 2016 08:24
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 185
Conditions	Daylight - Street Lights Present Other Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 56 Negative Postcode: NE9 5EA Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 55 Not applicable Postcode: NE32 3LD Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	55	Not a bus or coach passenger
NE32 3LD		

***Description
of Location***

PRIORY ROAD B1297 NEAR JN WITH A185

***Description
of Accident***

V1 WAS TRAVELLING NORTH-EAST FROM THE A185 AND ONTO THE B1297 PRIORY ROAD, JARROW. AT THE SAME TIME V2 WAS CROSSING THE B1297 FROM NORTH TO SOUTH WHEN BOTH VEHICLES CAME INTO CONTACT WHICH RESULTED IN THE RIDER ON V2 SUSTAINING SERIOUS INJURY

Slight Accident

Involving 3 Vehicle, 1 Casualty

0134357

Location	South Tyneside A 194 434247E, 563841N	Date/Time	Monday 05 December 2016 08:33
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Disobeyed "Give Way" or "Stop" sign or markings (A)

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 44 Negative Postcode: NE21 5PH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to South East Going ahead right hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	44	Not a bus or coach passenger
NE21 5PH		

Vehicle 3

Driver Female, 46
Negative
Postcode: NE31 2GB
Commuting to/from work

Collisions Hit no other vehicle
Front
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Mid junction - on roundabout or on main road

Movement Vehicle moving from South West to South East
Going ahead right hand bend
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location HADRIAN ROAD A194 AT JN WITH JOHN REID ROAD A1300

Description of Accident UNKNOWN VEHICLE 1 FAILS TO GIVE WAY AT ROUNDABOUT JUNCTION CAUSING VEH2 TO BRAKE HEAVILY. VEH3 COLLIDES WITH REAR OF VEH2. DRIVER VEH2 SUFFERS MINOR WHIPLASH TYPE INJURY. VEH1 FAILS TO STOP AT SCENE OF RTC.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0135139

Location	South Tyneside A 194 435880E, 565232N	Date/Time	Thursday 22 September 2016 08:10
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled
Conditions	Darkness - Street Lights present but unlit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B) Failed to look properly (A)

Vehicle 1

Driver	Male, 43 Driver not contacted at time of accident Postcode: NE34 6EB Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 11 Not applicable Postcode: NE34 9RN Pupil riding to/from school	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	11	Not a bus or coach passenger
NE34 9RN		

Casualty 2 - Slight

Vehicle or pillion passenger

Not a car passenger

Male

11

Not a bus or coach passenger

Description of Location

WESTERN APPROACH A194 AT JN WITH DEAN ROAD

Description of Accident

VEHICLE 1 HAS BEEN STATIONARY AT THE ROUNDABOUT AT THE JUNCTION OF WESTERN APPROACH, DEAN ROAD AND WEST WAY SOUTH SHIELDS. VEHICLE 1 WAS IN THE RIGHT LANE OF THE DUAL CARRIAGE WAY STATIONARY AT THE ROUNDABOUT. THE DRIVER WAS LOOKING TO THE RIGHT AT THE TRAFFIC COMING ROUND THE ROUNDABOUT AND PULLED OUT ONTO THE ROUNDABOUT WHEN THERE WAS A GAP IN THE TRAFFIC. THE VEHICLE IN THE LEFT LANE HAD STOPPED AND WAVED ACROSS A MALE ON A PEDAL CYCLE WHO CROSSED THE ROAD IN FRONT OF VEHICLE 1. VEHICLE 1 HI

Slight Accident

Involving 1 Vehicle, 1 Casualty

0139526

Location	South Tyneside 435959E, 564538N	Date/Time	Friday 02 December 2016 13:00
Road	Single Carriageway 30	Junction	Other junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Failed to judge other person's path or speed (A) Failed to look properly (B)

Vehicle 1

Driver	Female, 20 Driver not contacted at time of accident Postcode: SR6 7HD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	73	Crossing from driver's nearside
NE34 9AQ		East

Description of Location	2-4 STODDART STREET

Description of Accident	C1 WAS WALKING FROM STODART STREET AND CROSSED THE REAR LANE OF BOLDON LANE, SOUTH SHIELDS IN A EASTERLY DIRECTION FROM THE REAR OF FRANKIES FISH AND CHIP SHOP TOWARDS THE CAR PARK. AS C1 WAS IN THE ROADWAY CROSSING THE ROAD V1 APPROACHES TRAVELLING IN A SOUTHERLY DIRECTION AND V1 STRIKES C1 AROUND THE NEAR SIDE HEADLAMP OF V1'S MOTOR VEHICLE CAUSING C1 TO SPIN AND FALL TO THE FLOOR.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0140010

Location	South Tyneside 436502E, 564466N	Date/Time	Friday 16 December 2016 11:05
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Overtaking stationary vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle was Parked Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, not crossing
Male	52	Walking along in carriageway - back to traffic
NE34 7PE		North

***Description
of Location***

TALBOT ROAD NEAR JN WITH HARTON LANE

***Description
of Accident***

V2 WAS PARKED STATIONARY FACING SOUTH IN THE MIDDLE OF TALBOT ROAD, SOUTH SHIELDS WHILST OPERATIVES WERE COLLECTING RUBBISH BINS FROM NEARBY PREMISES. V1 HAS DRIVEN NORTH FROM HARTON LANE BETWEEN V2 AND THE BUILDING LINE TO GET PAST IT AND IN DOING SO HAS HIT ONE OF THE BIN OPERATIVES WALKING ALONG THE PAVEMENT CAUSING INJURY.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0139895

Location	South Tyneside A 194 433956E, 563659N	Date/Time	Friday 16 December 2016 12:07
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (A)

Vehicle 1

Driver	Male, 66 Negative Postcode: NE65 7RP Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 51 Negative Postcode: NE10 9NS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	51	Not a bus or coach passenger
NE10 9NS		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 51

Not a bus or coach passenger

NE10 9NS

Description of Location

NEWCASTLE ROAD A194

Description of Accident

IT APPEARS THAT VEHICLE 1 HAS FAILED TO SEE VEHICLE 2 SLOWING/STOPPING INFRONT OF THEM, DUE TO ROAD WORKS/SLOW MOVING TRAFFIC. VEHICLE 1 COLLIDE INTO REAR OF VEHICLE 2, CAUSING SLIGHT INJURY TO DRIVER AND FRONT SEAT PASSENGER VEHICLE 2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0145934

Location	South Tyneside A 185 433946E, 564826N	Date/Time	Thursday 29 September 2016 16:40
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (B) Failed to look properly (B)

Vehicle 1

Driver	Female, 37 Driver not contacted at time of accident Postcode: NE33 5RU Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Previous accident None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 18 Driver not contacted at time of accident Postcode: NE33 4SL Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	18	Not a bus or coach passenger
NE33 4SL		

***Description
of Location***

STRAKER STREET A185 AT JN WITH CHURCH BANK

***Description
of Accident***

VEHICLES TRAV. SOUTH WEST ON STRAKER STREET, VEHICLE 2 STATIONARY IN TRAFFIC AT J/W CHURCH BANK, VEHICLE 1 TRAV. BEHIND, FAILS TO STOP IN TIME, COLLIDING WITH REAR OF VEHICLE 2, DRIVER OF VEHICLE2 INDICATED TO OTHER DRIVER TO PULL INTO BUS STOP TO EXCHANGE DETAILS, VEHICLE 1 FAILED TO STOP, DRIVING STRAIGHT PAST

Slight Accident

Involving 2 Vehicle, 3 Casualties

0148461

Location	South Tyneside A 194 434502E, 564060N	Date/Time	Thursday 12 January 2017 08:30
Road	Single Carriageway 40	Junction	T or staggered junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Female, 29 Negative Postcode: NE32 3SD Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 41 Negative Postcode: SR6 7LY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	41	Not a bus or coach passenger
SR6 7LY		

Casualty 2 - Slight

Vehicle or pillion passenger

Male 50

NE34 7TH

Front seat passenger

Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger

Male 48

NE34 7TF

Rear seat passenger

Not a bus or coach passenger

Description of Location

NEWCASTLE ROAD A194 AT JN WITH HENDERSON ROAD

Description of Accident

VEHICLE TWO HAS BEEN TRAVELLING WEST BOUND ON NEWCASTLE ROAD PASSING THE JUNCTION WITH HENDERSON ROAD WHEN VEHICLE ONE HAS PULLED OUT OF THE JUNCTION COLLIDING WITH VEHICLE TWO SENDING IT INTO THE BARRIERS AND INTO THE CENTRAL RESERVATION WHERE THE OCCUPANTS WERE EJECTED FROM THE VEHICLE.

Slight Accident

Involving 2 Vehicle, 5 Casualties

0146522

Location	South Tyneside A 183 436570E, 566886N	Date/Time	Friday 30 December 2016 02:00
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Disobeyed automatic traffic signal (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 48 Not requested Postcode: NE33 2HF Not known	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 48	Not a bus or coach passenger
NE33 2HF	

Casualty 5 - Slight

Vehicle or pillion passenger	Rear seat passenger
Male 49	Not a bus or coach passenger

Vehicle 2

Driver	Male, 23 Negative Postcode: NE31 1SG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider

Male 23

NE31 1SG

Not a car passenger

Not a bus or coach passenger

Casualty 4 - Slight

Vehicle or pillion passenger

Male 43

Rear seat passenger

Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger

Male 22

SR5 2AB

Front seat passenger

Not a bus or coach passenger

Description of Location

FOWLER STREET A183

Description of Accident

A TAXI(VEHICLE 1)HAS BEEN HEADING UP FOWLER STREET AND HAS STOPPED AT THE JUNCTION DUE TO THE RED LIGHT, A GREY SUZUKI SWIFT (VEHICLE 2)HAS BEEN HEADING DOWN THE A183 TOWARDS BEACH ROAD. THE TRAFFIC LIGHT HAS BEEN READ WITH A GREEN FILTER TO TURN LEFT DOWN FOWLER STREET, HOWEVER THE GREY SUZUKI (VEHICLE 2) HAS DRIVEN THROUGH THE RED LIGHT AND HIT THE TAXI AS HIS LIGHT HAS TURNED GREEN AND HE HAS MOVED THROUGH THE JUNCTION.

Serious Accident

Involving 1 Vehicle, 3 Casualties

0154219

Location	South Tyneside 436571E, 566900N	Date/Time	Saturday 22 October 2016 11:53
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled A 183
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Sudden braking (B)

Vehicle 1

Driver	Male, 54 Not requested Postcode: NE12 6DG Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Vehicle or pillion passenger	Not a car passenger
Female 80	Seated passenger
NE31 1QF	

Casualty 3 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 50	Seated passenger
NE33 5LE	

Casualty 2 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 68	Seated passenger
NE34 6EE	

Description of Location FOWLER STREET AT JN WITH BEACH ROAD A183

Description of Accident BUS HAS BEEN TRAVELLING SOUTH ON FOWLER STREET SOUTH SHIELDS APPROACHING A JUNCTION AND THE DRIVER HAS HAD TO BRAKE HARD TO AVOID ANOTHER VEHICLE. ALTHOUGH NO COLLISION HAS OCCURED 3 PERSONS TRAVELLING ON THE BUS HAVE FALLEN OVER.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0152317

Location	South Tyneside A 1300 437444E, 564334N	Date/Time	Wednesday 01 February 2017 14:40
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 53 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 87	Seated passenger

Description of Location	SUNDERLAND ROAD A1300 NEAR JN WITH A1018

Description of Accident	THE VEHICLE WAS TRAVELLING TOWARDS THE ROUNDABOUT, DUE TO VEHICLES ON THE ROUNDABOUT HE HAS APPLIED HIS BRAKED HARD AND AN ELDERLY FEMALE PASSENGER HAS FELL FORWARD ON TO LUGGAGE RACK AND INJURED HERSELF

Slight Accident

Involving 2 Vehicle, 1 Casualty

0154068

Location	South Tyneside C 414 437320E, 564841N	Date/Time	Monday 06 February 2017 15:55
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Male, 60 Driver not contacted at time of accident Postcode: SR7 7PX Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South to West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female	Seated passenger

Vehicle 2

Driver	Male, Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

HARTON LANE C414 AT JN WITH KING GEORGE ROAD A1018

***Description
of Accident***

SCHOOL BUS TURNING LEFT ONTO HARTON LANE FROM KING GEORGE ROAD SOUTH SHIELDS HAS HAD TO BREAK FOR CHILD CROSSING ROAD ON PEDAL BIKE. BUS KNOCKED CHILD OVER BUT CAUSED NO INJURIES. PASSENGER ON BUS HAS BUMPED HEAD WHEN BUS HAD TO BREAK.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0156827

Location	South Tyneside A 1018 436815E, 566124N	Date/Time	Tuesday 13 September 2016 07:00
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Poor turn or manoeuvre (B)

Vehicle 1

Driver	Female, 26 Negative Postcode: NE33 2NX Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 35 Not applicable Postcode: SR3 1YN Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	35	Not a bus or coach passenger
SR3 1YN		

***Description
of Location***

IMERY STREET A1018 AT JN WITH EAST STEVENSON STREET

***Description
of Accident***

VEHICLE 1 HAS PULLED OUT OF EAST STEVENSON STREET, CROSSING IMEARY STREET HEADING TOWARDS WEST STEVENSON STREET. THE CYCLIST HAS BEEN TRAVELLING ALONG IMEARY STREET. VEHICLE 1 HAS NOT LOOKED PROPERLY AND NOT SEEN THE CYCLIST BEFORE MOVING OFF CAUSING CYCLIST TO COLLIDE WITH THE VEHICLE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0157756

Location	South Tyneside B 1298 436572E, 565795N	Date/Time	Sunday 30 October 2016 16:05
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal C 413
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 25 Not requested Postcode: NE33 5PW Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 45 Not requested Postcode: NE31 1JQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	45	Not a bus or coach passenger
NE31 1JQ		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 45

Not a bus or coach passenger

NE33 5PW

Description of Location

STANHOPE ROAD B1298 AT JN WITH MORTIMER ROAD C413

Description of Accident

V1 HAS BEEN DRIVING IN A NORTHERLY DIRECTION ALONG STANHOPE ROAD AND APPROACHED THE JUNCTION AT THE TRAFFIC LIGHTS AT STANHOPE PARADE. V2 HAS BEEN TRAVELING IN THE OPPOSITE DIRECTION, SOUTHERLY FROM STANHOPE PARADE TOWARDS THE TRAFFIC LIGHTS AT THE JUNCTION. THE LIGHTS HAVE CHANGED TO GREEN, V1 HAS ATTEMPTED TO TURN RIGHT ONTO MORTIMER ROAD AND COLLIDED WITH V2 WHO WAS DRIVING STRAIGHT AHEAD.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0160119

Location	South Tyneside A 194 433772E, 563498N	Date/Time	Wednesday 01 March 2017 10:20
Road	Slip Road 60	Junction	Roundabout A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 40 Driver not contacted at time of accident Postcode: TS28 5BY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	40	Not a bus or coach passenger
TS28 5BY		

***Description
of Location***

LEAM LANE A194 AT JN WITH A19 A194

***Description
of Accident***

V2 STATIONARY AT LINDISFARNE ROUNDABOUT AT JUNCTION A194 LEAM LANE AND A19 WAITING TO ENTER ROUNDABOUT. V1 APPROACHES ROUNDABOUT AND FAILS TO STOP IN TIME COLLIDING WITH REAR OF V2. DRIVERS STOP AT SCENE AND DETAILS EXCHANGED. DRIVER OF V2 SUBSEQUENTLY ATTENDED A&E AND FOUND TO HAVE WHIPLASH AND CONCUSSION.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0161619

Location	South Tyneside A 194 436196E, 566202N	Date/Time	Monday 06 March 2017 16:50
Road	Roundabout 40	Junction	Roundabout Automatic traffic signal B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 25 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 41 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North to South Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	41	Not a bus or coach passenger

***Description
of Location***

WESTERN APPROACH A194 AT JN WITH NEW GEORGE STREET B1301

***Description
of Accident***

DRIVER OF V2 HAS BEEN TRAVELLING ACROSS THE WESTERN APPROACH ROUNDABOUT. UPON EXITING THE ROUNDABOUT AN UK VEHICLE HAS BLOCKED THE PATH OF V2 CAUSING DRIVER TO APPLY THE BREAKS. AS A RESULT V1 HAS COLLIDED INTO THE REAR OF V2 CAUSING DAMAGE AND INJURY. BOTH PARTIES HAVE STOPPED AT THE SCENE AND EXCHANGED DETAILS

Slight Accident

Involving 2 Vehicle, 1 Casualty

0161098

Location	South Tyneside A 194 435247E, 564802N	Date/Time	Monday 06 March 2017 09:00
Road	Roundabout 60	Junction	Roundabout Automatic traffic signal A 185
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 35 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 19 Driver not contacted at time of accident Postcode: NE34 7PP Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	19	Not a bus or coach passenger
NE34 7PP		

***Description
of Location***

JARROW ROAD A194 AT JN WITH A185

***Description
of Accident***

DRIVER OF V2 HAS BEEN TRAVELLING EAST BOUND ALONG JARROW ROAD, UPON EXITING ROUNDABOUT V1 HAS COLLIDED WITH THE OFFSIDE OF V2 CAUSING DAMAGE TO THE FRONT AND REAR OFFSIDE DOOR PANELS. DRIVER OF V2 HAS SUSTAINED MINOR WHIPLASH AND INJURY TO NECK AND BACK.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0164237

Location	South Tyneside 434852E, 563770N	Date/Time	Monday 13 March 2017 23:20
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Impaired by alcohol (A)

Vehicle 1

Driver	Male, 48 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 49	Alighting

Description of Location	DAME FLORA ROBSON AVENUE

Description of Accident	VEHICLE 1 IS A SERVICE BUS WHICH WAS COMING TO A STOP AT THE BUS STOP. UPON APPROACH CASUALTY 1, WHO WAS ALSO INTOXICATED, HAS MADE HIS WAY TO THE FRONT OF THE BUS, AND WITHOUT HOLDING ONTO ANY RAILS HAS FALLEN FORWARD AS THE BUS CAME TO A STOP, BANGING HIS HEAD ON THE FRONT PANEL UNDER THE WINDSCREEN. AN AMBULANCE WAS CALLED TO THE SCENE.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0152885

Location	South Tyneside B 1298 435990E, 564059N	Date/Time	Saturday 04 February 2017 19:30
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 405
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 59 Driver not contacted at time of accident Postcode: NE31 2JQ Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 15 Not applicable Postcode: NE34 8EU Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	15	Not a bus or coach passenger
NE34 8EU		

***Description
of Location***

BOLDON LANE B1298 AT JN WITH GREEN LANE C405

***Description
of Accident***

THE CYCLIST (VEH 2) WAS TRAVELLING NORTH ON BOLDON LANE AND HAS BEEN GOING STRAIGHT OVER THE ROUNDABOUT, JUNCTION WITH GREEN LANE. AT THIS TIME VEHICLE 1 HAS ENTERED THE ROUNDABOUT AND FAILED TO SEE THE CYCLIST AND FAILED TO GIVE WAY CAUSING VEHICLE 1 TO COLLIDE WITH THE FRONT OF THE PEDAL CYCLE. THIS HAS CAUSED THE RIDER TO FALL FROM THE CYCLE AND SUSTAIN MNOR INJURIES. THE DRIVER OF VEHICLE 1 HAS STOPPED AND ALIGHTED FROM HIS VEHICLE TO ASSIST THE CASULTY.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0165096

Location	South Tyneside C 413 436918E, 565373N	Date/Time	Sunday 13 November 2016 10:05
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Exceeding speed limit (B)

Vehicle 1

Driver	Female, 21 Driver not contacted at time of accident Postcode: SR2 7NQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North East to North West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Female 21	Not a bus or coach passenger
SR2 7NQ	

Vehicle 2

Driver	Female, 27 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

MORTIMER ROAD C413 AT JN WITH MORPETH AVENUE

***Description
of Accident***

VEH1 WAS TURNING RIGHT FROM MORPETH AVENUE ONTO MORTIMER ROAD. DUE TO PARKED VEHICLES, VEHICLE 1 HAD TO PULL OUT ONTO THE MAIN ROAD SLIGHTLY TO SEE ANY OTHER VEHICLES. BELIEVING THAT IT WAS SAFE TO DO, VEHICLE 2 TRAV. SOUTH EAST ON MORTIMER ROAD, VEH 1 PULLED OUT TO TURN RIGHT WHEN VEHICLE 2 HAS COLLIDED WITH THE OFF SIDE OF VEH 1.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0165892

Location	South Tyneside 434117E, 563969N	Date/Time	Saturday 04 February 2017 08:45
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (B) Slippery road (due to weather) (B) Following too close (B) Swerved (A) Loss of Control (A) Failed to look properly (B)

Vehicle 1

Driver	Male, 32 Negative Postcode: NE32 3UA Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Bus Stop/Bus Shelter	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 32	Not a bus or coach passenger
NE32 3UA	

Vehicle 2

Driver	Female, 24 Negative Postcode: SR5 4HL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

STANHOPE ROAD

***Description
of Accident***

ON SATURDAY 4TH FEBRUARY 2017 AT 08.45 HOURS VEHICLE 1 AND VEHICLE 2 HAVE COLLIDED ON STANHOPE ROAD, JARROW WHILST TRAVELLING TOWARDS NEWCASTLE ROAD, JARROW WHICH HAS CAUSED VEHICLE 1 TO CRASH INTO THE BUS STOP. THE BUS STOP WAS BRICK AND PART OF IT COLLAPSED AND HAD TO BE DEMOLISHED. THIS WAS A 30MPH ZONE. IT WAS A CLEAR SUNNY DAY WITH DAMP ROAD SURFACES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0166181

Location	South Tyneside A 1018 437437E, 564269N	Date/Time	Tuesday 21 March 2017 12:55
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 35 Driver not contacted at time of accident Postcode: NE34 9TA Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	35	Not a bus or coach passenger
NE34 9TA		

***Description
of Location***

KING GEORGE ROAD A1018 NEAR JN WITH JOHN REID ROAD A1300

***Description
of Accident***

V2 FORD FUSION AT THE ROUNDABOUT ON KING GEORGE ROAD ABOUT TO TURN LEFT ONTO JOHN REID ROAD SOUTH SHIELDS SOUTH TYNESIDE, GIVING WAY TO TRAFFIC AT THE ROUNDABOUT. V1 RENAULT SCENIC COLLIDES WITH THE REAR OF V2 CAUSING INJURY TO DRIVER OF V2 AND DAMAGE TO REAR BUMPER OF V2 DENTS AND SCRATCHES TO PAINTWORK. V1 FAILS TO STOP AND EXCHANGE DETAILS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0167019

Location	South Tyneside A 194 434530E, 564117N	Date/Time	Thursday 23 March 2017 20:44
Road	Dual Carriageway 30	Junction	Crossroads Automatic traffic signal
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (A) Loss of Control (A)

Vehicle 1

Driver	Male, 22 Negative Postcode: SR2 8SW Other	Vehicle	Motorcycle over 125cc and up to 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Slowing or stopping Skidded Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 19	Not a bus or coach passenger

Vehicle 2

Driver	Female, 20 Negative Postcode: DH1 1DJ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

BURGER KING RESTAURANT NEWCASTLE ROAD A194 AT JN WITH SHAFTESBURY AVENUE

***Description
of Accident***

VEHICLE 2 APPROACH TRAFFIC LIGHT JUNCTION AND STOP DUE TO RED LIGHT, VEHICLE 1 APPROACH VEHICLE 2 FROM BEHIND, FAIL TO STOP AND COLLIDE INTO REAR OF VEHICLE 2. PILLION PASSENGER ON REAR OF VEHICLE 1 SUFFER MINOR INJURIES AS A RESULT.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0173564

Location	South Tyneside 433684E, 563507N	Date/Time	Tuesday 27 December 2016 14:00
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 53 Driver not contacted at time of accident Postcode: NE32 5ED Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle was Parked Parked No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 44 Not applicable Postcode: NE34 0RW Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	44	Not a bus or coach passenger
NE34 0RW		

***Description
of Location***

O/S 59 HADRIAN ROAD

***Description
of Accident***

VEHICLE 1 HAS BEEN PARKED AT THE SIDE OF THE ROAD OUTSIDE OF 59 HADRIAN ROAD. A YOUNG GIRL HAS BEEN PLAYING ON HER BIKE IN THE ROAD CAUSING A DISTRACTION. THE DRIVER OF VEHICLE 1 HAS OPENED HER DOOR. AS SHE HAS DONE SO VEHICLE 2 HAS BEEN TRAV. NORTH EAST ON HADRIAN ROAD, COLLIDING WITH THE OPEN CAR DOOR OF VEHICLE 1, WHICH HAS CAUSED RIDER TO COME OFF THE BIKE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0171884

Location	South Tyneside A 185 435222E, 564808N	Date/Time	Wednesday 09 November 2016 15:10
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Crossing road masked by stationary or parked vehicle (A) Failed to look properly (A) Careless, reckless or in a hurry (B) Failed to look properly (A) Careless, reckless or in a hurry (B) Aggressive driving (B)

Vehicle 1

Driver	Male, 67 Driver not contacted at time of accident Postcode: NE34 9HD Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
Movement		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male 21	Crossing from driver's nearside - masked by parked or stationary vehicle
NE32 5UG	South West

Description of Location	JARROW ROAD A185 AT JN WITH NEWCASTLE ROAD A194

Description of Accident	PEDESTRIAN WAITING TO CROSS JARROW ROAD IN A SOUTH WESTERLY DIRECTION ACROSS TWO LANES OF TRAFFIC. AN U/K VEHICLE IN THE N/S LANE OF TRAFFIC WHICH WAS WAITING IN A QUEUE OF TRAFFIC TO APPROACH TO ROUNDABOUT J/W NEWCASTLE ROAD HAS WAVED THE PEDESTRIAN ACROSS INFRONT OF THEIR VEHICLE WHILST THEY WERE STATIONARY. THE PEDESTRIAN HAS THEN CROSSED THAT LANE OF TRAFFIC AND STEPPED INTO THE O/S LANE WHERE VEHICLE 1 HAS BEEN MOVING OFF AND COLLIDED WITH THE INJURED PERSON AT LOW SPEED. DUE TO THE SHOCK

Slight Accident

Involving 2 Vehicle, 1 Casualty

0171470

Location	South Tyneside A 1300 437518E, 564301N	Date/Time	Thursday 10 November 2016 13:00
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (B) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 51 Driver not contacted at time of accident Postcode: SR6 7HZ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	51	Not a bus or coach passenger
SR6 7HZ		

***Description
of Location***

PRINCE EDWARD ROAD A1300

***Description
of Accident***

BUS IS PULLED IN BUS STOP ON PRINCE EDWARD RD, VEHICLE 1 IS PULLED IN BEHIND IT, VEHICLE 2 SEES THAT ROAD IS CLEAR AND BEGINS TO OVERTAKE. BUS BEGINS TO PULL OUT SO VEHICLE 2 STOPS TO ALLOW IT OUT. VEHICLE 1 THEN DRIVES INTO THE BACK OF VEHICLE 2. ALL VEHICLES TRAVELLING EAST TOWARDS THE COAST.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0168656

Location	South Tyneside B 1298 435959E, 564381N	Date/Time	Friday 24 February 2017 11:49
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 40 Negative Postcode: NE35 6PB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from West to South Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Female	70	Crossing from driver's nearside
NE34 6LF		West

Description of Location	BOLDON LANE B1298 AT JN WITH BEATTIE STREET

Description of Accident	VEHICLE 1 TURNS RIGHT FROM BEATTIE STREET ONTO BOLDON LANE, WHILST PEDESTRIAN CROSSING BOLDON LANE, HEADING TO PEDESTRIAN ISLAND, VEHICLE 1 COLLIDES WITH RIGHT LEG OF PEDESTRIAN.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0171848

Location	South Tyneside C 402 435839E, 566414N	Date/Time	Sunday 04 December 2016 16:45
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B) Failed to judge vehicle's path or speed (B) Impaired by alcohol (B)

Vehicle 1

Driver	Male, 26 Negative Postcode: NE34 9RX Not known	Vehicle	Motorcycle - Unknown cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male 35	Crossing from driver's offside
NE34 0QL	South East

Description of Location	COMMERCIAL ROAD C402

Description of Accident	RIDER OF MOTORCYCLE ONE HAS BEEN TRAVELLING ALONG COMMERCIAL ROAD, SOUTH SHIELDS TOWARDS PORTBERRY STREET. A PEDESTRIAN HAS WALKED OUT INTO THE ROAD. RIDER HAS BEEPED HORN AND BREAKED AND ALSO SWERVED TO AVOID THE PEDESTRIAN HOWEVER HAS CLIPPED HIM ON THE LEFT SIDE CAUSING THE MALE TO FALL TO THE GROUND AND INJURE HIS FACE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0171865

Location	South Tyneside C 414 436654E, 564532N	Date/Time	Monday 10 October 2016 08:45
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None Control by school crossing patrol Central refuge - no other controls	Contributory	Disobeyed pedestrian crossing facility (B) Junction restart (moving off at junction) (A) Failed to look properly (B) Careless, reckless or in a hurry (B) Fatigue (B)

Vehicle 1

Driver	Female, 63 Driver not contacted at time of accident Postcode: NE33 2AJ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Female	Crossing from driver's offside
NE34 0ND	South East

Description of Location	HARTON LANE C414 AT JN WITH MCANANY AVENUE

Description of Accident	VEHICLE 1 TRAV. SOUTH WEST ON HARTON LANE APP. J/W MCANANY AVENUE, PEDESTRIAN (LOLLIPOP LADY) STEPS ONTO HARTON LANE, VEHICLE 1 STOPS TO ALLOW PEDESTRIAN TO CROSS, VEHICLE 1 MOVES FORWARD SLIGHTLY, ROLLING OVER FOOT OF PEDESTRIAN, VEHICLE 1 DRIVES TO HOSPITAL CAR PARK AND RETURNS TO APOLOGIS TO PEDESTRIAN.

Serious Accident

Involving 2 Vehicle, 3 Casualties

0159363

Location	South Tyneside A 194 434550E, 564128N	Date/Time	Wednesday 01 March 2017 13:53
Road	Dual Carriageway 40	Junction	Crossroads Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Disobeyed automatic traffic signal (A)

Vehicle 1

Driver	Female, 25 Negative Postcode: LE67 4RL Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other Skidded Left carriageway offside onto central reservation

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 25	Not a bus or coach passenger
LE67 4RL	

Vehicle 2

Driver	Female, 73 Negative Postcode: NE34 9JQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 2 - Serious

Driver or rider	Not a car passenger
Female 73	Not a bus or coach passenger
NE34 9JQ	

Casualty 3 - Slight

Vehicle or pillion passenger

Rear seat passenger

Male 69

Not a bus or coach passenger

NE34 9JQ

Description of Location

NEWCASTLE ROAD A194 AT JN WITH SHAFTSBURY AVENUE

Description of Accident

VEHICLE 1 WAS TRAVELLING EAST, IN LANE 2 OF 2 ALONG THE A194 DUAL CARRIAGEWAY TOWARDS THE TRAFFIC LIGHT CONTROLLED JUNCTION WITH SHAFTSBURY AVENUE WHEN IT APPEARS IT HAS CONTRAVENED THE AUTOMATIC TRAFFIC SIGNAL WHICH WAS SHOWING RED AND COLLIDED WITH VEHICLE 2 WHICH WAS TRAVELLING SOUTH FROM SHAFTSBURY AVENUE TO CROSS THE EAST BOUND CARRIAGEWAY OF THE A194, TO THEN TRAVEL WEST. VEHICLE 1 HAS THEN STRUCK A TRAFFIC LIGHT ON THE CENTRAL RESERVE CAUSING EXTENSIVE DAMAGE. VEHICLE 2 CAME TO REST ON TH

Slight Accident

Involving 1 Vehicle, 1 Casualty

0126369

Location	South Tyneside 434413E, 564937N	Date/Time	Thursday 25 August 2016 14:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 49 Driver not contacted at time of accident Postcode: NE35 9NA Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing on pedestrian crossing facility
Male	Unknown or other

Description of Location PAULSWAY NEAR JN WITH PILGRIMWAY

Description of Accident VEH 1 TRAV. N/E ON PAULSWAY, STATIONARY AT TRAFFIC LIGHTS, WHEN LIGHTS CHANGED TO GREEN TWO MALES CROSSED PAULSWAY AND A THIRD MALE RAN PAST THE OTHER TWO MALES AS VEH1 STARTS TO PULL AWAY, PED. COLLIDES WITH FRONT OF VEH 1 AND LOOKED AT DRIVER PUTTING HANDS UP INDICATING PED. WAS ALRIGHT AND KEPT RUNNING, VEH 1 STOPPED IN ORDER TO MAKE SURE THE PED. WAS ALRIGHT, PED. DID NOT STOP AND KEPT ON HIS JOURNEY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0173366

Location	South Tyneside B 1298 435955E, 564435N	Date/Time	Thursday 08 December 2016 07:43
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Stationary or parked vehicle(s) (A) Stationary or parked vehicle(s) (B)

Vehicle 1

Driver	Male, 50 Not requested Postcode: NE33 5HX Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside Kerb None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 38 Not requested Postcode: NE33 4RH Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside Kerb None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from West to South Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	38	Not a bus or coach passenger
NE33 4RH		

***Description
of Location***

BOLDON LANE B1298 AT JN WITH STANLEY STREET

***Description
of Accident***

VEHICLE 2 STATIONARY ON STANLEY STREET, WAITING TO TURN RIGHT ONTO BOLDON LANE, VEHICLE 1 TRAV. NORTH ON BOLDON LANE APP. J/W STANLEY STREET, UNKNOWN VEHICLE TRAV. SOUTH ON BOLDON LANE, PULLS INTO CENTRE OF ROAD, WAITING TO TURN RIGHT ONTO STANLEY STREET, FLASHES LIGHT TO LEFT VEHICLE 2 KNOW ROAD IS CLEAR, VEHICLE 2 TURNS RIGHT ONTO BOLDON LANE, COLLIDING WITH VEHICLE 2, VEHICLES WEDGED BETWEEN PAVEMENT AND TRAFFIC ISLAND IN MIDDLE OF ROAD.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0167323

Location	South Tyneside A 194 433742E, 563544N	Date/Time	Friday 18 November 2016 22:55
Road	Roundabout 30	Junction	Roundabout Automatic traffic signal A 194
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Slippery road (due to weather) (A) Disobeyed automatic traffic signal (A) Failed to look properly (A) Vehicle in course of crime (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South West to North East Going ahead other Skidded Did not leave carriageway

Vehicle 2

Driver	Male, 67 Negative Postcode: NE32 5UN Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 67	Not a bus or coach passenger
NE32 5UN	

***Description
of Location***

LEAM LANE A194 AT JN WITH LINDISFARNE ROUNDABOUT A194

***Description
of Accident***

VEHICLE 1 A BMW WAS FOLLOWED FROM DOWNHILL, SUNDERLAND, BY A POLICE VEHICLE. VEHICLE 1 HAS MADE OFF FROM POLICE AND FAILED TO STOP. VEHICLE 1 HAS MADE DRIVEN THROUGH TWO RED LIGHTS AND DROVE ON OPPOSITE SIDE OF THE ROAD ON SEVERAL OCCASIONS. VEHICLE 1 HAS DRIVEN THROUGH RED TRAFFIC LIGHT ON JUNCTION A194, JUNCTION LINDISFARNE ROUNDABOUT. VEHICLE 1 STILL BEING FOLLOWED BY A POLICE VEHICLE HAS COLLIDED WITH VEHICLE 2 A SILVER CHEVROLET ON THE ROUNDABOUT. VEHICLE 1 HAS MADE OFF FROM THE SCENE AND

Serious Accident

Involving 2 Vehicle, 2 Casualties

0168292

Location	South Tyneside 436929E, 565387N	Date/Time	Sunday 26 March 2017 18:25
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled C 413
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 42 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 42	Not a bus or coach passenger

Vehicle 2

Driver	Female, 20 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Serious

Driver or rider	Not a car passenger
Female 20	Not a bus or coach passenger

***Description
of Location***

MORPETH AVENUE NEAR JN WITH MORTIMER ROAD C413

***Description
of Accident***

V2 WAS PARKED ON MORPETH AVENUE, SOUTH SHIELDS FACING A NE DIRECTION NEAR THE JUNCTION WITH MORTIMER ROAD. V2 HAS PULLED OFF. AT THE SAME POINT V1 WAS DRIVING LONG MORTIMER ROAD AND TURNED LEFT ONTO MORPETH AVENUE. ON DOING SO V2 AND V1 HAVE COLLIDED. V1 COLLIDING WITH THE FRONT PASSENGER SIDE. V2 COLLIDING WITH THE FRONT DRIVER SIDE. THIS RESULTED IN BODY WORK DAMAGE TO BOTH CARS. BOTH PERSONS HAVE SUSTAINED INJURIES. D1 SORENESS TO NECK. D2 SUSTAINED A BROKEN WRIST AND REQUIRED OPERATION AND H

Slight Accident

Involving 2 Vehicle, 1 Casualty

0171655

Location	South Tyneside A 1018 436950E, 565942N	Date/Time	Sunday 04 December 2016 15:15
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Junction restart (moving off at junction) (A) Failed to look properly (A) Poor turn or manoeuvre (A) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Female, 20 Not requested Postcode: NE34 6DQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 20	Not a bus or coach passenger
NE34 6DQ	

Vehicle 2

Driver	Male, 20 Not requested Postcode: NE33 2RQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

DEAN ROAD A1018 AT JN WITH IMEARY STREET B1301

***Description
of Accident***

VEHICLE 2 WAS TRAVELLING ALONG SUNDERLAND ROAD AND APPROACHED THE ROUNDABOUT WITH DEAN ROAD. HE WENT STRAIGHT ON AT THE ROUNDABOUT TO GO DOWN IMEARY STREET. VEHICLE 1 WAS TRAVELLING ALONG DEAN ROAD AND APPROACHED THE SAME ROUNDABOUT TO TURN RIGHT ON TO SUNDERLAND ROAD. WHILST VEHICLE 2 WAS ON THE ROUNDABOUT, VEHICLE 1 PULLED OUT AND THE VEHICLES COLLIDED ON THE ROUNDABOUT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0173693

Location	South Tyneside A 194 435697E, 565100N	Date/Time	Saturday 15 April 2017 12:00
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled C 402
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 61 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 23 Driver not contacted at time of accident Postcode: NE34 9JW Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to South West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	23	Not a bus or coach passenger
NE34 9JW		

***Description
of Location***

WESTERN APPROACH A194 AT JN WITH COMMERCIAL ROAD C402

***Description
of Accident***

VEH2 WAS TRAVELLING SOUTH BOUND ALONG COMMERCIAL ROAD TOWARD WESTERN APPROACH IN LANE ONE INTENDING TO TURN RIGHT ONTO WESTERN APPROACH. WHEN HALFWAY ROUND THE ROUND ABOUT, VEH1 ENTERED THE ROUNDABOUT FROM THE WEST BOUND CARRIAGEWAY OF WESTERN APPROACH AND FOR AN UNKNOWN REASON COLLIDED WITH VEH2 CAUSING DAMAGE AND MINOR INJURY TO THE DRIVER OF VEH2

Slight Accident

Involving 3 Vehicle, 1 Casualty

0173928

Location	South Tyneside A 194 434980E, 564492N	Date/Time	Friday 25 November 2016 15:20
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Dazzling sun (A) Dazzling sun (A) Dazzling sun (A)

Vehicle 1

Driver	Male, 42 Negative Postcode: NE33 2EP Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 22 Negative Postcode: NE32 5TS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	22	Not a bus or coach passenger
NE32 5TS		

Vehicle 3

Driver Female, 78
Negative
Postcode: NE32 3RD
Not known

Collisions Hit no other vehicle
Front
None
None

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Movement Vehicle moving from East to West
Moving off
No skidding, jack-knifing or overturning
Did not leave carriageway

**Description
of Location** NEWCASTLE ROAD A194

**Description
of Accident** THE 3 VEHICLES INVOLVED WERE TRAVELING IN A WESTERLY DIRECTION ON NEWCASTLE ROAD, A194 IN THE INSIDE LANE. THE SUN WAS VERY LOW AND VISIBILITY WAS POOR. DUE TO THE LOW SUN THE VEHICLES HAVE COLLIDED.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0173877

Location	South Tyneside B 1298 436406E, 565053N	Date/Time	Monday 19 December 2016 07:07
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 408
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Failed to signal or misleading signal (B) Failed to look properly (B)

Vehicle 1

Driver	Male, 43 Negative Postcode: NE33 3BT Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male	Crossing from driver's nearside
76	South East
NE34 8QU	

Description of Location	STANHOPE ROAD B1298 AT JN WITH WEST WAY C408

Description of Accident	VEHICLE ONE TRAVELING NORTH EAST ON STANHOPE ROAD, NEGOTIATES ROUNDABOUT JUNCTION WITH WEST WAY, CONTINUES NORTH EAST ON STANHOPE ROAD, COLLIDING WITH PEDESTRIAN CROSSING STANHOPE ROAD FROM NEAR SIDE OF VEHICLE ONE, KNOCKING PEDESTRIAN TO GROUND.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0162557

Location	South Tyneside A 1018 436856E, 566062N	Date/Time	Friday 18 November 2016 17:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Zebra Crossing	Contributory	Failed to look properly (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Female, Driver not contacted at time of accident Postcode: HU5 5TH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 24 Driver not contacted at time of accident Postcode: NE33 2ES Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle was Parked Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	24	Not a bus or coach passenger
NE33 2ES		

***Description
of Location***

IMEARY STREET A1018 NEAR JN WITH GEORGE POTTS STREET

***Description
of Accident***

VEH 2 HAS BEEN TRAVELLING NORTH ALONG IMEARY STREET,SOUTH SHIELDS IN A LINE OF TRAFFIC. THE VEHICLE DIRECTLY IN FRONT OF VEH 2 HAS STOPPED FOR THE PEDESTRIAN CROSSING PRIOR TO EAST GEORGE POTTS STREET. VEH 2 HAS COME TO A STOP BEHIND THIS VEHICLE AND WHILST STATIONARY VEH 1 HAS COLLIDED WITH THE REAR OF VEH 2. DAMAGE HAS BEEN CAUSED TO THE REAR OF VEH 2 AND THE FRONT OF VEH 1. THE DRIVER OF VEH 2 HAS ALSO SUFFERED SOFT TISSUE/MUSCLE INJURY TO HIS NECK AS A RESULT OF THE IMPACT. NAMES AND ADD

Slight Accident

Involving 2 Vehicle, 1 Casualty

0176992

Location	South Tyneside A 194 436215E, 566228N	Date/Time	Sunday 05 March 2017 15:20
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Failed to judge other person's path or speed (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 59 Negative Postcode: NE6 4DZ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead right hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 14 Not applicable Postcode: NE33 5EQ Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	14	Not a bus or coach passenger
NE33 5EQ		

***Description
of Location***

WESTERN APPROACH A194

***Description
of Accident***

ON SUNDAY 5TH MARCH 2017 V1 WAS TRAVELLING ALONG WESTERN APPROACH SOUTHBOUND WHEN THEY APPROACHED THE TRAFFIC LIGHTS OPPOSITE LIDL AS THEY APPROACHED THE LIGHTS THEY WERE ON GREEN SO PROCEEDED TO GO THROUGH, A PEDAL CYCLIST WAS PROCEEDING TO GO OVER THE CROSSING. AS THE PEDAL CYCLIST WAS GOING ACROSS THE LIGHTS WERE CHANGING, V1 NOTICED THE CYCLIST AND SUDDENLY THE CYCLIST COLLIDED WITH V1 AND FELL OFF THE BIKE AND ONTO TO THE GROUND.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0177880

Location	South Tyneside C 414 436476E, 564409N	Date/Time	Thursday 08 December 2016 11:36
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (B) Failed to look properly (A) Buildings, road signs, street furniture (A)

Vehicle 1

Driver	Male, 60 Driver not contacted at time of accident Postcode: NE34 7JA Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from South East to North East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 33 Driver not contacted at time of accident Postcode: NE34 7HX Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	33	Not a bus or coach passenger
NE34 7HX		

***Description
of Location***

HARTON LANE C414 AT JN WITH SOUTH TYNESIDE HOSPITAL

***Description
of Accident***

V2 TRAV. SOUTH WEST ALONG HARTON LANE APP. J/W SOUTH TYNESIDE HOSPITAL, V1 TURNS RIGHT FROM SOUTH TYNESIDE HOSPITAL ONTO HARTON LANE ACROSS PATH OF V2 CAUSING V2 TO BRAKE SUDDENLY, COLLIDING WITH V1 CAUSING SLIGHT INJURY TO RIDER OF V2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0180158

Location	South Tyneside B 1298 436117E, 563743N	Date/Time	Sunday 01 January 2017 00:25
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Impaired by alcohol (A) Junction overshoot (A)

Vehicle 1

Driver	Male, 47 Refused to provide Postcode: NE4 6XP Other	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front Central island of roundabout Tree	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other Skidded Left carriageway straight ahead at junction

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 48	Not a bus or coach passenger

Description of Location WHITELEAS WAY B1298 AT JN WITH JOHN REID ROAD A1300

Description of Accident V1 TRAV. NORTH WEST ON WHITELEAS WAY APP. R/ABOUT J/W JOHN REID ROAD, DRIVER LOSES CONTROL, ENTERS R/ABOUT, COLLIDING WITH CENTRAL ROUNDABOUT AREA BEFORE DRIVING THROUGH EXTERIOR SAFETY BARRIER ONTO GRASS EMBANKMENT, COLLIDING WITH TREE 30 YARDS AWAY AND BELOW ROUNDABOUT, DISCOVERED BY POLICE SECONDS AFTER AND DRIVER ARRESTED.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0181463

Location	South Tyneside A 194 433880E, 563607N	Date/Time	Saturday 13 May 2017 08:40
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 25 Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 22 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	22	Not a bus or coach passenger

***Description
of Location***

LEAM LANE A194 NEAR JN WITH A19

***Description
of Accident***

*** OPINION FORMED FROM COMMENTS OF V2 DRIVER (CASUALTY)*** V2 WAS DRIVING WEST ON THE LEAM LANE APPROACHING THE ROUNDABOUT JUNCTION WITH THE A19. ON THIS STRETCH AT THE MOMENT THERE ARE SOME ROADWORKS AND TRAFFIC WAS BUSY DUE TO THIS AND THE TIME OF DAY (0840HRS). V2 STOPPED RE TRAFFIC IN FRONT OF HIM BUT FELT A SHUNT FROM BEHIND,V1 HAD COLLIDED WITH HIS REAR WITH ITS FRONT,CAUSING VISIBLE DAMAGE TO BOTH VEHICLES. DRIVERS ALIGHTED THEIR VEHICLES AT THE TIME AND EXCHANGED DETAILS AT THE SCENE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0183992

Location	South Tyneside C 408 437400E, 564306N	Date/Time	Thursday 29 December 2016 14:45
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, Not applicable Postcode: NE34 7SB Not known	Vehicle	Mobility Scooter No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male	Not a bus or coach passenger
NE34 7SB	

***Description
of Location***

TEMPLE PARK ROAD C408 AT JN WITH PRINCE EDWARD ROAD A1300

***Description
of Accident***

V1 WAS TRAVELLING ACROSS THE ROUNDABOUT TRAVELLING NORTH FROM A1018 ONTO TEMPLE PARK ROAD. THE RIDER OF THE MOBILITY SCOOTER PULLED ONTO TEMPLE PARK ROAD TRAVELING EAST TOWARDS THE NOOK HOWEVER HE PULLED IN FRONT V1 WHICH THEN COLLIDED WITH HIM, KNOCKING HIM OFF THE SCOOTER. V1 THEN DROVE OFF WITHOUT STOPPING.

Serious Accident

Involving 3 Vehicle, 1 Casualty

0185154

Location	South Tyneside A 1018 437057E, 565811N	Date/Time	Wednesday 24 May 2017 15:17
Road	Dual Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A)

Vehicle 1

Driver	Male, 26 Negative Postcode: NE34 0RG Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 26	Not a bus or coach passenger
NE34 0RG	

Vehicle 2

Driver	Male, 37 Negative Postcode: NE33 5DL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 47
Negative
Postcode: NE34 7EE
Commuting to/from work

Collisions Hit no other vehicle
Back
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Movement Vehicle moving from South to North
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location SUNDERLAND ROAD A1018 NEAR JN WITH ACCESS ROAD LEADING TO THE BUNGALOW

Description of Accident IT APPEARS VEHICLE 1 TRAVELLING SOUTH ON A1018 SUNDERLAND ROAD, SOUTH TYNESIDE HAS ATTEMPTED A RIGHT HAND TURN OVER A DUAL CARRIAGEWAY THROUGH BUILT UP STATIONARY TRAFFIC IN LANE 2. AS VEHICLE 1 CROSSES FROM LANE 2 INTO LANE 1 OF DUAL CARRIAGEWAY VEHICLE 1 ENTERS THE PATH OF AN ONCOMING AUDI (VEHICLE 2) WHO HAS RIGHT OF WAY. VEHICLE 2 COLLIDES WITH VEHICLE 1 CAUSING THE RIDER TO FALL FROM VEHICLE 1 AND THE MOTOR CYCLE THEN FALLS INTO THE REAR OF VEHICLE 3 WHICH IS STATIONARY DUE TO TRAFFIC, CAUS

Serious Accident

Involving 1 Vehicle, 1 Casualty

0185423

Location	South Tyneside A 194 436186E, 566049N	Date/Time	Wednesday 24 May 2017 19:09
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Exceeding speed limit (B) Failed to look properly (B)

Vehicle 1

Driver	Male, 19 Negative Postcode: NE32 5JE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Overtaking moving vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere within 50 metres of pedestrian crossing
Male	17	Crossing from driver's nearside
NE34 8RT		North

Description of Location	A194 WESTERN APPROACH 100MTS SOUTH OF R/BOUT WITH B1301 LAYGATE A194 NEAR JN WITH LAYGATE

Description of Accident	V1 TRAVELLING WEST IN LANE TWO OF A194 WESTERN APPROACH. PEDESTRAIN CROSSING FROM THE DRIVERS NEARSIDE RUNS ACROSS PATH OF DRIVER AND RESULTS IN COLLISION. DRIVER OF V1 INITIALLY STOPS AT THE SCENE BEFORE DRIVING AWAY FROM THE SCENE AND HANDS HIMSELF IN AT SOUTH SHIELDS POLICE STATION. DRIVER PROVIDED NEGATIVE SPECIMENS FOR ALCOHOL AND DRUGS

Slight Accident

Involving 2 Vehicle, 2 Casualties

0186670

Location	South Tyneside C 413 436872E, 565431N	Date/Time	Monday 29 May 2017 23:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male	Not a bus or coach passenger

Vehicle 2

Driver	Male, 54 Driver not contacted at time of accident Postcode: NE34 9LG Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 54	Not a bus or coach passenger
NE34 9LG	

***Description
of Location***

MORTIMER ROAD C413

***Description
of Accident***

V2 A VOLVO S60 TAXI - AM08 NWL HAS BEEN PARKED OUTSIDE 149 MORTIMER ROAD, PICKING UP A FARE. V1 A BMW - OY64 EVG HAS BEEN TRAVELLING ALONG MORTIMER ROAD BEHIND V2. FOR UNKNOWN REASONS V1 HAS GONE INTO THE BACK OF V2 - POSSIBLY DISTRACTED AS V2 HAD LIGHTS ON & HAZARD LIGHTS FLASHING. BOTH PARTIES EXCHANGED DETAILS AT THE SCENE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0185469

Location	South Tyneside B 1298 435931E, 564583N	Date/Time	Saturday 20 May 2017 16:57
Road	Single Carriageway 30	Junction	Crossroads Automatic traffic signal B 1302
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 38 Driver not contacted at time of accident Postcode: NE8 2UA Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 50	Not a bus or coach passenger

Description of Location STANHOPE ROAD B1298 AT JN WITH B1302

Description of Accident DRIVER OF V1 TRAVELLING SOUTH WEST ON STANHOPE ROAD TO THE T JUNCTION WITH B1302 . AS APPROACHING THE TRAFFIC SIGNALS WHICH WERE ON RED PASSENGER RINGS BELL FOR BUS TO STOP AND STANDS UP. WHEN THE BUS PULLS AWAY ON THE GREEN LIGHT THE PASSENGER FAILS TO CATCH THE HAND RAIL DUE TO HAVING HER WALKING STICK IN THAT HAND AND FALLS OVER, CAUSING SLIGHT INJURY.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0190833

Location	South Tyneside A 1018 436966E, 565927N	Date/Time	Wednesday 01 March 2017 16:00
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Failed to look properly (A) Stationary or parked vehicle(s) (A)

Vehicle 1

Driver	Not traced, 16 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Female	16	Crossing from driver's offside
NE32 4PD		South West

Description of Location	SUNDERLAND ROAD A1018 AT JN WITH B1301

Description of Accident	PEDESTRIAN STATED THAT SHE WALKED THROUGH WESTOE VILLAGE, SOUTH SHIELDS AND STOPPED AT THE ELECTRONIC CROSSING, SUNDERLAND ROAD, SOUTH SHIELDS, WHICH IS SOUTH OF THE DEAN ROAD/ IMEARY STREET ROUNDABOUT. SHE STATES THAT THE GREEN MAN WAS ON SO SHE BEGAN RUNNING ACROSS THE ROAD, EAST TO WEST, TO THE OTHER SIDE. SHE WILL STATE THAT A CAR HAS THEN HAS THEN TRAVELED SOUTH TO NORTH, TRAVELING TOWARDS THE DEAN RD ROUNDABOUT AND HAS RAN OVER HER FOOT. THIS HAS CAUSED A CUT AND BRUISING TO HER BIG TOE. 2

Slight Accident

Involving 2 Vehicle, 2 Casualties

0190341

Location	South Tyneside B 1298 436517E, 565861N	Date/Time	Sunday 26 February 2017 11:50
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 24 Driver not contacted at time of accident Postcode: NE34 7PS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	24	Not a bus or coach passenger
NE34 7PS		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 22

Not a bus or coach passenger

NE34 7PS

Description of Location

STANHOPE ROAD B1298 AT JN WITH DEAN ROAD B1301

Description of Accident

V2 TRAVELLING NORTHBOUND ON STANHOPE ROAD TOWARDS ROUNDABOUT JUNCTION WITH CHICHESTER ROAD SOUTH SHIELDS. PEDESTRIANS AT ZEBRA CROSSING CAUSE V2 TO COME TO A COMPLETE STOP. WHILST V2 STATIONARY AT ZEBRA CROSSING V1 COLLIDES WITH THE REAR OF V2. V1 THEN MAKES OFF FROM SCENE WITHOUT PROVIDING DETAILS.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0189407

Location	South Tyneside B 1303 435812E, 564679N	Date/Time	Saturday 11 February 2017 18:20
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present but unlit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Travelling too fast for conditions (B) Failed to look properly (A)

Vehicle 1

Driver	Not traced, 40 Driver not contacted at time of accident Postcode: Not known	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian	In carriageway, crossing elsewhere
Male	Crossing from driver's nearside
SR4 0ED	South West

Description of Location	NR TYNE DOCK METRO STATION BOLDON LANE B1303

Description of Accident	PEDESTRIAN CROSSES BOLDON LANE AFTER LEAVING TYNE DOCK METRO STATION, VEH 1 TRAV. SOUTH ON BOLDON LANE, COLLIDING WITH PED, VEH 1 FAILS TO STOP.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0187875

Location	South Tyneside A 1018 437348E, 564759N	Date/Time	Friday 19 May 2017 04:39
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Impaired by alcohol (A)

Vehicle 1

Driver	Male, 27 Negative Postcode: NE32 4AN Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Parked vehicle None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 27	Not a bus or coach passenger
NE32 4AN	

Vehicle 2

Driver	Not traced, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle was Parked Parked No skidding, jack-knifing or overturning Left carriageway nearside

*Description
of Location*

130 KING GEORGE ROAD, SOUTH SHIELDS, OUTSIDE NO. 133 A1018

*Description
of Accident*

V1 ASTRA, TRAVELLING NORTH ON KING GEORGE ROAD WHEN LOST CONTROL COLLIDING WITH UNATTENDED V2 BMW V1 HAS OVERTURNED AND COME TO REST ON STREET

Slight Accident

Involving 2 Vehicle, 1 Casualty

0189762

Location	South Tyneside A 1018 437403E, 564455N	Date/Time	Tuesday 21 February 2017 13:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Junction restart (moving off at junction) (A) Failed to judge other person's path or speed (A) Failed to look properly (B)

Vehicle 1

Driver	Male, 64 Driver not contacted at time of accident Postcode: NE32 4RY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to South Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 46 Driver not contacted at time of accident Postcode: NE33 3EH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	46	Not a bus or coach passenger
NE33 3EH		

***Description
of Location***

KING GEORGE ROAD A1018 NEAR JN WITH LASCELLES AVENUE

***Description
of Accident***

VEHICLE 2 IS TRAVELLING NORTHBOUND ON KING GEORGE ROAD. VEHICLE 1 IS TRAVELLING WEST BOUND FROM LASCELLES AVENUE ACROSS THE CENTRAL RESERVATION TO TURN ONTO THE NORTHBOUND CARRIAGEWAY OF KING GEORGE ROAD. AS VEHICLE 2 PASSES THE CENTRAL REFUGE, VEHICLE 1 MISJUDGES THE SPEED OF VEHICLE 2 AND PULLS OUT COLLIDING WITH THE REAR OFFSIDE OF VEHICLE 2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0192875

Location	South Tyneside 434756E, 563735N	Date/Time	Thursday 09 March 2017 16:42
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Crossing road masked by stationary or parked vehicle (B) Failed to look properly (B) Stationary or parked vehicle(s) (B)

Vehicle 1

Driver	Female, 25 Not requested Postcode: NE34 9EZ Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Female	10	Crossing from driver's nearside
NE34 9RN		North East

Description of Location	HENDERSON ROAD AT JN WITH DAME FLORA ROBON AVENUE

Description of Accident	VEH 1 TRAV. NORTH WEST ON HENDERSON ROAD, HAVING TURNED FROM DAME FLORA ROBSON AVENUE, PARKED CARS ON NEAR SIDE OF VEH 1, PED. RAN INTO CARRIAGEWAY FROM BEHIND PARKED VEH INTO PATH OF VEH 1

Slight Accident

Involving 1 Vehicle, 1 Casualty

0194706

Location	South Tyneside A 1300 436130E, 563748N	Date/Time	Saturday 18 March 2017 14:35
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Nervous, uncertain or panic (B) Loss of Control (A)

Vehicle 1

Driver	Male, 52 Negative Postcode: NE34 8DL Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to North Turning left Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 52	Not a bus or coach passenger
NE34 8DL	

Description of Location JOHN REID ROAD A1300 AT JN WITH BOLDON LANE B1298

Description of Accident V1IS TRAVELING WESTBOUND ON JOHN REID ROAD, SOUTH SHIELDS. V1 MAKES WAY TO ROUNDABOUT WITH BOLDON LANE. WHILST NEGOTIATING THE ROUNDABOUT DRIVER OF V1 LEANS THE MOTORCYCLE LOW TO THE GROUND AND THE FOOT PEGS OF THE VEHICLE DIG INTO THE GROUND CAUSING THE MOTORCYCLE TO HIGHSIDE THROWING THE RIDER FROM THE CYCLE TO THE GROUND. THE MOTORCYCLE CONTINUES TO SLIDE ALONG THE ROAD WITHOUT THE RIDER.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0196500

Location	South Tyneside A 1300 434915E, 563447N	Date/Time	Friday 24 March 2017 10:00
Road	Single Carriageway 40	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B) Failed to look properly (B)

Vehicle 1

Driver	Female, 57 Not requested Postcode: NE32 4JG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 57	Not a bus or coach passenger
NE32 4JG	

Vehicle 2

Driver	Male, 44 Not requested Postcode: NE34 9HS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

JOHN REID ROAD A1300 AT JN WITH WINSKELL ROAD

***Description
of Accident***

VEHICLE 1 HAS BEEN TRAVELLING ALONG WINSKILL ROAD, SOUTH SHIELDS TURNING RIGHT AT THE ROUNDABOUT ON JOHN REID ROAD, VEHICLE 2 HAS BEEN TRAVELLING ALONG JOHN REID ROAD AND VEHICLES HAVE COLLIDED ON ROUNDABOUT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0196579

Location	South Tyneside 436100E, 566197N	Date/Time	Monday 26 June 2017 11:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 57 Driver not contacted at time of accident Postcode: NE34 7JA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Parked vehicle None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	57	Not a bus or coach passenger
NE34 7JA		

*Description
of Location*

FREDERICK STREET

*Description
of Accident*

FROM INFO FROM DRIVER V2 - V1 HAS BEEN PARKED ON THE ROAD. V2 HAS BEEN TRAVELLING BEHIND HIM HEADING IN THE SAME DIRECTION. V1 PULLS OUT OF HIS SPACE GIVING V2 NO TIME TO REACT,V2 COLLIDES WITH V1 CAUSING DAMAGE TO V2. BOTH DRIVERS STOP AND SPEAK AT SCENE AND EXCHANGE DETAILS. DRIVER V2 LATER SUFFERS FROM MINOR WHIPLASH AND REPORTS TO POLICE ACCORDINGLY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0196724

Location	South Tyneside B 1298 436500E, 565262N	Date/Time	Saturday 25 March 2017 18:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Not traced, Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		On footway or verge
Female	8	Unknown or other
		South

Vehicle 2

Driver	Not traced, Not applicable Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Parked No skidding, jack-knifing or overturning Did not leave carriageway

*Description
of Location*

STANHOPE ROAD B1298

*Description
of Accident*

A MALE RIDING A PEDAL CYCLE KNOCKED OVER A YOUNG GIRL WHO WAS WALKING ALONG A PATH THEN COLLIDED WITH A STATIONARY VEHICLE KNOCKING OFF THE WING MIRROR BEFORE MAKING OFF ON FOOT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0196739

Location	South Tyneside C 402 435787E, 566323N	Date/Time	Saturday 01 July 2017 11:30
Road	Single Carriageway 30	Junction	Other junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 80 Driver not contacted at time of accident Postcode: NE34 9JF Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 59 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 59	Not a bus or coach passenger

***Description
of Location***

TRIMMERS ARMS PUBLIC HOUSE COMMERCIAL ROAD C402 NEAR JN WITH LAYGATE STREET

***Description
of Accident***

DRIVER OF VEHICLE 2 STATES SHE WAS STATIONARY IN HER VEHICLE IN A LINE OF TRAFFIC AS THERE WAS TEMPORARY TRAFFIC LIGHTS ON THE ROAD (OUTSIDE OF THE TRIMMERS ARMS) WHICH WERE ON RED. HER VEHICLE WAS APPROXIMATELY 5TH OR 6TH IN A QUEUE OF TRAFFIC. SHE FELT AN ALMIGHTY THUD AND THEN ANOTHER THUD AND HER VEHICLE JERKED. THE ELDERLY GENTLEMAN OF VEHICLE 1 GOT OUT TO CHECK SHE WAS OK AND APOLOGISED SAYING HIS FOOT HAD SLIPPED. THEY BOTH PULLED OVER AWAY FROM THE TRAFFIC AND DETAILS WERE EXCHANGED. DR

Slight Accident

Involving 2 Vehicle, 1 Casualty

0196746

Location	South Tyneside A 194 435689E, 565090N	Date/Time	Wednesday 28 June 2017 17:20
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Male, 33 Not requested Postcode: NE37 1HW Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 51 Not requested Postcode: Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	51	Not a bus or coach passenger

***Description
of Location***

A194 NEAR JN WITH TEMPLETOWN

***Description
of Accident***

DRIVER OF VEHICLE 2 DESCRIBES THAT SHE WAS TRAVELLING SOUTH ON TEMPLETOWN, TRAVELLING IN THE NEAR SIDE LANE TOWARDS ROUNDABOUT ON WESTERN APPROACH, SHE HAD HER RIGHT INDICATOR ON TO TURN RIGHT ONTO THE ROUNDABOUT TO JOIN THE A194 (SLAKE TERRACE), WHEN SHE WAS ON THE ROUNDABOUT HEADING WEST ON THE A194 VEHICLE 1 WAS TRAVELLING IN NEAR SIDE LANE ON WESTERN APPROACH, AS VEHICLE 2 WAS ON THE ROUNDABOUT THE FRONT OF VEHICLE 1 COLLIDED WITH THE NEAR SIDE DOOR OF VEHICLE 2. DRIVER OF VEHICLE 2 STATES JUS

Slight Accident

Involving 2 Vehicle, 1 Casualty

0197732

Location	South Tyneside A 194 433833E, 563551N	Date/Time	Saturday 08 April 2017 10:45
Road	Roundabout 40	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres Central refuge - no other controls	Contributory	Illegal turn or direction of travel (A)

Vehicle 1

Driver	Male, 54 Not requested Postcode: NE12 8YQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 58 Not requested Postcode: NE33 3DU Other	Vehicle	Motorcycle - Unknown cc No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	58	Not a bus or coach passenger
NE33 3DU		

***Description
of Location***

LEAM LANE A194 AT JN WITH LINDISFARNE ROUNDABOUT A19

***Description
of Accident***

VEHICLE 2 TRAVELLING SOUTH WEST ON A194 IN THE DIRECTION OF NEWCASTLE IN LANE 2. STOPPED AT THE TRAFFIC LIGHTS AT THE LINDISFARNE ROUNDABOUT. VEHICLE 1 HAS STOPPED AT THE TRAFFIC LIGHTS AT THE SAME LOCATION BUT IN LANE 1. YOU CAN GO STRAIGHT AHEAD IN BOTH LANES. AS THE LIGHTS HAVE CHANGED VEHICLE 2 HAS PULLED AWAY AND WENT STRAIGHT ON TO CONTINUE ALONG THE A194. VEHICLE 1 HAS INDICATED RIGHT TO GO AROUND THE ROUNDABOUT TOWARDS THE TURN OFF FOR THE A19, CUTTING ACROSS LANE 2 AND COLLIDING WITH V

Slight Accident

Involving 1 Vehicle, 1 Casualty

0198799

Location	South Tyneside B 1298 436098E, 563807N	Date/Time	Tuesday 11 April 2017 16:02
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Other (A)

Vehicle 1

Driver	Male, 32 Not requested Postcode: NE37 2SA Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 86	Standing passenger
NE34 8JX	

Description of Location BOLDON LANE B1298 NEAR JN WITH JOHN REID ROAD A1300

Description of Accident VEHICLE1 (BUS) WAS WAITING AT THE ROUNDABOUT ON JOHN REID ROAD, WAITING TO PULL OUT. WHEN THE VEHICLE STARTED TO MOVE FORWARD THE PASSENGER WHO WAS STOOD UP FELL BACKWARDS. THE PASSENGER STATED SHE HAD HURT HER BACK.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0199097

Location	South Tyneside C 413 436869E, 565428N	Date/Time	Friday 07 July 2017 07:37
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Stationary or parked vehicle(s) (B)

Vehicle 1

Driver	Male, 13 Not applicable Postcode: Pupil riding to/from school	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 13	Not a bus or coach passenger

Vehicle 2

Driver	Male, 52 Driver not contacted at time of accident Postcode: NE34 0SQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Moving off No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

MORTIMER ROAD C413

***Description
of Accident***

V2 WAITING TO GIVE WAY TO ONCOMING TRAFFIC OVERTAKING STATIONARY BUS, AS V2 DRIVES NORTH ON MORTIMER ROAD, V1 CROSSES THE ROAD FROM EAST TO WEST CAUSING V2 TO BRAKE, RIDER OF V1 FALLS FROM PEDAL CYCLE CAUSING MINOR INJURY TO LEG.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0201989

Location	South Tyneside A 1018 437332E, 564938N	Date/Time	Wednesday 15 March 2017 12:16
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled C 413
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Sudden braking (A) Following too close (A) Tyres illegal, defective or under-inflated (B)

Vehicle 1

Driver	Female, 27 Not provided (medical reasons) Postcode: NE34 8NL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other Skidded Did not leave carriageway

Vehicle 2

Driver	Male, 45 Negative Postcode: NE34 6NL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Slowing or stopping Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	45	Not a bus or coach passenger
NE34 6NL		

***Description
of Location***

KING GEORGE ROAD A1018 AT JN WITH MORTIMER ROAD C413

***Description
of Accident***

V1 TRAV ON KING GEORG ROAD TOWARDS ROUNDABOUT J/W HARTON LANE BEHIND V2. THE VEHICLE IN FRONT OF V2 BRAKED SUDDENLY CAUSING V2 TO BRAKE. V1 FAILED TO STOP IN TIME AND HAS COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0202557

Location	South Tyneside A 1300 435591E, 563591N	Date/Time	Monday 08 May 2017 16:44
Road	Dual Carriageway 40	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A) Failed to judge other person's path or speed (B)

Vehicle 1

Driver	Male, 62 Not requested Postcode: NE62 5PN Journey as part of work	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 37 Not requested Postcode: NE34 9DN Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	37	Not a bus or coach passenger
NE34 9DN		

***Description
of Location***

O/S THE NEW MILL PUBLIC HOUSE JOHN REID ROAD A1300 AT JN WITH CHESTERTON ROAD

***Description
of Accident***

VEHS TRAV. SOUTH WEST ON JOHN REID ROAD, VEH 1 IN OUTSIDE LANE, ATTEMPTS TO CHANGE LANES TO NEAR SIDE LANE, CLIPPING REAR OF VEH 2 TRAV. IN NEAR SIDE LANE, CAUSING VEH 2 TO SPIN IN OPPOSITE DIRECTION CAUSING INJURY TO DRIVER OF VEH 2

Slight Accident

Involving 2 Vehicle, 1 Casualty

0204246

Location	South Tyneside B 1298 436017E, 564664N	Date/Time	Sunday 23 July 2017 21:45
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Darkness - Street Lighting Unknown Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 32 Driver not contacted at time of accident Postcode: NE34 8DE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 28 Driver not contacted at time of accident Postcode: NE34 8LB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	28	Not a bus or coach passenger
NE34 8LB		

***Description
of Location***

ALNWICK ROAD B1298 AT JN WITH STANHOPE ROAD

***Description
of Accident***

V2 WAS AT THE JUNCTION OF ALNWICK ROAD WITH STANHOPE ROAD. AS V2 WAS WAITING AT THE JUNCTION V1 WAS TRAVELLING ALONG STANHOPE ROAD IN THE DIRECTION OF GOLDEN LANE. V1 HAS THEN TURNED AND COLLIDED WITH V2, CAUSING DAMAGE TO THE FRONT OFFSIDE DOOR, OFFSIDE REAR PASSENGER DOOR, OFFSIDE BACK WING, BUMPER AND ALLOY. V2'S DRIVER WAS ALSO INJURED, DAMAGE AND SORENESS TO SHOULDER. BOTH PARTIES EXCHANGED DETAILS AT THE TIME.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0205520

Location	South Tyneside A 1018 437115E, 565684N	Date/Time	Friday 28 July 2017 20:00
Road	Dual Carriageway 30	Junction	T or staggered junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 55 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 57 Driver not contacted at time of accident Postcode: NE33 4SB Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	57	Not a bus or coach passenger
NE33 4SB		

***Description
of Location***

SUNDERLAND ROAD A1018 AT JN WITH GROSVENOR ROAD

***Description
of Accident***

VEHICLE 2 WAS TRAVELING NORTH ON SUNDERLAND ROAD IN SOUTH SHIELDS AND STOPPED AT TRAFFIC LIGHTS AT THE JUNCTION WITH GROSVENOR ROAD. VEHICLE 1 WAS TRAVELING IN THE SAME DIRECTION BUT WAS IN FRONT OF VEHICLE 2. BOTH VEHICLES WERE WAITING TO TURN RIGHT ONTO GROSVENOR ROAD. VEHICLE 1 HAS ROLLED BACKWARDS INTO VEHICLE 2. IT THEN PULLED FORWARD THEN REVERSED INTO VEHICLE 2. THE DRIVER OF VEHICLE 2 GOT OUT AND WENT TO THE DRIVER OF VEHICLE 1 WHO STILL REMAINED IN HER VEHICLE AND TOLD HER WHAT SHE HAD

Slight Accident

Involving 2 Vehicle, 1 Casualty

0205493

Location	South Tyneside A 185 433285E, 565058N	Date/Time	Saturday 29 July 2017 20:45
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 185
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 48 Not requested Postcode: NE31 1YP Other	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 23 Not requested Postcode: NE32 3QA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 21	Not a bus or coach passenger
SR5 4HT	

***Description
of Location***

A185 AT JN WITH HOWARD STREET A185

***Description
of Accident***

V1 HEADING EAST ON A185 HOWARD STREET IN JARROW APPROACHING ROUNDABOUT AT JUNCTION WITH A185 FROM THE A19, V2 HEADING TOWARDS ROUNDABOUT ON A185 FROM THE A19. V2 ENTERS ROUNDABOUT WITH THE INTENTION OF TURNING RIGHT ONTO PRIORY ROAD AND PROCEEDS FORWARD, V1 THEN ENTERS THE ROUNDABOUT AND CRASHES INTO THE NEAR SIDE OF V2 CAUSING DAMAGE AND MINOR INJURY TO THE F/N/S PASSENGER.

Slight Accident

Involving 3 Vehicle, 3 Casualties

0203425

Location	South Tyneside A 1018 437444E, 564345N	Date/Time	Thursday 11 May 2017 19:10
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Following too close (A) Failed to judge other person's path or speed (B) Sudden braking (B)

Vehicle 1

Driver	Male, 20 Negative Postcode: NE34 6JT Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male 20	Not a bus or coach passenger
NE34 6JT	

Vehicle 2

Driver	Male, 35 Negative Postcode: NE34 8TN Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 35	Not a bus or coach passenger
NE34 8TN	

Vehicle 3

Driver Male, 39
Negative
Postcode: NE34 8UA
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from North to South
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 3 - Slight

Driver or rider
Male 39
NE34 8UA
Not a car passenger
Not a bus or coach passenger

Description of Location KING GEORGE ROAD A1018 NEAR JN WITH PRINCE EDWARD ROAD A1300

Description of Accident VEHICLE 2 & 3 STATIONARY IN TRAFFIC ON KING GEORGE ROAD, APPROACHING JUNCTION OF ROUND-A-ABOUT WITH PRINCE EDWARD ROAD, SOUTH SHIELDS,SOUTH TYNESIDE. DRIVER OF VEHICLE 1 TRAVELS ALONG KING GEORGE ROAD, SOUTH SHIELDS, APPROACHING BEHIND VEHICLE 2. DRIVER OF VEHICLE 1 BRAKES SUDDENLY UPON SEEING VEHICLE 2 AND FRONT END OF VEHICLE 1 COLLIDES WITH REAR OF VEHICLE 2, CAUSING AIRBAGS TO BE DEPLOYED INSIDE VEHICLE 2. DUE TO VEHICLE 1 IMPACTING WITH THE REAR OF VEHICLE 2, THIS IMPACT HAS FORCED VEHICL

Slight Accident

Involving 2 Vehicle, 1 Casualty

0206128

Location	South Tyneside A 194 433754E, 563569N	Date/Time	Saturday 13 May 2017 14:40
Road	Dual Carriageway 40	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	Temporary road layout (eg. contraflow) (A)

Vehicle 1

Driver	Male, 33 Driver not contacted at time of accident Postcode: NE34 6RZ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 42 Driver not contacted at time of accident Postcode: NE33 3GA Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	42	Not a bus or coach passenger
NE33 3GA		

***Description
of Location***

LINDISFARNE ROUNDABOUT A194 AT JN WITH A19

***Description
of Accident***

V2 DRIVING AROUND LINDISFARNE ROUNDABOUT WHEN A TEMPORARY BARRIER HAS FALLEN INTO LANE.V2 HAS THEN HAD TO BRAKE SUDDENLY AND V1 HAS COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0209202

Location	South Tyneside B 1298 436541E, 565831N	Date/Time	Saturday 05 August 2017 18:12
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 64 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 35	Standing passenger

Description of Location	STANHOPE PARADE B1298

Description of Accident	V1 WAS DRIVING ALONG STANHOPE PARADE IN THE DIRECTION OF THE MARKET. THE DRIVER SAW 3 PEOPLE AT THE BUS STOP BY THE MEDICAL CENTRE AND PULLED IN, NO PERSON WANTED THE BUS AND NO ONE HAD SOUNDED THE BELL TO ALIGHT. THE DRIVER CHECK THE MIRRORS AND PULLED AWAY. AT THE NEXT STOP A MALE PASSENGER STATED THAT HE HAD INJURED HIS LOWER BACK AT THE PREVIOUS STOP. AN INDEPENDENT WITNESS, HAS ALIGHTED AND INFORMED THE DRIVER THAT THE PASSENGER HAD NOT HURT HIMSELF.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0208065

Location	South Tyneside 437428E, 564471N	Date/Time	Wednesday 24 May 2017 20:37
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 51 Negative Postcode: NE34 9TY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 17 Not applicable Postcode: NE34 8DF Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	17	Not a bus or coach passenger
NE34 8DF		

*Description
of Location*

LASCELLES AVENUE AT JN WITH KING GEORGE ROAD A1018

*Description
of Accident*

DRIVER OF FORD FIESTA HEADING WEST ON LASCELLES AVENUE, APPROACHING JUNCTION OF KING GEORGE ROAD (4 METERS AWAY). RIDER OF BICYCLE HEADING SOUTH ON THE PAVEMENT OF KING GEORGE ROAD CROSSES LASCELLES AVENUE AND COLLIDES WITH FORD FIESTA ON THE NEAR SIDE FRONT OF BONNET.

Slight Accident

Involving 4 Vehicle, 4 Casualties

0210020

Location	South Tyneside A 184 436645E, 564525N	Date/Time	Friday 26 May 2017 12:15
Road	Dual Carriageway 60	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (A) Following too close (A) Following too close (A) Sudden braking (A) Sudden braking (A) Sudden braking (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 43 Negative Postcode: DH4 6QL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	43	Not a bus or coach passenger
DH4 6QL		

Casualty 2 - Slight

Vehicle or pillion passenger
Female 16
DH4 6QL

Front seat passenger
Not a bus or coach passenger

Vehicle 3

Driver Male, 52
Negative
Postcode: NE34 8JD
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from North East to South West
Slowing or stopping
No skidding, jack-knifing or overturning
Did not leave carriageway

Collisions Hit no other vehicle
Back
None
None

Casualty 3 - Slight

Vehicle or pillion passenger
Female 51
NE34 8JD

Front seat passenger
Not a bus or coach passenger

Casualty 4 - Slight

Vehicle or pillion passenger
Female 17
NE34 8JD

Rear seat passenger
Not a bus or coach passenger

Vehicle 4

Driver Female, 66
Negative
Postcode: NE61 6LH
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from North East to South West
Slowing or stopping
No skidding, jack-knifing or overturning
Did not leave carriageway

Collisions Hit no other vehicle
Did not impact
None
None

Description of Location NEWCASTLE ROAD A184

Description of Accident THE DRIVER OF VEHICLE 4 HAS SLOWED & PULLED OVER INTO A JUNCTION WHILST TRAVELING WESTBOUND ON THE A184. DUE TO VEHICLE 4 SLOWING, THE DRIVERS OF VEHICLES 3 & 2 HAVE HAD TO BRAKE HARD TO AVOID A COLLISION. AS VEHICLE 2 HAS COME TO A STOP, NARROWLY AVOIDING VEHICLE 3, THE DRIVER OF VEHICLE 1 HAS COLLIDED WITH THE REAR OF VEHICLE 2 AND SHUNTED IT FORWARD INTO VEHICLE 3. THE DRIVER OF VEHICLE 1 THEN DROVE OFF, LEAVING THE SCENE WITHOUT PASSING ON ANY DETAILS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0210390

Location	South Tyneside A 194 433744E, 563547N	Date/Time	Tuesday 20 June 2017 19:30
Road	Dual Carriageway 70	Junction	Roundabout Automatic traffic signal A 19
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Buildings, road signs, street furniture (A)

Vehicle 1

Driver	Male, 45 Driver not contacted at time of accident Postcode: NE34 8JZ Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 17 Driver not contacted at time of accident Postcode: NE10 0AG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	17	Not a bus or coach passenger
NE10 0AG		

***Description
of Location***

LINDISFARNE ROUNDABOUT A194 AT JN WITH A19

***Description
of Accident***

V2 IS A LEARNER DRIVER AND WAS OUT WITH HER MOTHER WHO IS QUALIFIED TO BE IN PASSENGER SEAT, V1 WAS ON THE LINDISFARNE ROUNDABOUT WHEN V2 HAS COME STRAIGHT ONTO THE ROUNDABOUT IN V1 FRONT NEAR SIDE WING, CAUSING MINOR INJURY TO V2.

Slight Accident

Involving 2 Vehicle, 4 Casualties

0214021

Location	South Tyneside A 194 434255E, 563864N	Date/Time	Monday 28 August 2017 12:05
Road	Roundabout 50	Junction	Roundabout Automatic traffic signal A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 47 Driver not contacted at time of accident Postcode: NE21 5LB Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	47	Not a bus or coach passenger
NE21 5LB		

Casualty 2 - Slight

Vehicle or pillion passenger

Female 44

Front seat passenger

Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger

Female 13

Rear seat passenger

Not a bus or coach passenger

Casualty 4 - Slight

Vehicle or pillion passenger

Female 13

Rear seat passenger

Not a bus or coach passenger

Description of Location

LEAM LANE A194 AT JN WITH JOHN REID ROAD A1300

Description of Accident

THE DRIVER OF VEHICLE 2 WAS STATIONARY ON THE A194 LEAM LANE AT THE ROUNDABOUT WITH THE A1300 JOHN REID ROAD WHEN VEHICLE 1 HAS FAILED TO STOP IN TIME AND HAS COLLIDED WITH THE REAR OF VEHICLE 2. BOTH PARTIES STOPPED AT THE SCENE AND EXCHANGED DETAILS.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0219708

Location	South Tyneside A 1018 436992E, 565989N	Date/Time	Monday 11 September 2017 16:00
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining with high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Rain, sleet, snow or fog (A)

Vehicle 1

Driver	Male, 61 Driver not contacted at time of accident Postcode: NE34 6EB Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	Bus Lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		Unknown or other
Female	14	Unknown or other
		Standing Still

Description of Location	DEAN ROAD A1018 AT JN WITH ADA STREET

Description of Accident	VEHICLE 1 PULLING INTO BUS STOP AND IMPACTS A LAMP POST WITH THE NEAR SIDE WING MIRROR. GLASS FROM WING MIRROR SHATTERS AND GLASS HITS PEDESTRIAN WAITING AT BUS STOP CAUSING MINOR DAMAGE.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0185419

Location	South Tyneside 436121E, 566081N	Date/Time	Wednesday 24 May 2017 15:45
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 57 Negative Postcode: NE34 6SB Journey as part of work	Vehicle	Goods vehicle 7.5 tonnes mgw and over No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Female	75	Crossing from driver's nearside East

Description of Location	NEW GEORGE STREET

Description of Accident	DRIVER V1 REVERSING DID NOT SEE I.P WHO WALKED BEHIND VAN. V1 COLLIDED WITH I.P CAUSING SERIOUS INJURY. DRIVER V1 ARRESTED SEC 5A POSITIVE ROADSIDE DRUGS TEST

Slight Accident

Involving 2 Vehicle, 1 Casualty

0206104

Location	South Tyneside C 408 436965E, 564820N	Date/Time	Monday 31 July 2017 12:51
Road	Single Carriageway 30	Junction	Other junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 23 Driver not contacted at time of accident Postcode: NE33 4SH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Overtaking stationary vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 68 Driver not contacted at time of accident Postcode: NE34 OPS Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 40	Not a bus or coach passenger
NE34 OPS	

***Description
of Location***

TEMPLE PARK ROAD, SOUTH SHIELDS C408 AT JN WITH AMBLESIDE AVENUE, SOUTH SHIELDS

***Description
of Accident***

V2 WAS TRAVELLING SOUTH ALONG TEMPLE PARK ROAD, V1 WAS TRAVELLING CLOSE BEHIND. V2 INDICATED AND SLOWED DOWN TO TURN LEFT INTO AMBLESIDE AVENUE. AS V2 BEGAN TO TURN THEY HEARD A LOUD BANG FROM THE REAR OF THE VEHICLE. THE OCCUPANTS OF VEHICLE 2 STOPPED, SAW V1 SLOW AND MALE OCCUPANT LOOK OVER THEN V1 SPED OFF UP TEMPLE PARK ROAD. ON CHECKING THE REAR OF V2 THE OCCUPANTS CAN SEE THAT THE REAR DRIVERS SIDE BUMPER HAS BEEN DAMAGED IN 3 PLACES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0199009

Location	South Tyneside A 1300 435081E, 563430N	Date/Time	Saturday 08 July 2017 22:45
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 44 Negative Postcode: SR4 6AX Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Changing lane to right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 44	Not a bus or coach passenger
SR4 6AX	

Vehicle 2

Driver	Male, 41 Negative Postcode: NE34 8DQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

JOHN REID ROAD, STH SHIELDS, A1300 A1300

***Description
of Accident***

DRIVER OF V1 STATES HE WAS DRIVING HIS M/V ON THE JOHN REID ROAD TOWARD BROCKLEY WHINS WITH CEMETARY ON NEAR SIDE, HE INDICATED RIGHT BEFORE LOOKING IN HIS REAR VIEW MIRRORS, HE MOVED OVER TO THE RIGHT HAND LANE AND COLLIDING WITH V2. DRIVER OF V2 STATES HE WAS TRAVVELLING IN THE SAME ROAD, JOHN REID ROAD, IN LANE 2 TOWARD BROCKLEY WHINS WHEN THE DRIVER OF V1 INDICATED AND PULLED OUT IN FRONT OF HIM COLLIDING WITH HIS FRONT NEAR SIDE.

Serious Accident

Involving 4 Vehicle, 4 Casualties

0189727

Location	South Tyneside B 1298 436549E, 565608N	Date/Time	Sunday 11 June 2017 11:58
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 32 Negative Postcode: NE34 8JH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 32	Not a bus or coach passenger
NE34 8JH	

Vehicle 2

Driver	Female, 18 Negative Postcode: NE33 4TS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Waiting to turn right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 3 - Slight

Driver or rider	Not a car passenger
Female 18	Not a bus or coach passenger
NE33 4TS	

Casualty 4 - Slight

Vehicle or pillion passenger
Female 17

Front seat passenger
Not a bus or coach passenger

Vehicle 3

Driver Not traced,
Not applicable
Postcode:
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Front
Parked vehicle
Entered ditch

Movement Vehicle was Parked
Parked
No skidding, jack-knifing or overturning
Left carriageway nearside

Vehicle 4

Driver Female, 77
Negative
Postcode: NE34 8NH
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle was Parked
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 2 - Serious

Driver or rider
Female 77
NE34 8NH

Not a car passenger
Not a bus or coach passenger

Description of Location STANHOPE ROAD WESTBOUND AT THE JUNCTION WITH BEWICK STREET TO THE OFFSIDE B1298 AT JN WITH BEWICK STREET

Description of Accident IT APPEARS THAT V1 WAS HEADING WEST ON STANHOPE ROAD IN SOUTH SHIELDS AT SPEED, V2 HAD MOVED OFF FROM A PARKING LAYBY ON THE OFFSIDE OFF STANHOPE ROAD NEAR TO GILLS FISH SHOP AND THEN SLOWS TO TURN RIGHT INTO BEWICK STREET TO THE OFFSIDE. V1 MOVES OUT TO OVERTAKE V2 AND AS V2 TURNS RIGHT V1 CRASHES INTO THE FRONT OFFSIDE OF V2 AND CAREERS TO THE OFFSIDE, CRASHING HEADFIRST INTO V3 WHICH IS SHUNTED BACKWARDS INTO THE FRONT OF V4, V3 IS THEN FORCED FROM THE ROAD ONTO THE PAVEMENT AND COMES TO A ST

Serious Accident

Involving 2 Vehicle, 1 Casualty

0231695

Location	South Tyneside C 406 435104E, 563985N	Date/Time	Saturday 21 October 2017 14:16
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 25 Not provided (medical reasons) Postcode: NE31 1QT Not known	Vehicle	Motorcycle over 125cc and up to 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Overtaking moving vehicle on its offside Skidded and overturned Left carriageway offside

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 25	Not a bus or coach passenger
NE31 1QT	

Vehicle 2

Driver	Female, 29 Negative Postcode: NE34 7NX Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

WENLOCK ROAD C406 AT JN WITH BINCHESTER STREET

***Description
of Accident***

V2 (QASHQAI) WAS IN THE PROCESS OF TURNING RIGHT OFF WENOCK ROAD INTO BINCHESTER STREET. AS THIS VEHICLE WAS TURNING V1 (MOTORCYCLE) ATTEMPTED TO OVERTAKE V2 TO ITS OFFSIDE AND COLLIDED WITH V2 CAUSING THIS RIDER OF V1 TO FALL OFF HIS MOTORCYCLE AND SUSTAIN SERIOUS INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0230298

Location	South Tyneside A 194 436204E, 566228N	Date/Time	Saturday 14 October 2017 17:55
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Other Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 28 Driver not contacted at time of accident Postcode: SR6 7BL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 29 Driver not contacted at time of accident Postcode: NE34 9FD Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside Bollard/Refuge None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	29	Not a bus or coach passenger
NE34 9FD		

***Description
of Location***

WESTERN APPROACH A194

***Description
of Accident***

VEHICLE 2 WAS TRAVELLING ON WESTERN APPROACH WHEN VEHICLE 1 HAS EXITED THE ROUNDABOUT AND WHEN DOING SO HAS THEN COLLIDED WITH VEHICLE 2 ITS NEAR SIDE WHICH HAS THEN FORCED IT INTO THE CRASH BARRIER. BOTH PARTIES STOPPED AT THE SCENE BEFORE MOVING FURTHER UP THE ROAD WHERE INITIALLY DETAILS WERE EXCHANGED. HOWEVER WHEN THE DRIVER OF VEHICLE 1 BECAME AWARE POLICE HAD BEEN CONTACTED HE MADE OFF.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0214188

Location	South Tyneside 435932E, 565926N	Date/Time	Tuesday 22 August 2017 13:50
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 77 Not requested Postcode: SR6 7RG Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 31 Driver not contacted at time of accident Postcode: NE33 3AW Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	31	Not a bus or coach passenger
NE33 3AW		

*Description
of Location*

SOUTH ELDON STREET AT JN WITH SMITH STREET

*Description
of Accident*

8. V1 WAS AT THE JUNCTION OF SMITH STREET WAITING TO TURN RIGHT ONTO SOUTH ELDON STREET. V1 HAS PULLED OUT OF THE JUNCTION WHILE V2 WAS GOING PAST THE JUNCTION. V1 HAS COLLIDED WITH THE DRIVERSIDE DOOR OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0215690

Location	South Tyneside A 194 433839E, 563572N	Date/Time	Thursday 31 August 2017 17:55
Road	Roundabout 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 27 Driver not contacted at time of accident Postcode: DE14 2SP Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 55 Driver not contacted at time of accident Postcode: NE38 7TB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to South Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	55	Not a bus or coach passenger
NE38 7TB		

***Description
of Location***

LINDISFARNE ROUNDABOUT A194 NEAR JN WITH A19

***Description
of Accident***

V2 HAS BEEN STATIONARY ON THE LINDISFARNE ROUNDABOUT (ON LEAM LANE) AWAITING TO TURN LEFT ONTO THE A19 SOUTH TOWARDS SUNDERLAND. AS THE DRIVER OF V2 HAS BEEN WAITING, HELD UP AT A RED LIGHT, V1 HAS COLLEDED WITH THE REAR OF V2 CAUSING DAMAGE TO THE REAR BUMPER. V1 HAS THEN DROVE AROUND V2. THE DRIVER OF V2 HAS REPORTED THE INCIDENT TO POLICE AS SHE THOUGHT V1 HAD MADE OFF, HOWEVER, THE DRIVER OF V1 REPORTED THE INCIDENT ALSO TO POLICE 30 MINS LATER STATING THAT HE HAD PANICKED. X REF LOG 905 3

Slight Accident

Involving 2 Vehicle, 1 Casualty

0234149

Location	South Tyneside A 1018 436673E, 566561N	Date/Time	Friday 05 May 2017 15:07
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, 26 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 52 Not requested Postcode: NE35 9NF Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	52	Not a bus or coach passenger
NE35 9NF		

***Description
of Location***

WESTOE ROAD A1018 AT JN WITH WHARTON STREET

***Description
of Accident***

V2 TRAV NORTH ON WESTOE ROAD STOPS AT THE LIGHTS AT THE J/W WHARTON STREET. V1 ALSO TRAV NORTH ON WESTOE ROAD FAILED TO STOP AND COLLIDED WITH THE REAR OF V2. V1 THEN ASKED V2 TO PULL OVER FURTHER UP THE ROAD. V2 PULLED OFF AND V1 LEFT THE SCENE.

Serious Accident

Involving 1 Vehicle, 2 Casualties

0237516

Location	South Tyneside A 1018 437178E, 565553N	Date/Time	Tuesday 07 November 2017 18:20
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A) Aggressive driving (A) Other (A) Vehicle in course of crime (A)

Vehicle 1

Driver	Male, 19 Negative Postcode: NE33 4LE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Tree	Location	Footway (pavement) Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Serious

Vehicle or pillion passenger	Rear seat passenger
Female 12	Not a bus or coach passenger
NE34 0BQ	

Casualty 2 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 17	Not a bus or coach passenger
NE33 4LE	

Description of Location SUNDERLAND ROAD A1018

Description of Accident WHISLT FAILING TO STOP FOR POLICE, V1 DRIVES THE WRONG WAY ROUND THE ROUNDABOUT (SUNDERLAND ROAD/KING GEORGE ROAD) MOUNTS THE PAVEMENT ON SUNDERLAND ROAD AND COLLIDES WITH A TREE

Slight Accident

Involving 1 Vehicle, 1 Casualty

0239769

Location	South Tyneside 437308E, 564932N	Date/Time	Sunday 12 November 2017 13:52
Road	Dual Carriageway 30	Junction	T or staggered junction Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 2

Driver	Male, 41 Driver not contacted at time of accident Postcode: SR6 7PS Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead right hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 53	Seated passenger

Description of Location	MORTIMER ROAD AT JN WITH KING GEORGES ROAD A1018

Description of Accident	ON THE 12/11/17 AT 1352 HOURS A BUS HAS BEEN DRIVING ON MORTIMER ROAD SOUTH SHEILDS AND WHEN HE HAS BEEN AT THE JUNCTION WITH KING GEORGES ROAD A DRUNK PASSENGER HAS FALLEN OFF HIS CHAIR CAUSING MINOR INJURY TO HIMSELF.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0240517

Location	South Tyneside 434199E, 563871N	Date/Time	Wednesday 15 November 2017 08:00
Road	Dual Carriageway 30	Junction	Roundabout Automatic traffic signal A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 55 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 24 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 28
Driver not contacted at time of accident
Postcode: NE32 3TR
Commuting to/from work

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle moving from North to East
Moving off
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Driver or rider
Male 28
NE32 3TR
Not a car passenger
Not a bus or coach passenger

Description of Location AUCKLAND TERRACE AT JN WITH NEWCASTLE ROAD A194

Description of Accident VEHILCE 1 HAS BEEN TRAVELING EASTBOUND ALONG THE A194 LEAM LANE AND HAS ALLGEDLY GONE THROUGH A RED LIGHT AT THE ROUNDABOUT WITH NEWCASTLE ROAD SOUTH SHIELDS. VEHICLE 2 AND VEHICLE 3 HAVE BEEN STATIONARY ON AUKLAND TERRACE WAITING FOR THE LIGHTS TO CHANGE TO GREEN. THE LIGHTS HAVE CHANGED TO GREEN AND BOTH VEHICLE 2 AND 3 HAVE BEGAN TO MOVE OFF. DUE TO VEHICLE 1 VEHICLE 2 HAS HAD TO STOP AND VEHICLE 3 HAS COLLIDED WITH THE REAR OF VEHICLE 2. VEHICLE 1 HAS LEFT THE SCENE FAILING TO STOP. THE DRIV

Slight Accident

Involving 3 Vehicle, 1 Casualty

0167189

Location	South Tyneside A 194 433750E, 563523N	Date/Time	Saturday 25 March 2017 10:35
Road	Roundabout 30	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 30 Driver not contacted at time of accident Postcode: Commuting to/from work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	30	Not a bus or coach passenger

Vehicle 3

Driver Male, 18
Driver not contacted at time of accident
Postcode:
Not known

Collisions Hit no other vehicle

Back
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Entering roundabout

Movement Vehicle moving from South to North
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location LINDISFARNE ROUNDABOUT A194 AT JN WITH LEAM LANE A19

Description of Accident DRIVERS FROM V2 AND V3 SPOKE TO WHO STATE THAT THEY HAVE BEEN STATIC AT TRAFFIC LIGHTS ON LINDISFARNE ROUNDABOUT IN JARROW WAITING TO GO AHEAD. THEY BELIEVE THAT V1 HAS GONE THROUGH THE PREVIOUS SET OF LIGHTS ON AMBER AND COLLIDED WITH V2 CAUSING IT TO SHUNT INTO V3. THE DRIVERS HAVE AGREED TO GET OFF THE MAIN CARRIAGEWAY AND PULLED ONTO LINDISFARNE ROAD HOWEVER V1 HAS FAILED TO DO SO AND DRIVEN OFF ONTO THE A194 LEAM LANE TOWARDS SIMONSDALE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0232120

Location	South Tyneside 434547E, 564130N	Date/Time	Friday 20 October 2017 08:15
Road	Dual Carriageway 30	Junction	Crossroads Automatic traffic signal
Conditions	Daylight - Street Lights Present Other Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 37 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 32 Driver not contacted at time of accident Postcode: DH4 4SH Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	32	Not a bus or coach passenger
DH4 4SH		

***Description
of Location***

NEWCASTLE ROAD NEAR JN WITH SHAFTESBURY AVENUE

***Description
of Accident***

FWIN 504 201017 V2 HAS BEEN STATIONARY AT A SET OF TRAFFIC LIGHTS. V2 WAS WAITING TO GO STRAIGHT AHEAD AND THERE WERE NO VEHICLES IN FRONT. V1 HAS COLLIDED WITH THE REAR OF V2. BOTH DRIVERS HAVE SPOKEN TO EACH OTHER AND THE DRIVER OF V1 HAS PROVIDED NAME, EMAIL AND ADDRESS TOGETHER WITH TELEPHONE NUMBER. THE IP FAILED TO OBTAIN THE VRM OF V1 HOWEVER STATED THAT IT WAS A SILVER/WHITE FORD FIESTA POSSIBLY A 52 PLATE. BOTH PARTIES HAVE CORRESPONDED VIA EMAIL AND THE DRIVER OF V1 HAS REFUSED T

Slight Accident

Involving 1 Vehicle, 1 Casualty

0240690

Location	South Tyneside A 19 433708E, 563976N	Date/Time	Tuesday 14 November 2017 06:50
Road	Dual Carriageway 70	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 41 Negative Postcode: NE12 7HX Commuting to/from work	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Changing lane to left Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 41	Not a bus or coach passenger
NE12 7HX	

Description of Location	A19 NEAR JN WITH A194

Description of Accident	V1 (MOTORCYCLE) TRAVELLING SOUTH ON A19 DUAL CARRIAGEWAY. VEHICLE MOVES FROM OUTSIDE LANE TO INSIDE AND FAILS TO SEE SLOW MOVING VEHICLE AHEAD. AS A RESULT RIDER OF V1 THROWS HIMSELF OFF MOTORCYCLE ONTO THE GROUND TO AVOID COLLIDING WITH SLOW MOVING VEHICLE, MINOR INJURY CAUSED TO RIDER AND DAMAGE TO HIS MOTORCYCLE.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0208764

Location	South Tyneside A 194 434513E, 564068N	Date/Time	Tuesday 01 August 2017 20:45
Road	Dual Carriageway 40	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Aggressive driving (A)

Vehicle 1

Driver	Male, 22 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 45 Negative Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	45	Not a bus or coach passenger

Vehicle 3

Driver Male, 28
Driver not contacted at time of accident
Postcode: NE34 0RP
Other

Collisions Hit no other vehicle
Offside
None
None

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Mid junction - on roundabout or on main road
Movement Vehicle moving from East to West
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location NEWCASTLE ROAD A194 NEAR JN WITH HENDERSON ROAD

Description of Accident POLICE DRIVER RESPONDING TO HI-1 WHILE OVERTAKING V1 DRIVER V1 MOVES TO THE RIGHT AND COLLIDES WITH POLICE VEHICLE. V1 THEN MAKES OFF AS DRIVER MAKES RUDE GESTURE FROM WINDOW. POLICE VEH THEN PURSUES V1, DURING PURSUIT V1 COLLIDES WITH V3 CAUSING MINOR DAMAGE.PURSUIT ABORTED DUE TO RISK TAKEN BY DRIVER V1.LOCATED ABANDONED SHORT DISTANCE AWAY

Slight Accident

Involving 2 Vehicle, 1 Casualty

0240154

Location	South Tyneside A 19 433387E, 564864N	Date/Time	Tuesday 07 November 2017 11:10
Road	Dual Carriageway 50	Junction	Slip Road Give way or uncontrolled A 185
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Sudden braking (B)

Vehicle 1

Driver	Female, 78 Negative Postcode: NE32 4TY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering from slip road
		Movement	Vehicle moving from North to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	78	Not a bus or coach passenger
NE32 4TY		

Vehicle 2

Driver	Male, 54 Negative Postcode: NE33 5RS Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering from slip road
		Movement	Vehicle moving from North to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

*Description
of Location*

A19 AT JN WITH A185

*Description
of Accident*

V1 HYUNDAI FOLLOWING V2 FROM SLIP ROAD ONTO A19 SOUTH BOUND FROM JARROW. V2 STOPS SUDDENLY AND V1 COLLIDES WITH REAR OF V2, CAUSING DAMAGE TO BOTH VEHICLES.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0245108

Location	South Tyneside A 194 436238E, 566413N	Date/Time	Friday 01 December 2017 11:48
Road	Dual Carriageway 30	Junction	Roundabout Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Stationary or parked vehicle(s) (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 32 Negative Postcode: NE34 7JD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	57	Crossing from driver's nearside - masked by parked or stationary vehicle
NE34 7JD		West

Description of Location WESTERN APPROACH A194 AT JN WITH VICTORIA ROAD

Description of Accident VEHICLE 1 TRAVELLING SOUTH ALONG WESTERN APPROACH, SLOW UPON APPROACH TO TRAFFIC LIGHT AHEAD ON RED. TRAFFIC LIGHT TURN FROM RED TO AMBER, DRIVER VEHICLE 1 APPROACHES LIGHTS NO MORE THAN 10 MPH, SUDDENLY IP RUN ACROSS CROSSING FROM NEAR SIDE, MASKED BY LARGE HEAVY GOODS VEHICLE IN LANE 1. IP RUN INTO SIDE OF VEHICLE 1 COLLIDING WITH PASSENGER DOOR MIRROR. INJURY CAUSED TO IP.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0249733

Location	South Tyneside 436500E, 566927N	Date/Time	Saturday 16 December 2017 12:40
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 38 Driver not contacted at time of accident Postcode: NE33 3GE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 27 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	27	Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 19

Not a bus or coach passenger

Description of Location

CHARLOTTE STREET

Description of Accident

VEH 1 HAS PULLED OUT AND COLLIDED WITH REAR NEARSIDE OF VEH 2 DAMAGING SAME AND CAUSING MINOR INJURIES

Slight Accident

Involving 2 Vehicle, 1 Casualty

0249502

Location	South Tyneside 436636E, 566536N	Date/Time	Monday 18 September 2017 09:01
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 19 Not applicable Postcode: NE35 9BJ Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 19	Not a bus or coach passenger
NE35 9BJ	

Vehicle 2

Driver	Female, 36 Not requested Postcode: NE34 0PN Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

HALSTEAD PLACE

***Description
of Accident***

CYCLIST V1 HAS CYCLED DOWN THE FOOTPATH ON ROBINSON STREET, HE HAD HEADPHONES ON AND WAS LOOKING IN THE WRONG DIRECTION, HE HAS LEFT THE FOOTPATH ONTO HALSTEAD PLACE AND COLLIDED WITH THE DRIVERS SIDE OF THE YARIS V2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0252279

Location	South Tyneside A 194 435539E, 565016N	Date/Time	Friday 22 December 2017 19:00
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1302
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Deposit on road (eg. oil, mud, chippings) (B)

Vehicle 1

Driver	Male, 42 Not requested Postcode: NE29 7AF Journey as part of work	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South West to North East Moving off Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 42	Not a bus or coach passenger
NE29 7AF	

Description of Location
A194 AT JN WITH B1302

Description of Accident
DRIVER V1 STATES HE WAS TRAVELLING IN A SOUTH WESTERNLY DIRECTION ON A194 AND ON REACHING THE ROUNDABOUT IN THE NEAR SIDE LANE HAS GONE TO ACCELERATE AND LOST CONTROL WITH THE BIKE FALLING ONTO HIS RIGHT LEG CAUSING PAIN TO HIS KNEE AND ALSO HIS RIGHT FOOT. ALL INJURIES MINOR IN NATURE AND NO ONE PRESENT TO SUGGEST ACCOUNT OTHER THAN THAT GIVEN.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0246628

Location	South Tyneside A 194 435918E, 565525N	Date/Time	Wednesday 06 December 2017 11:50
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled C 407
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 43 Driver not contacted at time of accident Postcode: NE8 4NR Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 42 Driver not contacted at time of accident Postcode: NE31 2GD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South West to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	42	Not a bus or coach passenger
NE31 2GD		

***Description
of Location***

WESTERN APPROACH A194 AT JN WITH BARNES ROAD C407

***Description
of Accident***

V2 IS TRAVELLING SOUTH WEST IN THE OUTSIDE LANE OF A 40MPH DUAL CARRIAGEWAY APPROACHING A ROUNDABOUT AND GOING STRAIGHT AHEAD (2ND EXIT). V1 IS TRAVELLING IN THE INSIDE LANE TO THE NEAR SIDE OF V2. AS V2 TRAVELS OVER THE ROUNDABOUT V1 TURNS RIGHT ACROSS ITS PATH AND THE NEAR SIDE OF V2 COLLIDES WITH THE OFFSIDE OF V1 CAUSING DAMAGE TO BOTH.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0256365

Location	South Tyneside A 194 433743E, 563543N	Date/Time	Monday 08 January 2018 08:30
Road	Dual Carriageway 40	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	

Vehicle 1

Driver	Female, 42 Driver not contacted at time of accident Postcode: DL1 3TS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 54 Driver not contacted at time of accident Postcode: TS25 1JT Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	54	Not a bus or coach passenger
TS25 1JT		

***Description
of Location***

LINDISFARNE ROUNDABOUT A194 AT JN WITH A19

***Description
of Accident***

VEH 2 TRAVELLING ALONG LEAM LANE HEADING STRAIGHT OVER LINDISFARNE ROUNDABOUT IN INSIDE LANE AS LIGHTS ON GREEN. VEH 1 HAS COME FROM THE RIGHT AND TURNED INTO DRIVERS DOOR OF VEH 2 DAMAGING SAME. VEH 1 APPEARED TO WANT TO BE OFF AT SLIP ROAD EXIT ON TO A19/TYNE TUNNEL

Slight Accident

Involving 3 Vehicle, 1 Casualty

0255707

Location	South Tyneside A 194 435533E, 565014N	Date/Time	Tuesday 09 January 2018 07:55
Road	Roundabout 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 26 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 24
Driver not contacted at time of accident
Postcode: NE33 2EL
Commuting to/from work

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from East to West
Turning right
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Driver or rider
Male 24
NE33 2EL
Not a car passenger
Not a bus or coach passenger

Description of Location WESTERN APPROACH A194 NEAR JN WITH HUDSON STREET B1302

Description of Accident FWIN 215 090118 THE DRIVER OF V3 HAS BEEN TRAVELLING ON THE A194 NORTHBOUND. HE HAS CONTINUED ONTO THE ROUNDABOUT TO TURN RIGHT INTO THE PORT OF THE TYNE, WHERE HE WORKS. AS HE HAS CONTINUED AROUND THE ROUNDABOUT V1 HAS FAILED TO GIVE WAY FROM THE LEFT (JUNCTION WITH JARROW ROAD) AND HAS PULLED OUT ON THE JUNCTION. THIS HAS CAUSED THE DRIVER OF V3 TO STOP SUDDENLY ON THE ROUND ABOUT. V2 HAS BEEN CONTINUED ONTO THE ROUND ABOUT TRAVELLING FROM JARROW ROAD ALSO. V2 HAS BEEN POSITIONED BEHIND V3 A

Slight Accident

Involving 1 Vehicle, 1 Casualty

0192313

Location	South Tyneside A 1018 436811E, 566128N	Date/Time	Saturday 17 June 2017 19:00
Road	One way street 30	Junction	Other junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 55 Negative Postcode: NE33 3AR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Female	48	Crossing from driver's nearside
NE33 4AE		North

Description of Location IMEARY STREET A1018 AT JN WITH EAST STEVENSON STREET

Description of Accident VEHICLE ONE HAS PULLED OUT OF EAST STEVENSON STREET TURNING RIGHT ONTO IMEARY STREET. DRIVER ONE HAS BEEN BLINDED BY LOW SUN AND COLLIDED WITH PEDESTRIAN WHO WAS CROSSING IMEARY STREET. I HAVE SPOKEN TO THE STAFF NURSE AT STDGH WHO CONFIRMED MINOR INJURIES ONLY CONSISTING OF MINOR MUSCLE BRUISING.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0247739

Location	South Tyneside B 1302 435672E, 564792N	Date/Time	Saturday 09 December 2017 17:35
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 60 Negative Postcode: NE23 8ER Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 24 Not requested Postcode: NE34 0NR Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	24	Not a bus or coach passenger
NE34 0NR		

***Description
of Location***

BOLDON LANE B1302 AT JN WITH HUDSON STREET

***Description
of Accident***

VEHICLE ONE PRECEDED TO TURN RIGHT OUT OF JUNCTION FAILING TO SEE VEHICLE 2 WHO WAS ON THE MAIN ROAD. VEHICLE ONE HAS EDGED OUT OF THE JUNCTION BY AROUND 2 FEET COLLIDED OFFSIDE TO NEAR SIDE ON VEHICLE 2. THE RIDER OF VEHICLE 2 WAS THROWN FROM MOTORBIKE AND SUFFERED MINOR INJURIES TO HAND, SORENESS AND BRUISING

Slight Accident

Involving 1 Vehicle, 1 Casualty

0256304

Location	South Tyneside 435902E, 565186N	Date/Time	Monday 14 August 2017 09:02
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B) Failed to look properly (B)

Vehicle 1

Driver	Female, 43 Not requested Postcode: NE34 0ES Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Female 20	Crossing from driver's nearside
NE33 5NQ	North East

Description of Location	WEST WAY AT JN WITH WESTERN APPROACH A194

Description of Accident	8) V1 WAS APPROACHING R.A.B FROM WESTWAY JUNCTION WITH WESTERN APPROACH TRAVELING ABOUT 10MPH WHEN THE PEDESTRIAN HAS WALKED ONTO THE ROAD INFRONT OF A STATIONARY VEHICLE OUT OF V1'S SIGHT AND V1 HAS COLLIDED WITH THE PEDESTRAIN CAUSING MINIOR INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0259175

Location	South Tyneside A 1018 437208E, 565537N	Date/Time	Wednesday 17 January 2018 17:25
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A)

Vehicle 1

Driver	Male, 28 Not requested Postcode: NE34 9JU Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to South East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 28	Not a bus or coach passenger
NE34 9JU	

Vehicle 2

Driver	Male, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

SUNDERLAND ROAD A1018 NEAR JN WITH SUNDERLAND ROAD A1018

***Description
of Accident***

IP IN VEHICLE 1 WAS TRAVELING SOUTH ALONG SUNDERLAND ROAD. A BLACK VW SCIROCCO HAS COLLIDED WITH THE REAR OF HIS VEHICLE AND THEN MADE OFF AT SPEED WITHOUT STOPPING.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0208376

Location	South Tyneside A 1300 437279E, 564228N	Date/Time	Sunday 06 August 2017 13:27
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Tyres illegal, defective or under-inflated (A) Aggressive driving (B) Aggressive driving (B)

Vehicle 1

Driver	Male, 34 Negative Postcode: NE34 0QZ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Road sign/Traffic Signal	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other Skidded Left carriageway offside onto central reservation

Vehicle 2

Driver	Male, 69 Driver not contacted at time of accident Postcode: NE34 7JQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back Bollard/Refuge Road sign/Traffic Signal	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other Skidded Left carriageway offside onto central reservation

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	69	Not a bus or coach passenger
NE34 7JQ		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 45

Not a bus or coach passenger

NE34 8NJ

Description of Location

JOHN REID ROAD A1300 NEAR JN WITH KING GEORGE ROAD A1018

Description of Accident

2X VEHICLES DRIVING WEST ON DUAL CARRIAGEWAY ROAD. VEHICLES COLLIDE AND LEAVE CARRIAGEWAY TO OFF-SIDE
COMING TO A HALT IN CENTRAL RESERVATION AFTER COLLIDING WITH STREET FURNITURE

Slight Accident

Involving 1 Vehicle, 1 Casualty

0224362

Location	South Tyneside A 1018 436569E, 566839N	Date/Time	Sunday 17 September 2017 03:52
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal A 194
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Impaired by alcohol (A)

Vehicle 1

Driver	Male, 25 Not provided (medical reasons) Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Bollard/Refuge None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 25	Not a bus or coach passenger

Description of Location WESTOE ROAD A1018 AT JN WITH CROSSGATE A194

Description of Accident DRIVER OF VEHICLE 1, UNDER THE INFLUENCE OF ALCOHOL HAS DRIVEN ROUND THE BEND AT TOO HIGH A SPEED AND LOST CONTROL OF THE VEHICLE COLLIDING WITH THE CENTRAL RESERVATION AND BARRIER

Slight Accident

Involving 1 Vehicle, 1 Casualty

0261664

Location	South Tyneside A 1018 436626E, 566708N	Date/Time	Wednesday 24 January 2018 19:05
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 24 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	Bus Lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 30	Seated passenger

Description of Location	WESTOE ROAD A1018

Description of Accident	V1 HAS BEEN TRAVELLING ALONG WESTOE ROAD SOUTH SHIELDS, WHEN THE DRIVER HAS BRAKED HARD TO AVOID HITTING A DOG WHICH HAS RAN INTO ROAD. PASSENGER HAS THEN FELL FORWARD AND HIT HIS FACE.

Serious Accident

Involving 4 Vehicle, 4 Casualties

0244116

Location	South Tyneside 436164E, 565610N	Date/Time	Wednesday 29 November 2017 08:55
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (A) Swerved (B) Passing too close to cyclist, horse rider or pedestrian (A) Slippery road (due to weather) (B)

Vehicle 1

Driver	Female, 44 Negative Postcode: NE32 3TR Taking pupil to/from school	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Female 44	Not a bus or coach passenger
NE32 3TR	

Casualty 4 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 17	Not a bus or coach passenger
NE32 3TR	

Vehicle 2

Driver	Not traced, 30 Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 52
Negative
Postcode: NE33 4LG
Not known

Collisions Hit no other vehicle
Back
None
None

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from South West to North East
Waiting to turn right
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Serious

Driver or rider
Male 52
NE33 4LG
Not a car passenger
Not a bus or coach passenger

Vehicle 4

Driver Female, 54
Negative
Postcode: NE35 9DH
Other

Collisions Hit no other vehicle
Front
None
None

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from North East to South West
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 3 - Slight

Driver or rider
Female 54
NE35 9DH
Not a car passenger
Not a bus or coach passenger

Description of Location DEAN ROAD AT JN WITH WEST PARK ROAD

Description of Accident V1, V2 AND V3 WERE TRAVELLING IN A NORTH EAST DIRECTION ON DEAN ROAD, SOUTH SHIELDS APPROACHING THE JUNCTION OF WEST PARK ROAD. V4 WAS TRAVELLING IN A SOUTH WEST DIRECTION ON DEAN ROAD, SOUTH SHIELDS APPROACHING THE JUNCTION OF WEST PARK ROAD. V3 WAS FIRST, FOLLOWED BY V2 AND THEN V1 BEHIND THEM. V3 TOOK POSITION IN THE MIDDLE SECTION OF THE ROAD, MARKED BY WHITE LINES TO TURN RIGHT ONTO WEST PARK ROAD. V2 SWERVED IN THE ROAD, FURTHER INTO THE MIDDLE OF THE LANE, V1 THEN BRAKED AND SWERVED TO

Slight Accident

Involving 3 Vehicle, 3 Casualties

0242536

Location	South Tyneside A 1018 436692E, 566511N	Date/Time	Thursday 23 November 2017 17:42
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (B) Travelling too fast for conditions (B) Failed to judge other person's path or speed (A) Following too close (B)

Vehicle 1

Driver	Female, 19 Not requested Postcode: NE34 7PQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 3 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 20	Not a bus or coach passenger

Vehicle 2

Driver	Female, 31 Not requested Postcode: NE33 4SL Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 31	Not a bus or coach passenger
NE33 4SL	

Vehicle 3

Driver Female, 46
Not requested
Postcode: NE33 2AN
Other

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from South East to North West
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 2 - Slight

Driver or rider
Female 46
NE33 2AN
Not a car passenger
Not a bus or coach passenger

Description of Location WESTOE ROAD A1018 AT JN WITH ROBINSON STREET

Description of Accident V3 STOPPED IN THE STREET IN STATIONARY TRAFFIC, V2 SLOWED AND STOPPED BEHIND V3 AND WAS STATIONARY IN THE ROAD. V1 APPROACHED AND COLLIDED WITH THE REAR OF V2 CAUSING V2 TO JUMP FORWARD AND COLLIDE WITH THE REAR OF V3.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0217842

Location	South Tyneside A 1018 436808E, 566123N	Date/Time	Thursday 07 September 2017 15:30
Road	One way street 30	Junction	Other junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 51 Negative Postcode: NE33 4HS Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 12 Not applicable Postcode: Pupil riding to/from school	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	Cycle Lane (On main carriageway) Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	12	Not a bus or coach passenger

<i>Description of Location</i>	IMEARY STREET A1018 AT JN WITH WEST STEVENSON STREET
<i>Description of Accident</i>	8. V1 IS TRAVELLING NW ALONG IMEARY STREET WHICH IS A ONE WAY STREET WITH A CYCLE LANE. DRIVER TURNS LEFT INTO WEST STEVENSON STREET FAILING TO NOTICE THE CYCLIST TO HIS NEAR SIDE WHO THEN COLLIDES WITH THE NEAR SIDE OF V1. ,

Serious Accident

Involving 1 Vehicle, 1 Casualty

0263165

Location	South Tyneside A 1018 436719E, 566402N	Date/Time	Tuesday 30 January 2018 13:00
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 42 Negative Postcode: NE31 1HY Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Female	74	Crossing from driver's nearside
NE32 5YW		South

Description of Location	IMEARY STREET A1018 AT JN WITH CHICHESTER ROAD B1298

Description of Accident	V1 TRAVELLING WESTBOUND ON WESTOE RD AWAY FROM THE TRAFFIC LIGHT SIGNALS WITH CHICHESTER RD ELDERLY FEMALE PEDESTRAIN STEPS FROM NEAR SIDE PAVEMENT INTO NEAR SIDE FRONT CORNER OF BUS CAUSING INJURIES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0263573

Location	South Tyneside A 185 433927E, 564842N	Date/Time	Wednesday 31 January 2018 18:20
Road	Dual Carriageway 40	Junction	T or staggered junction Give way or uncontrolled C 404
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 29 Negative Postcode: NE32 3PW Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 29 Driver not contacted at time of accident Postcode: NE6 4RA Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	29	Not a bus or coach passenger
NE6 4RA		

***Description
of Location***

STRAKER STREET A185 AT JN WITH CHURCH BANK C404

***Description
of Accident***

APPARENTLY V1 IS WAITING TO TURN RIGHT AT THE CENTRE JUNCTION FROM THE A185 STRAKER STREET UP CHURCH BANK TOWARDS JARROW. ON SEEING AN APPARENT GAP V1 SETS OFF ACROSS THE JUNCTION FAILING TO SEE V2 BEHIND A LEADING CAR AND COLLIDES WITH V2 ON THE REAR NEAR SIDE. RIDER V2 IS THROWN FROM HIS BIKE SUSTAINING MINOR INJURIES.

Slight Accident

Involving 1 Vehicle, 2 Casualties

0267281

Location	South Tyneside A 1018 436620E, 566705N	Date/Time	Monday 05 February 2018 17:55
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 45 Driver not contacted at time of accident Postcode: NE34 6PY Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 35	Standing passenger

Casualty 2 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 9	Standing passenger

Description of Location WESTOE ROAD A1018 NEAR JN WITH ERSKINE ROAD

Description of Accident VEHICLE 1 THE BUS HAS BEEN PULLING INTO A BUS STOP ON WESTOE ROAD SOUTH SHIELDS AND DRIVER HAS TAKEN HIS FOOT OFF THE BRAKE PEDAL WHILST THE BUS HAS BEEN MOVING SLOWLY. A FEMALE AND HER 9 YEAR OLD SON HAVE BEEN STANDING AT THE DOORWAY AT THE FRONT OF THE BUS AND BOTH HAVE STUMBLER CAUSING SLIGHT INJURIES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0261889

Location	South Tyneside	Date/Time	Thursday
	435959E, 564532N		25 January 2018
			13:00
Road	Single Carriageway	Junction	T or staggered junction
	30		Give way or uncontrolled
Conditions	Daylight - Street Lights Present	Contributory	
	Fine without high winds		Buildings, road signs, street furniture (A)
	Dry		Buildings, road signs, street furniture (A)
	None		
	None		
	None within 50 metres		
	No physical crossing facility within 50 metres		

Vehicle 1

Driver	Male, 16	Vehicle	Car
	Driver not contacted at time of accident		No tow or articulation
	Postcode:	Location	On main carriageway - not in restricted lane
	Not known		Approaching junction or waiting/parked at junction exit
Collisions	Hit no other vehicle	Movement	Vehicle moving from East to West
	Nearside		Going ahead other
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

Vehicle 2

Driver	Male, 36	Vehicle	Motorcycle over 50cc and up to 125cc
	Negative		No tow or articulation
	Postcode: NE33 5DR	Location	On main carriageway - not in restricted lane
	Not known		Approaching junction or waiting/parked at junction exit
Collisions	Hit no other vehicle	Movement	Vehicle moving from West to East
	Offside		Turning right
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	36	Not a bus or coach passenger
NE33 5DR		

***Description
of Location***

STODDART STREET NEAR JN WITH BOLDON LANE

***Description
of Accident***

V1 DRIVING ON STODDART STREET AT THE REAR OF BOLDON LANE SHOPS, V2 ENTERS STODDART STREET FROM BOLDON LANE, V1 BEGINS TO TURN LEFT TOWARDS BOLDON LANE AS V2 BEGINS TO TURN RIGHT TOWARDS REAR OF SHOPS ON BOLDON LANE. V1 AND V2 COLLIDE AT A RELATIVELY LOW SPEED, RIDR OF V2 IS KNOCKED ONTO THE ROAD SURFACE AS V1 REVERSES AND DRIVES OFF.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0265255

Location	South Tyneside A 185 433930E, 564838N	Date/Time	Monday 05 February 2018 17:20
Road	Dual Carriageway 40	Junction	T or staggered junction Give way or uncontrolled C 404
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 21 Negative Postcode: NE31 1RH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 61 Negative Postcode: NE34 8TP Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other Overturned Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	61	Not a bus or coach passenger
NE34 8TP		

***Description
of Location***

STRAKER STREET A185 AT JN WITH CHURCH BANK C404

***Description
of Accident***

V1 WAITING AT JUNCTION ON JARROW ROAD TO TURN RIGHT ONTO CHURCH BANK, V2 HEADING ON JARROW ROAD TOWARDS THE JUNCTION WITH CHURCH BANK, TRAFFIC ON JARROW ROAD COMES TO A STOP AND V1 IS BECKONED TO CROSS THROUGH THE GAP ONT CHURCH BANK, AS V1 MOVES OFF DRIVER FAILS TO SEE V2 APPROACHING, V2 CRASHES INTO THE FRONT NEARSIDE OF V1, RIDER OF V2 IS THROWN OVER THE BONNET OF V1 AND LANDS ON THE ROAD SURFACE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0257738

Location	South Tyneside A 194 436216E, 566178N	Date/Time	Friday 12 January 2018 14:00
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 80 Driver not contacted at time of accident Postcode: NE34 7PX Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 50 Driver not contacted at time of accident Postcode: SR6 7LL Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	50	Not a bus or coach passenger
SR6 7LL		

***Description
of Location***

WESTERN APPROACH A194 AT JN WITH LAYGATE B1301

***Description
of Accident***

VEHICLE 1 HAS BEEN FOLLOWING VEHICLE 2 WEST BOUND TOWARDS THE ROUNDABOUT OF WESTERN APPROACH AND LAYGATE VEHICLE 2 IS SLOWING FOR THE ROUNDABOUT,VEHICLE 1 HAS MISJUDGED THE DISTANCE BETWEEN THE TWO VEHICLES AND HAS COLLIDED WITH VEHICLE 2 , FRONT BUMPER TO REAR BUMPER, ONLY SLIGHT DAMAGE IS CAUSED TO VEHICLE 2 DUE TO LOW SPEED OF THE COLLISION. THE DRIVER AND AND PASSENGER OF VEHICLE 2 HAVE BEEN LEFT WITH SORENESS TO THEIR BACKS AND SHOULDERS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0209053

Location	South Tyneside 435567E, 563941N	Date/Time	Monday 07 August 2017 12:15
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 53 Negative Postcode: NE34 9DN Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 48 Negative Postcode: NE32 4JP Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	48	Not a bus or coach passenger
NE32 4JP		

<i>Description of Location</i>	HONEYSUCKLE AVENUE AT JN WITH REDBERRY WAY
<i>Description of Accident</i>	V1 BEING DRIVEN ON REDBERRY WAY FAILS TO GIVE WAY AND OVERSHOTS JUNCTION ONTO HONEYSUCKLE AVE ALLOWING V2 NO TIME TO AVOD COLLISION.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0226912

Location	South Tyneside A 19 433666E, 564129N	Date/Time	Tuesday 05 September 2017 07:50
Road	Slip Road 50	Junction	Slip Road Give way or uncontrolled A 19
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (A) Sudden braking (A) Failed to judge other person's path or speed (B)

Vehicle 1

Driver	Male, 43 Driver not contacted at time of accident Postcode: Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside Kerb None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from South to North Going ahead left hand bend Skidded Left carriageway nearside

Vehicle 2

Driver	Female, 41 Not requested Postcode: Commuting to/from work	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from South to North Going ahead other Skidded Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Female 41	Not a bus or coach passenger

***Description
of Location***

N/A A19 A19 NEAR JN WITH A19 A19

***Description
of Accident***

DRIVER OF VEHICLE 2 TRAVELLING NORTHBOUND IN OUTSIDE LANE ON A19. VEHICLE 1 ALSO TRAVELLING NORTHBOUND IN OUTSIDE LANE AHEAD OF V1. V2 INDICATES AND PULLS LEFT INTO INSIDE LANE INTO SLOWING TO STATIONARY TRAFFIC. V1 INDICATES AND PULLS INTO INSIDE LANE AHEAD OF V2 CAUSING V2 TO BRAKE HARD AND LOOSE CONTROL. RIDER OF V2 (MOTORCYCLE) FALLS FROM VEHICLE CAUSING INJURY. V2 SKIDS ALONG CARRIAGEWAY TO A STOP.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0268644

Location	South Tyneside A 194 434318E, 563917N	Date/Time	Thursday 15 February 2018 11:50
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 27 Not requested Postcode: SO16 7AE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 27	Not a bus or coach passenger
SO16 7AE	

Vehicle 2

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Not traced,
Driver not contacted at time of accident
Postcode:
Not known

Collisions Hit no other vehicle

Front
None
None

Vehicle Goods Vehicle - Unknown Weight
No tow or articulation

Location On main carriageway - not in restricted lane

Not at, or within 20 metres of junction

Movement Vehicle moving from East to West
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

**Description
of Location** NEWCASTLE ROAD A194

**Description
of Accident** V1 WAS DRIVING ALONG ROAD NEWCASTLE ROAD (WESTERLY WHEN IT WAS HIT BY V2 AND V3 CAUSING DAMAGE TO BOTH REAR QUATER PANELS MAKING V1 UNDRIVABLE. V2 AND V3 HAVE THEN MADE OFF FROM THE SCENE NOT EXCHANGING DETAILS. THE DRIVER OF V1 HAD A SMALL CUT TO HIS HAND AS A RESULT OF THE INCIDENT '

Slight Accident

Involving 1 Vehicle, 1 Casualty

0270145

Location	South Tyneside A 1300 437492E, 564494N	Date/Time	Tuesday 20 February 2018 11:41
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 24 Negative Postcode: NE32 4BU Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		On footway or verge
Female	75	Walking along in carriageway - facing traffic
NE32 3PW		West

Description of Location	PRINCE EDWARD ROAD A1300 NEAR JN WITH KING GEORGE RD A1018

Description of Accident	PEDESTRIAN RAN TO CATCH THE BUS (VEHICLE 1) WHICH WAS STATIONARY AT BUS STOP. BUS STARTS TO PULL AWAY FROM BUS STOP AND WHILE STILL RUNNING PEDESTRIAN TRIPS FALLING INTO THE PATH OF THE BUS HITTING HEAD OFF THE BUS CAUSING SMALL CUT TO LEFT SIDE OF HER EYE. INJURY NOT LIFE THREATENING PEDESTRIAN TAKEN TO STGH TO BE CHECKED OVER

Serious Accident

Involving 2 Vehicle, 1 Casualty

0279849

Location	South Tyneside A 1300 437409E, 564294N	Date/Time	Monday 26 March 2018 12:48
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Defective brakes (B) Exceeding speed limit (A) Junction overshoot (A) Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 38 Negative Postcode: NE34 7NJ Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Slowing or stopping Skidded Did not leave carriageway

Vehicle 2

Driver	Male, 42 Not requested Postcode: SR5 4EG Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Vehicle or pillion passenger	Not a car passenger
Female 79	Seated passenger
NE34 8BS	

***Description
of Location***

JOHN REID ROAD A1300 AT JN WITH A1018

***Description
of Accident***

V1 WAS TRAVELLING EAST ON JOHN REID ROAD APPROACHING ROUNDABOUT WITH KING GEORGE ROAD. V2 WAS TRAVELLING WEST ON PRINCE EDWARD ROAD AND TURNING RIGHT AT THE ROUNDABOUT TOWARD KING GEORGE ROAD. WHILST V2 WAS ON THE ROUNDABOUT V1 WAS UNABLE TO STOP AND COLLIDED WITH THE SIDE OF V1.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0282531

Location	South Tyneside C 406 435646E, 563922N	Date/Time	Friday 30 March 2018 17:25
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Other Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Not applicable Postcode: Not known	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 40 Driver not contacted at time of accident Postcode: NE37 3DE Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 51	Not a bus or coach passenger
NE34 8JE	

***Description
of Location***

GREEN LANE C406

***Description
of Accident***

VEHICLE 2 HAS COME TO A HALT BEHIND VEHICLE 1 AND WAS STATIONARY WHEN VEHICLE 1 HAS REVERSED INTO VEHICLE 2. THE DRIVERS APPARENTLY STOPPED AT THE TIME BUT THERE WAS NO DAMAGE SO NO DETAILS WERE EXCHANGED. A PASSENGER IN THE TAXI VEHICLE H2 DAYS LATER STATED THAT SHE HAD A SORE SHOULDER. TAXI DRIVER HAS THEN GIVEN HIS DETAILS. HOWEVER NO DETAILS KNOWN OF V1.

Slight Accident

Involving 1 Vehicle, 2 Casualties

0286332

Location	South Tyneside A 1300 436643E, 563947N	Date/Time	Friday 20 April 2018 10:00
Road	Dual Carriageway 60	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 44 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Vehicle or pillion passenger	Rear seat passenger
Female 0	Not a bus or coach passenger
NE34 0BW	

Casualty 1 - Slight

Vehicle or pillion passenger	Rear seat passenger
Female 22	Not a bus or coach passenger
NE34 0BW	

**Description
of Location** JOHN REID ROAD A1300

**Description
of Accident** VEHICLE 1 = PEUGEOT BLACK ON THE 20TH APRIL 2018 AT 1000 HOURS CASUALTY HAS BEEN TRAVELLING WITH HER 5 MONTH OLD BABY IN THE REAR OF VEHICLE 1 ALONG JOHN REID ROAD, SOUTH SHIELDS WHEN THE WHEEL HAS COME OFF THE VEHICLE CAUSING THE VEHICLE TO HIT THE CURB. THE DRIVER HAS MADE SURE THAT ALL PARTIES WERE OK AT THE TIME OF THE COLLISION TO WHICH THEY SAID THEY WERE HOWEVER LATER THAT DAY CASUALTY HAS ATTENDED SOUTH TYNESIDE HOSPITAL AND THE DOCTORS HAVE STATED THAT HER AND THE BABY HAVE WHIPLASH.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0207427

Location	South Tyneside A 1300 437492E, 564298N	Date/Time	Wednesday 02 August 2017 13:20
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 70 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 34 Driver not contacted at time of accident Postcode: NE34 7QW Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	34	Not a bus or coach passenger
NE34 7QW		

***Description
of Location***

PRINCE EDWARD ROAD A1300 NEAR JN WITH JOHN REID ROAD A1300

***Description
of Accident***

V2 STATIONARY FACING WEST BEHIND APPROX TWO CARS FROM JUNCTION IN THE INSIDE LANE INTENDING TO TURN SOUTH WEST AT THE ROUNDABOUT ON TO JOHN REID ROAD. V1 TRAVELLING BEHIND. V1 ATTEMPTED TO CROSS IN TO LANE TWO, HOWEVER, MISJUDGED THE MANOEUVRE AND V1 FRONT NEARSIDE COLLIDED WITH V2'S REAR OFFSIDE. V1 INITIALLY FAILED TO STOP, BUT AFTER V2 FOLLOWED THE CAR TO TEMPLE PARK ROAD AND FLASHED LIGHTS AT DRIVER, HE INDICATED TO PULL OVER. MALE DRIVER OF V1 ALIGHTED FROM VEHICLE AND LOOKED AT THE DAMAG

Serious Accident

Involving 2 Vehicle, 1 Casualty

0256719

Location	South Tyneside A 194 433835E, 563601N	Date/Time	Monday 04 September 2017 14:25
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Sudden braking (A) Unfamiliar with model of vehicle (A)

Vehicle 1

Driver	Not traced, Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to North East Going ahead left hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Serious

Driver or rider	Not a car passenger
Not Traced	Not a bus or coach passenger

Vehicle 2

Driver	Female, 56 Negative Postcode: DH4 4XG Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to North East Going ahead left hand bend No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

LEAM LANE A194 NEAR JN WITH LINDISFARNE ROUNDABOUT A19

***Description
of Accident***

BOTH V1 AND V2 HAVE LEFT THE ROUNDABOUT AT LINDISFARNE TRAVELLING NORTH ON THE A194 LEAM LANE, DRIVER OF V2 WAS IN FRONT, V1 BEHIND. V2 DRIVERS FOOT HAS SLIPPED OFF THE ACCELERATOR AND ONTO THE BRAKE CAUSING HER TO PERFORM AN EMERGENCY STOP AS IT IS AN AUTOMATIC. V1 HAS THEN BEEN UNABLE TO STOP AND DROVE INTO THE REAR OF V2. DRIVER OF V2 HAS NO INJURIES, DRIVER OF V1 HAS INJURIES TO HER RIGHT ARM AND HAS GONE TO HOSPITAL, TAKEN BY A FRIEND. NO FURTHER POLICE ACTION AT THIS TIME.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0288251

Location	South Tyneside 437245E, 565483N	Date/Time	Sunday 01 April 2018 06:55
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from East to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 46 Driver not contacted at time of accident Postcode: NE34 7JG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	46	Not a bus or coach passenger
NE34 7JG		

***Description
of Location***

SUNDERLAND ROAD AT JN WITH A1018

***Description
of Accident***

FWIN 1225 27/04/18 V2 HAS BEEN ON SUNDERLAND ROAD APPROACHING THE ROUNDABOUT V1 HAS COLLIDED WITH THE OFFSIDE OF V2 CAUSING DAMAGE AND INJURY (MINOR) TO DRIVER OF V2. BOTH VEHICLES STOPPED DETAILS WERE EXCHANGED

Slight Accident

Involving 2 Vehicle, 1 Casualty

0289311

Location	South Tyneside A 1018 436993E, 565899N	Date/Time	Monday 30 April 2018 12:26
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None Control by other authorised person Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Female, 49 Driver not contacted at time of accident Postcode: NE34 0TQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Changing lane to right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 61 Driver not contacted at time of accident Postcode: NE34 0SX Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside and rebounded

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 61	Not a bus or coach passenger
NE34 0SX	

<i>Description of Location</i>	SUNDERLAND ROAD A1018
<i>Description of Accident</i>	V2 TRAVELING NORTH ON A 1018 SUNDERLAND ROAD SOUTH SHIELDS SOUTH TYNESIDE IN THE INSIDE LANE. V1 MERGES FRM THE RIGHT (OUTSIDE LANE) AND COLLIDES WITH V2 CAUSING DAMAGE TO R/O/S WHEEL ARCH WHEEL AND R/O/S QUARTER PANEL F/O/S WHEEL ARCH WHEEL AND WING DENTS SCRATCHES AND SCUFFS TO PIANTWORK. V1 HAS FORCED V2 ONTO THE CURB CAUSING DAMAGE TO F/N/S WHEEL. DRIVER OF V2 RECEIVED WHIPLASH INJURIES. ALL DETAILS EXCHANGED AT SCENE.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0269782

Location	South Tyneside B 1298 435941E, 564499N	Date/Time	Monday 19 February 2018 15:39
Road	Unknown 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Dangerous action in carriageway (eg. playing) (A)

Vehicle 1

Driver	Male, 19 Negative Postcode: NE34 8DE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Male	4	Crossing from driver's nearside
NE33 2AQ		East

Description of Location	O/S LIDL BOLDON LANE B1298

Description of Accident	IT APPEARS THAT VEH 1 HAS BEEN EXITING THE CARPARK AND AS THEY HAVE DRIVEN PAST THE STORE ENTRANCE,THE IP WHO WAS PART OF A GROUP HAS RAN INTO THE ROAD AND BEEN STRUCK BY VEH 1, RESULTING IN IP BEING DRAGGED ALONG THE ROAD,THEN VEHICLE GOING OVER THE TOP OF IP.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0291094

Location	South Tyneside A 1018 437451E, 564217N	Date/Time	Tuesday 08 May 2018 15:00
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 26 Not requested Postcode: NE33 5QD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 41 Not requested Postcode: SR5 4LP Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	41	Not a bus or coach passenger
SR5 4LP		

***Description
of Location***

KING GEORGE ROAD A1018 NEAR JN WITH JOHN REID ROAD, SOUTH SHIELDS A1300

***Description
of Accident***

VEHICLE 2 SLOWS COMING TO A STOP DUE TO TRAFFIC HELD UP IN FRONT, V1 FAILS TO STOP IN TIME IMPACTING IN REAR OF V2.

Serious Accident

Involving 1 Vehicle, 2 Casualties

0282750

Location	South Tyneside 435715E, 564192N	Date/Time	Saturday 07 April 2018 12:20
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Impaired by drugs (illicit or medicinal) (A)

Vehicle 1

Driver	Male, 22 Positive Postcode: NE34 0BT Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Female	55	Crossing from driver's nearside
NE34 0BE		North East

Casualty 2 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	48	Crossing from driver's nearside
NE34 0BE		North East

Description of Location MARIGOLD WALK NEAR JN WITH ORCHID CLOSE

Description of Accident BOTH PEDESTRIANS WERE CROSSING MARIGOLD WALK. V1 WAS REVERSING AND HAS COLLIDED WITH BOTH PEDESTRIANS.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0291035

Location	South Tyneside A 1300 434691E, 563580N	Date/Time	Thursday 03 May 2018 22:17
Road	Dual Carriageway 40	Junction	Crossroads Automatic traffic signal
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Male, 23 Negative Postcode: SR6 7BQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	27	Crossing from driver's offside
NE32 4HN		East

Description of Location JOHN REID ROAD A1300 AT JN WITH WINSKELL ROAD

Description of Accident APPARENTLY PEDESTRIAN CASUALTY HAS RAN FROM CENTRAL REFUGE ACROSS PATH OF V1 WHICH WAS PASSING THROUGH A GREEN AUTOMATED TRAFFIC SIGNAL.

Slight Accident

Involving 3 Vehicle, 3 Casualties

0291011

Location	South Tyneside A 194 435233E, 564778N	Date/Time	Monday 07 May 2018 13:46
Road	Dual Carriageway 30	Junction	Mini roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 49 Negative Postcode: DH7 6HU Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from East to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 36 Negative Postcode: NE33 5SX Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from East to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	36	Not a bus or coach passenger
NE33 5SX		

Vehicle 3

Driver Female, 25
Negative
Postcode: NE34 9EZ
Other

Vehicle Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under
No tow or articulation

Location On main carriageway - not in restricted lane
Leaving roundabout

Collisions Hit no other vehicle
Back
None
None

Movement Vehicle moving from East to South East
Turning right
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 3 - Slight

Driver or rider
Female 25
NE34 9EZ

Not a car passenger
Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger
Female 33
NE34 9EZ

Not a car passenger
Not a bus or coach passenger

Description of Location NEWCASTLE ROAD A194 AT JN WITH JARROW ROAD A194

Description of Accident IT APPEARS VEH 1 HAS EXITED THE ROUNDABOUT IN THE . WRONG LANE,ATTEMPTED TO MOVE LEFT INTO THE CORRECT LANE,COLLIDING INTO VEH 2 WHICH HAS BEEN PUSHED INTO VEH 1

Slight Accident

Involving 2 Vehicle, 1 Casualty

0292181

Location	South Tyneside 436277E, 564965N	Date/Time	Friday 11 May 2018 13:29
Road	One way street 20	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, Driver not contacted at time of accident Postcode: NE34 9AF Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 27 Driver not contacted at time of accident Postcode: NE33 5PR Commuting to/from work	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	27	Not a bus or coach passenger
NE33 5PR		

***Description
of Location***

ROAD TO THE REAR OF STANHOPE STREET

***Description
of Accident***

MOTOR CYCLE RIDER - V2 WAS TRAVELLING IN A NORTH EASTERLY DIRECTION BEHIND V1. THE DRIVER OF V1 STOPPED HER CAR AND BEGAN REVERSING TOWARDS A PARKING BAY, V2 BEEPED TO INDICATE TO V1 THAT SHE WAS THERE, V1 CONTINUED TO REVERSE COLLIDING WITH V2 CAUSING DAMAGE TO MOTOR BIKE AND INJURY TO RIDER. DRIVER OF V1 WAITED A WHILE BEFORE LEAVING THE SCENE WHEN V2 PARTNER ARRIVED. RIDER OF V2 HAD THE VRM DETAILS OF V1, BEFORE SHE LEFT THE SCENE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0273937

Location	South Tyneside B 1298 436016E, 564663N	Date/Time	Tuesday 06 March 2018 08:50
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 42 Not provided (medical reasons) Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 42	Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 40	Not a bus or coach passenger

Vehicle 2

Driver	Not traced, 40 Refused to provide Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

*Description
of Location*

OPPOSITE PREMIER STORES STANHOPE ROAD B1298 NEAR JN WITH GARRICK SREET

*Description
of Accident*

VEHICLE 1 HAS BEEN DRIVING ALONG STANHOPE ROAD, TOWARDS BOLDON LANE. VEHICLE 2 HAS PULLED OUT OF THE JUNCTION AT OLIVE STREET AT SPEED AND COLLIDED WITH THE FRONT END OF VEHICLE 1. UPON COLLIDING WITH VEHICLE 1 VEHICLE 2 HAS MADE OFF FROM SCENE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0293096

Location	South Tyneside A 1300 436741E, 564005N	Date/Time	Tuesday 15 May 2018 10:50
Road	Dual Carriageway 40	Junction	T or staggered junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 49 Negative Postcode: TS27 4ED Journey as part of work	Vehicle	Goods vehicle 7.5 tonnes mgw and over No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 63 Not provided (medical reasons) Postcode: NE34 0HH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	63	Not a bus or coach passenger
NE34 0HH		

***Description
of Location***

JOHN REID ROAD A1300 AT JN WITH SOUTH TYNESIDE GENERAL HOSPITAL

***Description
of Accident***

VEH 2 IN NEAR SIDE LANE OF JOHN REID ROAD STOPPING FOR A TRAFFIC LIGHT CHANGING FROM GREEN TO AMBER. VEH 1 PRESENT IN OUTSIDE LANE WHEN VEHICLE IN FRONT STOPPED . VEH 1 TAKES AVOIDING ACTION MOVING TO NEAR SIDE LANE COLLIDING WITH THE REAR OF VEH 2 CAUSING DAMAGE AND MINOR INJURY.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0294301

Location	South Tyneside B 1298 435964E, 564207N	Date/Time	Friday 11 May 2018 17:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 50 Driver not contacted at time of accident Postcode: NE8 3PR Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 46	Boarding
NE34 8HT	

Description of Location	MAXWELLS DIY BOLDON LANE B1298 NEAR JN WITH HARTON LANE

Description of Accident	LOG STATES FEMALE CONTACTED BUS COMPANY STATING SHE HAD FALLEN ON THE BUS CAUSING INJURY TO HER BACK AS THE BUS SET OFF BEFORE SHE MANAGED TO SIT DOWN. DRIVER WAS UNAWARE OF THE INCIDENT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0297283

Location	South Tyneside A 194 435928E, 565527N	Date/Time	Tuesday 29 May 2018 22:45
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled C 407
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 34 Driver not contacted at time of accident Postcode: DH4 5JZ Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North East to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 38 Driver not contacted at time of accident Postcode: NE33 4AR Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	38	Not a bus or coach passenger
NE33 4AR		

***Description
of Location***

WESTERN APPROACH A194 AT JN WITH BARNES ROAD C407

***Description
of Accident***

V2 HAS BEEN GOING AROUND ROUNDABOUT. V1 HAS ENTERED THE ROUNDABOUT WITHOUT ENSURING IT IS CLEAR AND CLIPPED THE REAR TYRE OF V2.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0301030

Location	South Tyneside A 194 434009E, 563697N	Date/Time	Wednesday 13 June 2018 09:51
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 61 Negative Postcode: NE33 4SY Not known	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 61	Not a bus or coach passenger
NE33 4SY	

Vehicle 2

Driver	Male, 47 Negative Postcode: SR3 1HN Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Parked No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

NEWCASTLE ROAD A194

***Description
of Accident***

V1 HEADING WEST IN LANE 2 ON THE A194 NEWCASTLE ROAD HEADING TOWARDS LINDISFARNE ROUNDABOUT. V2 IS STATIONARY IN LANE 1 IN A LINE OF TRAFFIC HELD AT A RED LIGHT AT LINDISFARNE ROUNDABOUT. V1 RIDER DECIDES TO MOVE ACROSS INTO LANE 1 JUST AS A VEHICLE IN FRONT DOES THE SAME, INSTEAD OF BRAKING RIDER OF V1 ACCELERATES PAST THE NEARSIDE OF THIS VEHICLE AND, UNAWARE OF THE STATIONARY VEHICLES IN LANE 1, CRASHES INTO THE REAR OF V2.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0306361

Location	South Tyneside A 1300 436159E, 563775N	Date/Time	Tuesday 26 June 2018 16:24
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 21 Negative Postcode: NE7 7QH Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 75 Not provided (medical reasons) Postcode: NE33 2NP Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	75	Not a bus or coach passenger
NE33 2NP		

Casualty 2 - Slight

Vehicle or pillion passenger

Female 79

NE34 9ST

Rear seat passenger

Not a bus or coach passenger

Description of Location

JOHN REID ROAD A1300

Description of Accident

V1 HAS BEEN TRAVELLING WEST ON A1300 JOHN REID ROAD APPROACHING ROUNDABOUT WITH WHITE LEAS WAY. V2 HAS BEEN SLOWING TO STOP AT THE ROUNDABOUT WHEN V1 HAS FAILED TO LOOK AHEAD AND HAS COLLIDED WITH THE REAR OF V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0253871

Location	South Tyneside A 194 435534E, 565010N	Date/Time	Wednesday 03 January 2018 05:40
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled B 1302
Conditions	Darkness - Street Lights present and lit Raining with high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (A) Slippery road (due to weather) (B) Buildings, road signs, street furniture (B)

Vehicle 1

Driver	Male, 49 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 43 Not applicable Postcode: NE34 8HN Commuting to/from work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	43	Not a bus or coach passenger
NE34 8HN		

***Description
of Location***

A194 AT JN WITH B1302

***Description
of Accident***

VEHICLE 2 WAS TRAVELLING NORTH ALONG THE B1302 APPROACHING THE ROUNDABOUT AT THE JUNCTION WITH THE A194 AND THE PORT OF TYNE. VEHICLE 1 WAS TRAVELLING EAST ALONG THE A194 APPROACHING THE ROUNDABOUT WITH THE B1302. VEHICLE 2 ENTERED THE ROUNDABOUT TO TAKE THE SECOND EXIT INTO THE PORT OF TYNE. VEHICLE 1 WAS IN THE MIDDLE LANE OF THREE TO TAKE THEIR SECOND EXIT, STRAIGHT ON ON THE A194. VEHICLE 1 DID NOT STOP AT THE ROUNDABOUT AND WENT INTO THE ROUNDABOUT COLLIDING WITH VEHICLE 2. PERSON 2 CAME O

Slight Accident

Involving 4 Vehicle, 2 Casualties

0305946

Location	South Tyneside A 194 433913E, 563629N	Date/Time	Thursday 28 June 2018 16:22
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 21 Negative Postcode: NE32 4AS Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male 21	Not a bus or coach passenger
NE32 4AS	

Vehicle 2

Driver	Male, 42 Negative Postcode: NE34 6HG Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 42	Not a bus or coach passenger
NE34 6HG	

Vehicle 3

Driver	Male, 51
	Negative
	Postcode: DH4 6EU
	Other
Collisions	Hit no other vehicle
	Back
	None
	None

Vehicle	Car
	No tow or articulation
Location	On main carriageway - not in restricted lane
	Not at, or within 20 metres of junction
Movement	Vehicle moving from East to West
	Slowing or stopping
	No skidding, jack-knifing or overturning
	Did not leave carriageway

Vehicle 4

Driver	Female, 71
	Negative
	Postcode: NE32 5EW
	Other
Collisions	Hit no other vehicle
	Back
	None
	None

Vehicle	Car
	No tow or articulation
Location	On main carriageway - not in restricted lane
	Not at, or within 20 metres of junction
Movement	Vehicle moving from East to West
	Slowing or stopping
	No skidding, jack-knifing or overturning
	Did not leave carriageway

Description of Location LEAM LANE A194 NEAR JN WITH A19

Description of Accident VEH1, VEH2, VEH3 AND VEH4 TRAVELLED WESTBOUND ALONG A194 LEAM LANE DUAL CARRIAGEWAY. ALL 4 VEHICLES WERE IN LANE 2. VEH4 (MERCEDES) BRAKES AS STATIONARY TRAFFIC IN FRONT., VEH3 (DACIA) SLOWS BEHIND VEH4, VEH2 (PEUGEOT SD62GYK) SLOWS BEHIND VEH3. VEH1 (PEUGEOT MJ12FOG) COLLIDES INTO REAR OF VEH3 SHUNTING VEH3 FORWARD AND UNDER REAR OF VEH2 WHICH IS THEN SHUNTED FORWARD COLLIDING WITH VEH4. DRIVERS OF VEH1 AND VEH2 REPORT MINOR SOFT TISSUE INJURIES AT SCENE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0308256

Location	South Tyneside	Date/Time	Friday
	435562E, 563948N		06 July 2018
			12:50
Road	Single Carriageway	Junction	Crossroads
	30		Give way or uncontrolled
Conditions	Daylight - Street Lights Present	Contributory	
	Fine without high winds		Loss of Control (A)
	Dry		
	None		
	None		
	None within 50 metres		
	No physical crossing facility within 50 metres		

Vehicle 1

Driver	Female, 24	Vehicle	Car
	Negative		No tow or articulation
	Postcode: NE34 0BZ	Location	On main carriageway - not in restricted lane
	Other		Approaching junction or waiting/parked at junction exit
Collisions	Hit no other vehicle	Movement	Vehicle moving from North East to South West
	Front		Going ahead other
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 24	Not a bus or coach passenger
NE34 0BZ	

Vehicle 2

Driver	Not traced,	Vehicle	Motorcycle - Unknown cc
	Driver not contacted at time of accident		No tow or articulation
	Postcode:	Location	On main carriageway - not in restricted lane
	Not known		Cleared junction or waiting/parked at junction exit
Collisions	Hit no other vehicle	Movement	Vehicle moving from South West to North East
	Front		Going ahead right hand bend
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

<i>Description of Location</i>	HONEYSUCKLE AVENUE NEAR JN WITH REDBERRY WAY
<i>Description of Accident</i>	V2 TRAVELLING SOUTH WEST ON HONEYSUCKLE AVENUE. V1 UNKNOWN MOTORCYCLE TRAVELLING IN OPPOSITE DIRECTION COLLIDES WITH FRONT OF V1. UNKNOWN RIDER THEN MAKES OFF WITH V1.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0308360

Location	South Tyneside A 194 435104E, 564585N	Date/Time	Saturday 07 July 2018 17:33
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Travelling too fast for conditions (A) Stolen Vehicle (A)

Vehicle 1

Driver	Male, 31 Positive Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 48 Not requested Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	48	Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male

37

Not a bus or coach passenger

Description of Location

A194

Description of Accident

VEHICLE 1 HAD BEEN REPORTED STOLEN AND HAD SUBSEQUENTLY MADE OFF FROM POLICE. DURING THE PURSUIT VEH 1 HAS COLLIDED WITH THE REAR OF VEH 2 RESULTING IN MINOR INJURIES TO THE OCCUPANTS OF VEH 1.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0310564

Location	South Tyneside A 1018 436677E, 566585N	Date/Time	Monday 16 July 2018 15:40
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Illness or disability, mental or physical (A)

Vehicle 1

Driver	Male, 57 Negative Postcode: NE33 2PF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Other permanent object	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 57	Not a bus or coach passenger
NE33 2PF	

Description of Location	WESTOE ROAD A1018 AT JN WITH WHARTON STREET
Description of Accident	VEH 1 DRIVING WEST ON WESTOE ROAD SOUTH SHIELDS DRIVER VEH 1 HAS MEDICAL EPISODE AT THE WHEEL CAUSING VEHICLE TO ENTER NEARSIDE PAVEMENT CAUSING DAMAGE TO STREET FURNITURE AND VEHICLE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0297567

Location	South Tyneside A 194 436194E, 566200N	Date/Time	Tuesday 29 May 2018 20:30
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (B) Failed to look properly (B)

Vehicle 1

Driver	Male, 19 Not requested Postcode: Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 19	Not a bus or coach passenger

Vehicle 2

Driver	Female, 43 Not requested Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

WESTERN APPROACH A194 AT JN WITH LAYGATE B1301

***Description
of Accident***

VEHICLE 1 AND VEHICLE 2 TRAVELLING ROUND THE ROUND ABOUT WHEN VEHICLES AVE COLLIDED WHEN EXITING AT THE SAME
EXIT

Slight Accident

Involving 1 Vehicle, 1 Casualty

0311665

Location	South Tyneside B 1298 435970E, 564267N	Date/Time	Monday 09 July 2018 11:55
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (B) Failed to look properly (B)

Vehicle 1

Driver	Male, 20 Driver not contacted at time of accident Postcode: SR1 2BX Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In centre of carriageway, not on refuge, central island or central reservation
Female 64	Crossing from driver's offside
NE34 0NW	West

Description of Location	BOLDON LANE B1298 NEAR JN WITH TYNE TERRACE

Description of Accident	VEHICLE 1 TRAVELS NORTH ON BOLDON LANE. AS VEHICLE DRIVES TOWARDS CENTRAL PEDESTRIAN REFUGE THE PEDESTRIAN CROSSES FROM VEHICLE 1'S OFFSIDE. VEHICLE 1 COLLIDES WITH PEDESTRIAN KNOCKING HER TO THE GROUND. DRIVER OF VEHICLE 1 FAILS TO STOP AND DRIVES OFF.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0316614

Location	South Tyneside B 1298 436509E, 565911N	Date/Time	Monday 06 August 2018 16:00
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Not traced, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	44	Unknown or other
		Unknown

Description of Location CHICHESTER ROAD B1298

Description of Accident PEDESTRIAN1 CROSSING ZEBRA CROSSING WHEN V1 REVERSES INTO THEM CAUSING INJURY THEN DRIVES OFF WITHOUT EXCHANGING DETAILS WITH PEDESTRIAN 1

Slight Accident

Involving 2 Vehicle, 2 Casualties

0310213

Location	South Tyneside B 1298 435993E, 564050N	Date/Time	Monday 09 July 2018 15:10
Road	Roundabout 30	Junction	Mini roundabout Give way or uncontrolled C 406
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (B)

Vehicle 1

Driver	Female, 32 Negative Postcode: NE32 4TH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider		Not a car passenger
Female	32	Not a bus or coach passenger
NE32 4TH		

Vehicle 2

Driver	Male, 40 Negative Postcode: DL15 8NS Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	40	Not a bus or coach passenger
DL15 8NS		

***Description
of Location***

BOLDON LANE B1298 AT JN WITH GREEN LANE C406

***Description
of Accident***

VEHICLE 1 WAS TRAVELLING NORTHBOUND ON BOLDON LANE TOWARDS THE ROUNDABOUT JUNCTION WITH GREEN LANE.
VEHICLE 2 WAS TRAVELLING SOUTH BOUND ON BOLDON LANE TOWARDS THE ROUNDABOUT JUNCTION WITH GREEN LANE.
BOTH VEHICLES HAVE ENTERED THE ROUNDABOUT AND FOR REASONS UNKNOWN HAVE COLLIDED WITH EACH OTHER

Slight Accident

Involving 2 Vehicle, 1 Casualty

0271009

Location	South Tyneside B 1301 436187E, 566203N	Date/Time	Sunday 18 February 2018 17:00
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 35 Not applicable Postcode: Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South East to North West Waiting to turn right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	35	Not a bus or coach passenger

***Description
of Location***

LAYGATE B1301 AT JN WITH LAYGATE

***Description
of Accident***

V2 CYCLIST TRAVELLING NORTH FROM B1301.V1 TRAVELLING SOUTH EAST ON LAYGATE ENTERS ROUNDABOUT HEADING TOWARD B1301.V1 FAILS TO GIVE WAY TO V2 COLLIDING WITH VEHICLE CAUSING RIDER TO FALL OFF.V1 FAILS TO STOP FAILS TO REPORT COLLISION.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0322969

Location	South Tyneside C 407 436163E, 565610N	Date/Time	Wednesday 29 August 2018 16:35
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 20 Driver not contacted at time of accident Postcode: Not known	Vehicle	Motorcycle - Unknown cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Overtaking moving vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Female 17	Crossing from driver's nearside
	North

Description of Location	DEAN ROAD C407 NEAR JN WITH WEST PARK ROAD

Description of Accident	P1 WAS CROSSING ROAD AFTER GETTING OF BUS THEN WALKED IN FRONT OF BUS INTO PATH OF V1 AN UNKNOWN MOTORCYCLE KNOCKING HER OVER. V1 FAILED TO STOP AND MADE OFF FROM SCENE. P1 LATER ATTENDED HOSPITAL AND HAS BRUISING TO HER BACK.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0323023

Location	South Tyneside C 406 435592E, 563893N	Date/Time	Thursday 23 August 2018 14:40
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 46 Not requested Postcode: NE34 0BZ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 18 Driver not contacted at time of accident Postcode: NE34 0PQ Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	18	Not a bus or coach passenger
NE34 0PQ		

***Description
of Location***

GREEN LANE C406 AT JN WITH HONEYSUCKLE AVENUE

***Description
of Accident***

V1 HAS BEEN TRAVELLING ALONG GREEN LANE. V1 HAS TURNED RIGHT ACROSS LINE OF TRAFFIC AND COLLIDED WITH V2 WHICH WAS TRAVELLING IN OPPOSITE DIRECTION.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0324441

Location	South Tyneside A 194 435207E, 564722N	Date/Time	Tuesday 04 September 2018 15:10
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 55 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 55	Not a bus or coach passenger

Vehicle 2

Driver	Male, 37 Driver not contacted at time of accident Postcode: NE34 8HT Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 2 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 30	Not a bus or coach passenger
NE34 8HT	

***Description
of Location***

NEWCASTLE ROAD A194

***Description
of Accident***

VEHICLE 2 WAS TRAVELLING WESTBOUND ON THE A194 NEWCASTLE ROAD WHEN VEHICLE 1 HAS PULLED ACROSS FROM THE RIGHT LANE INTO THE LEFT LANE FORCING VEHICLE 2 INTO A KERB CAUSING MINOR INJURY TO BOT THE DRIVER AND PASSENGER OF VEHICLE 2

Slight Accident

Involving 2 Vehicle, 1 Casualty

0325394

Location	South Tyneside 435598E, 564936N	Date/Time	Friday 07 September 2018 18:00
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 15 Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 15	Not a bus or coach passenger

Vehicle 2

Driver	Female, 19 Driver not contacted at time of accident Postcode: NE36 0JA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

HUDSON STREET

***Description
of Accident***

VEHICLE 1 WHICH IS A CYCLIST DROVE ACROSS THE ROAD WITHOUT LOOKING AND COLLIDED WITH VEHICLE 2. THE CYCLIST FELL OFF HIS BIKE BUT GOT UP AND APOLOGISED TO DRIVER OF VEHICLE 2 AND ROAD OFF WITHOUT EXCHANGING DETAILS

Serious Accident

Involving 2 Vehicle, 1 Casualty

0312833

Location	South Tyneside 434916E, 563503N	Date/Time	Sunday 22 July 2018 11:47
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 29 Negative Postcode: NE32 4HS Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 26 Negative Postcode: NE34 9HB Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other Skidded Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	26	Not a bus or coach passenger
NE34 9HB		

***Description
of Location***

WINSKELL ROAD AT JN WITH WINSKELL ROAD

***Description
of Accident***

V1 WAS TRAVELLING IN AN EASTERLY DIRECTION ALONG WINSKELL ROAD TOWARDS A T JUNCTION. V2 WAS TRAVELLING IN A WESTERLY DIRECTION ALONG WINSKELL ROAD TOWARDS THE SAME JUNCTION. V1 HAS PULLED OUT OF JUNCTION AND COLLIDED WITH V2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0266557

Location	South Tyneside B 1298 436507E, 565918N	Date/Time	Thursday 08 February 2018 18:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Female, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 52 Driver not contacted at time of accident Postcode: NE33 2BA Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	52	Not a bus or coach passenger
NE33 2BA		

***Description
of Location***

CHICHESTER ROAD B1298

***Description
of Accident***

VEHICLE 2 WAS STATIONARY WAITING TO GO AHEAD WHEN VEHICLE 1 HAS COLLIDED WITH THE REAR OF VEHICLE 2. INITIALLY THE DRIVER OF VEHICLE 1 PROVIDED DRIVER 2 WITH A CONTACT NUMBER HOWEVER SINCE THE COLLISION HAS FAILED TO PROVIDE ALL RELEVANT DETAILS SUCH AS NAME/REGISTRATION AND INSURANCE DETAILS.

Serious Accident

Involving 3 Vehicle, 1 Casualty

0286350

Location	South Tyneside A 19 433617E, 564428N	Date/Time	Wednesday 18 April 2018 18:15
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None Other object in carriageway None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A) Aggressive driving (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 39 Driver not contacted at time of accident Postcode: DH7 6AG Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 24 Negative Postcode: NE31 1BY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 32
Negative
Postcode: NE6 3BQ
Commuting to/from work

Vehicle Motorcycle over 50cc and up to 125cc
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Front
Other object
None

Movement Vehicle moving from South to North
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Serious

Driver or rider
Male 32
NE6 3BQ
Not a car passenger
Not a bus or coach passenger

Description of Location A19 (A19) 574 METRES SOUTH OF JUNCTION WITH A185 (A185)

Description of Accident V1 TRAVELLING AT SPEED IN LANE 2 HEADING NORTH TOWARDS TYNE TUNNEL ON THE A19 APPROACHES THE REAR OF V2 ALSO TRAVELLING IN LANE 2. V1 MOVES ACROSS FROM LANE 2 INTO LANE 1 AND PERFORMS HIGH SPEED UNDERTAKE CUTTING BACK ACROSS FROM LANE 1 INTO LANE 2 BEFORE BRAKING HEAVILY. DUE TO THE ACTIONS OF V1, V2 SWERVES ACROSS FROM LANE 2 INTO LANE 1 BRAKING HEAVILY. V3 ALREADY TRAVELLING IN LANE 1 ATTEMPTS TO BRAKE, HOWEVER FAILS TO STOP DUE TO DISTANCE AND COLLIDES WITH V2. V1 CONTINUES FROM SCENE AT SP

Slight Accident

Involving 2 Vehicle, 1 Casualty

0311345

Location	South Tyneside 435937E, 565931N	Date/Time	Wednesday 18 July 2018 17:15
Road	Single Carriageway 30	Junction	Crossroads Authorised Person
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Junction restart (moving off at junction) (A)

Vehicle 1

Driver	Female, 23 Negative Postcode: NE34 9HA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 35 Negative Postcode: NE33 2PB Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	35	Not a bus or coach passenger
NE33 2PB		

***Description
of Location***

REED STREET AT JN WITH ELDON STREET

***Description
of Accident***

VEH1 (FIAT) HAS BEEN TRAVELLING SOUTHBOUND ALONG ELDON STREET TOWARDS JUNCTION WITH REED STREET AND HAS OVERSHOT JUNCTION ONTO REED STREET COLLIDING WITH OFFSIDE OF VEH2 (SKODA) TRAVELLING EASTBOUND ALONG REED STREET. CAUSING VEH2 TO COLLIDE INTO CENTRAL REFUGE STREET FURNITURE AND DRIVER OF VEH2 TO SUFFER MINOR INJURY.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0330460

Location	South Tyneside A 194 433742E, 563537N	Date/Time	Wednesday 26 September 2018 08:30
Road	Dual Carriageway 40	Junction	Roundabout Automatic traffic signal A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Parked vehicle None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 38 Driver not contacted at time of accident Postcode: NE32 5NB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	38	Not a bus or coach passenger
NE32 5NB		

Casualty 2 - Slight

Vehicle or pillion passenger

Rear seat passenger

Female 5

Not a bus or coach passenger

NE32 5NB

Description of Location

LEAM LANE A194 AT JN WITH LEAMLANE A194

Description of Accident

VEHICLE 2 WAS APPROACHING THE ROUNDABOUT WHEN VEHICLE 1 WHICH WAS IN THE MIDDLE LANE WAS TRYING TO CUT ACROSS INTO THE INSIDE LANE HOWEVER IN DOING SO COLLIDED WITH THE REAR OF VEHICLE 1 THEN MADE OFF WITHOUT STOPPING.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0330468

Location	South Tyneside 436177E, 565782N	Date/Time	Wednesday 26 September 2018 19:34
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Female, 30 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 27 Negative Postcode: SR2 0TF Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	27	Not a bus or coach passenger
SR2 0TF		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 49

Not a bus or coach passenger

SR2 7QS

Description of Location

BERTRAM STREET AT JN WITH ALICE STREET

Description of Accident

V1 (MICRA) HAS LEFT REAR LANE JUNCTION OF ALICE STREET TO TURN RIGHT IN WESTERLY DIRECTION ONTO BERTRAM STEET AND COLLIDED INTO NEAR SIDE OF POLICE VEHICLE WHICH WAS TRAVELLING EASTERLY DIRECTION ON BERTRAM STREET.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0331290

Location	South Tyneside A 185 433345E, 565069N	Date/Time	Friday 28 September 2018 20:27
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1297
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 77 Driver not contacted at time of accident Postcode: NE32 3AE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 33 Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	33	Not a bus or coach passenger

***Description
of Location***

A185 AT JN WITH PRIORY ROAD B1297

***Description
of Accident***

VEHICLE 2 WAS ON THE ROUNDABOUT ON THE A185 PRIORY ROAD WHEN VEHICLE 1 HAS PULLED ONTO THE ROUNDABOUT FROM HER LEFT CAUSING HER TO COLLIDE WITH THE OFFSIDE OF VEHICLE 1, FALLING OFF HER PEDAL CYCLE CAUSING HER INJURIES. BOTH VEHICLES HAVE STOPPED AT THE SCENE AND DETAILS HAVE BEEN EXCHANGED

Slight Accident

Involving 1 Vehicle, 1 Casualty

0318029

Location	South Tyneside A 194 436174E, 566051N	Date/Time	Friday 10 August 2018 11:00
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None Control by other authprised person Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Female, 36 Not requested Postcode: NE33 3LF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	69	Crossing from driver's nearside
NE34 9QY		North

Description of Location WESTERN APPROACH A194

Description of Accident PEDESTRIAN WAS WAITING TO CROSS THE DUAL CARRIAGE WAS AT A PEDESTRIAN CROSSING POINT AND HAS WALKED OUT WITHOUT PROPERLY CHECKING IT WAS CLEAR. V1 WAS CLIPPED THE PEDESTRIAN WITH THE NEAR SIDE WING MIRROR

Slight Accident

Involving 2 Vehicle, 1 Casualty

0312204

Location	South Tyneside A 1300 434699E, 563556N	Date/Time	Tuesday 03 July 2018 20:50
Road	Dual Carriageway 40	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 26 Not requested Postcode: SR3 2UP Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 29 Not requested Postcode: NE34 8LB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	29	Not a bus or coach passenger
NE34 8LB		

***Description
of Location***

JOHN REID ROAD A1300 AT JN WITH PERTH AVENUE

***Description
of Accident***

VEHICLE ONE TRAVELLING NORTH WEST JOHN REID ROAD, DRIVER WAS LOST AND UNFAMILIAR WITH THE ROAD. THEY APPROACHED J/W PERTH AVENUE, DROVE THROUGH RED LIGHT, COLLIDING WITH VEHICLE TWO THAT WAS CROSSING THE CARRIAGEWAY FROM JOHN REID ROAD, SOUTH WEST ONTO PERTH AVENUE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0264650

Location	South Tyneside A 1018 437463E, 564295N	Date/Time	Sunday 04 February 2018 13:25
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 69 Negative Postcode: NE34 7HA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 70 Not applicable Postcode: SR2 8DX Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South West to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	70	Not a bus or coach passenger
SR2 8DX		

***Description
of Location***

KING GEORGE ROAD A1018 AT JN WITH JOHN REID ROAD A1300

***Description
of Accident***

VEHICLE 1 HAS PULLED OUT OF PRINCE EDWARD ROAD ONTO THE ROUNDABOUT. AS HE HAS PULLED OUT HE HAS CAUGHT THE REAR WHEEL OF THE CYCLIST CAUSING THE CYCLIST TO FALL OFF HIS BIKE. CYCLIST ALL DRESSED IN DARK CLOTHING. DRIVER OF VEHICLE 1 HAS NOT SEEN THE CYCLIST OWING TO LOW SUN. CYCLIST WAS COMING OFF AT THE JUNCTION OF KING GEORGE ROAD. SLIGHT SCRATCHES TO VEHICLE 1 OFF SIDE FRONT BUMPER. ROADSIDE BREATH TEST CONDUCTED BOTH NEGATIVE RESULT.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0308881

Location	South Tyneside A 1018 436619E, 566718N	Date/Time	Monday 09 July 2018 10:20
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 27 Driver not contacted at time of accident Postcode: NE33 5SU Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Rear seat passenger
Female 93	Not a bus or coach passenger
NE33 3AN	

Description of Location	WESTOE ROAD A1018 NEAR JN WITH PERCY STREET
Description of Accident	INJURED PARTY ELDERLY DISABLED PASSENGER IN TAXI IN WHEELCHAIR SECURED IN REAR OF TAXI. DRIVER OF VEHICLE 1 TRAVELLING SOUTH ON WESTOE ROAD BRAKED SHARPLY AT JUNCTION CAUSING INJURED PARTY TO FALL FORWARDS HITTING HEAD ON BODYWORK OF VEHICLE CAUSING BRUSING TO HEAD.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0335089

Location	South Tyneside 435817E, 563822N	Date/Time	Thursday 11 October 2018 17:00
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 63 Not requested Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	9	Crossing from driver's nearside
NE34 0TW		South

Description of Location	BIDDICK HALL DRIVE NEAR JN WITH BIDDICK HALL DRIVE

Description of Accident	TWO PRIMARY SCHOOL AGED MALES HAVE BEEN CHASING EACH OTHER ON SCOOTERS BOTH MALES HAVE GONE FROM THE PAVEMENT ONTO THE ROAD, CAR ONE HAS SEEN BOTH THE CHILDREN ON THE PATH AND HAS STOPPED HIS CAR PRIOR TO THE MALES CROSSING ONTO THE ROAD, HOWEVER ONE OF THE MALES HAS HIT HIS CAR AND BOUNCED OFF THE BONNET OFF THE STATIONARY CAR, CAUSING MINOR INJURIES TO THE YOUNG MALE. BOTH PARTIES HAVE GIVEN SIMILAR ACCOUNTS LEAVING BLAME ON THE PEDESTRIAN.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0341384

Location	South Tyneside A 194 434487E, 564047N	Date/Time	Sunday 04 November 2018 10:30
Road	Dual Carriageway 40	Junction	Crossroads Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	59	Crossing from driver's nearside
NE34 9QN		North

Description of Location	NEWCASTLE ROAD A194 NEAR JN WITH HENDERSON ROAD

Description of Accident	THE PEDESTRIAN HAS PRESSED THE BUTTON ON THE PELICAN CROSSING AND WAITED FOR THE LIGHTS TO CHANGE, ON SEEING THE GREEN MAN SHE HAS STARTED TO CROSS THE ROAD. AS SHE WAS CROSSING A VEHICLE HAS COME FROM HER RIGHT AT SPEED, THE VEHICLE HASN'T HIT THE PEDESTRIAN BUT SHE HAS FALLEN BACKWARDS AND INJURED HER HANDS WHEN TRYING TO STOP HER FALL. SHE HAS NO IDEA WHAT MAKE, MODEL, COLOUR OR VRM OF THE CAR INVOLVED, SHE STATED THAT SHE DOESN'T KNOW WHETHER THE CAR HAS COME OUT OF HENDERSON

Slight Accident

Involving 2 Vehicle, 1 Casualty

0311678

Location	South Tyneside A 1300 437427E, 564280N	Date/Time	Thursday 19 July 2018 17:38
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 66 Negative Postcode: NE34 6JP Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 58 Negative Postcode: NE34 6RR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	58	Not a bus or coach passenger
NE34 6RR		

<i>Description of Location</i>	JOHN REID ROAD A1300 AT JN WITH A1018
<i>Description of Accident</i>	V1 ENTER R/A OFF KING GEORG RD BUT DOES NOT GIVE WAY TO V2 ALREADY ON R/A

Slight Accident

Involving 2 Vehicle, 1 Casualty

0311675

Location	South Tyneside A 194 434245E, 563854N	Date/Time	Thursday 19 July 2018 20:53
Road	Roundabout 40	Junction	Roundabout Automatic traffic signal A 1300
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A)

Vehicle 1

Driver	Male, 79 Negative Postcode: NE34 9LU Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 35 Negative Postcode: NE34 8PQ Other	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	35	Not a bus or coach passenger
NE34 8PQ		

*Description
of Location*

LEAM LANE A194 AT JN WITH JOHN REID ROAD A1300

*Description
of Accident*

DRIVER OF V1 HAS RUN INTO THE BACK OF THE V2 WHILST IT WAS STOPPED AT A RED TRAFFIC LIGHT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0324942

Location	South Tyneside A 1018 436575E, 566824N	Date/Time	Thursday 06 September 2018 21:12
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal A 194
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Female, 41 Not requested Postcode: NE34 0LH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 44	Not a bus or coach passenger

Vehicle 2

Driver	Male, 24 Not requested Postcode: NE33 3LP Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North West Turning left No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

WESTOE ROAD A1018 AT JN WITH CROSSGATE A194

***Description
of Accident***

VEHICLE 1 VRM NA11CWF WAS WAITING AT TRAFFIC LIGHTS TO TURN RIGHT, VEHICLE 2 VRM SA07HDA WAS ON THE OPPOSITE SIDE OF THE ROAD FACING VEHICLE 1 AND TURNING LEFT. VEHICLE 2 HAS TURNED LEFT AS VEHICLE 1 HAS TURNED RIGHT AND BOTH VEHICLES HAVE COLLIDED. VEHICLE 1 DRIVER BELIEVES SHE OBSERVED A GREEN LIGHT BUT NOW UNSURE IF GREEN RIGHT TURN LIGHT WAS ILLUMINATED.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0329464

Location	South Tyneside A 1300 434688E, 563580N	Date/Time	Saturday 22 September 2018 01:20
Road	Dual Carriageway 40	Junction	Crossroads Automatic traffic signal
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Female, 35 Not requested Postcode: NE34 9RX Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 30 Not requested Postcode: NE34 9JZ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Vehicle or pillion passenger	Rear seat passenger
Male 26	Not a bus or coach passenger

***Description
of Location***

JOHN REID ROAD A1300 AT JN WITH PERTH AVENUE

***Description
of Accident***

V2 HAS BEEN IN NEARSIDE LANE STATIONARY AT TRAFFIC LIGHTS. REAR SEAT PASSENGER DEAN ELGAR, DOB 30/04/1992 WHILST UNDER THE INFLUENCE OF ALCOHOL HAS EXITED V2 AND INTO THE LIVE OFFSIDE LANE WHERE HE HAS BEEN STRUCK BY V1 TRAVELLING AT 40MPH. ELGAR HAS COLLIDED WITH THE NEARSIDE WING MIRROR AND V1 HAS RAN OVER HIS FOOT CAUSING A SUSPECTED FRACTURE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0331673

Location	South Tyneside C 408 436631E, 564968N	Date/Time	Monday 01 October 2018 15:20
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 32 Negative Postcode: NE33 1RR Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In centre of carriageway, not on refuge, central island or central reservation
Female	12	Crossing from driver's offside
NE32 5YR		East

Description of Location	TEMPLE PARK ROAD C408 NEAR JN WITH STANHOPE ROAD

Description of Accident	OFFICER WAS DRIVING UNDER NORMAL CONDITIONS WITHIN SPEED LIMIT. PEDESTRIAN A PUPIL FROM THE ST WILFREDS SCHOOL HAS RUN OUT WITHOUT LOOKING INTO PATH OF PATROL CAR. DRIVER HAS IMMEDIATELY REACTED APPLYING BRAKES HOWEVER PEDESTRIAN HAS COLLIDED WITH FRONT O/S OF PATROL CAR. IMPACT HAS CAUSED MINOR DAMAGE TO POLICE VEHICLE HEADLAMP. PEDESTRIAN WAS CHECKED OVER BY NEAS, NO VISIBLE INJURY SLIGHT SORENESS TO HIP ONLY. PUPIL WALKED BACK TO SCHOOL BEFORE LEAVING A SHORT TIME LATER WITH FAM

Serious Accident

Involving 2 Vehicle, 1 Casualty

0343737

Location	South Tyneside A 185 433931E, 564845N	Date/Time	Monday 12 November 2018 18:46
Road	Dual Carriageway 30	Junction	T or staggered junction Give way or uncontrolled C 404
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Female, 57 Driver not contacted at time of accident Postcode: NE34 6EE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 17 Driver not contacted at time of accident Postcode: NE34 7QP Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other Skidded Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 17	Not a bus or coach passenger
NE34 7QP	

***Description
of Location***

JARROW A185 AT JN WITH CHURCH BANK C404

***Description
of Accident***

V2 WAS DRIVING ALONG A185 JARROW WHEN IT PASSED THE JUNCTION OF A185 AND CHURCH BANK V1 CUT ACROSS ITS PATH CAUSING V2 TO DRIVE INTO V1

Slight Accident

Involving 2 Vehicle, 1 Casualty

0305960

Location	South Tyneside A 194 436569E, 566830N	Date/Time	Friday 22 June 2018 12:05
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	

Vehicle 1

Driver	Female, 41 Driver not contacted at time of accident Postcode: NE33 3BH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 37 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 71	Seated passenger
NE34 0PD	

***Description
of Location***

CROSSGATE A194 AT JN WITH A1018

***Description
of Accident***

V2 WAS IN THE CORRECT LANE TO TAKE A LEFT TURN AT THE TRAFFIC LIGHTS DOT BEACH ROAD, V1 WAS IN THE LEFT LANE HOWEVER CHANGED TO THE RIGHT LANE THEN JUST AS THE LIGHTS CHANGED V1 THEN SWITCHED LANES CAUSING THE BUS TO COLLIDE INTO THE REAR NEAR SIDE PASSENGER DOOR AN OAP ON THE BUS HAD THEN CAUSE TO FALL FROM HER SEAT TO THE FLOOR WHEN DRIVER APPLIED HIS BRAKES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0343160

Location	South Tyneside A 194 434924E, 564464N	Date/Time	Sunday 11 November 2018 12:37
Road	Roundabout 60	Junction	Roundabout Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 50 Driver not contacted at time of accident Postcode: LS19 6DG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to East Changing lane to right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 46 Driver not contacted at time of accident Postcode: NE3 3XR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	46	Not a bus or coach passenger
NE3 3XR		

***Description
of Location***

NEWCASTLE ROAD A194 AT JN WITH WALDRIDGE WAY

***Description
of Accident***

VEHICLE 2 HAS BEEN TRAVELLING IN THE RIGHT LANE GOING STRAIGHT AHEAD OVER ROUNDABOUT WHEN VEHICLE 1 TRAVELLING IN THE SAME DIRECTION HAS VEERED INTO THE RIGHT LANE COLLIDING WITH V2 CAUSING DAMAGE AND SLIGHT INJURY

Slight Accident

Involving 1 Vehicle, 1 Casualty

0345832

Location	South Tyneside A 1300 436897E, 564055N	Date/Time	Wednesday 21 November 2018 17:57
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Not traced, 37 Driver not contacted at time of accident Postcode: NE38 7QF Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	48	Crossing from driver's offside
NE34 0HT		South

Description of Location JOHN REID ROAD A1300

Description of Accident INJURED PEDESTRIAN ATTEMPTED TO CROSS ROAD USING PEDESTRIAN CROSSING, WHILST HALF WAY ACROSS, SHE WITNESSED VEHICLE 1 TRAVELLING TOWARDS HER AND REALISING THE SPEED THE VEHICLE WAS TRAVELLING, SHE BELIEVED THAT HE WAS NOT GOING TO STOP, SO SHE TRIED TO MOVE BACKWARDS, AT THIS POINT SHE HAS FALLEN OVER CAUSING MINOR INJURY TO KNEE, BACK AND ELBOW. DRIVER OF VEHICLE 1 STOPPED AT SCENE AND ATTEMPTED TO EXCHANGE DETAILS. PEDESTRIAN WAS SHOOK UP AND IN SHOCK REFUSED TO TAKE DETAILS. FWIN 300 221118

Slight Accident

Involving 1 Vehicle, 1 Casualty

0291440

Location	South Tyneside B 1298 435966E, 564221N	Date/Time	Thursday 03 May 2018 10:15
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 47 Driver not contacted at time of accident Postcode: NE34 0ND Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to North Going ahead other Skidded Left carriageway offside

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male 49	Crossing from driver's offside
NE34 0AL	Standing Still

Description of Location	BOLDON LANE B1298
Description of Accident	PEDASTRIAN HAS BEEN CROSSING THE ROAD FROM MAXWELLS HARDWARE SHOP 139 BOLDON LANE CARRYING A TIN OF PAINT AND WOOD AFTER CHECKING TO ENSURE IT WAS SAFE TO DO SO. A BLUE FORD FOCUS HAS STOPPED TO ALLOW PEDESTRIAN TO CROSS. VEHICLE HAS THEN BEGAN TO DO A U TURN IN THE ROAD COLLIDING WITH THE PEDESTRIAN WHO DROPPED HIS TIN OF PAINT. VEHICLE HAS STOPPED AND PASSED DETAILS OVER TO THE PEDESTRIAN PEDESTRIAN DID NOT HAVE ANY INJURIES AT THE TIME AND DID NOT SEEK MEDICIAL ATTENT

Serious Accident

Involving 4 Vehicle, 1 Casualty

0343420

Location	South Tyneside C 413 436655E, 565690N	Date/Time	Friday 09 November 2018 12:42
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 24 Negative Postcode: NE33 4TT Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 75 Not provided (medical reasons) Postcode: NE34 8AN Not known	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other Skidded and overturned Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	75	Not a bus or coach passenger
NE34 8AN		

Vehicle 3

Driver Not traced,
Not applicable
Postcode:
Not known

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Offside
None
None

Movement Vehicle moving from South East to North West
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 4

Driver Not traced,
Not applicable
Postcode:
Not known

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Offside
None
None

Movement Vehicle moving from South East to North West
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location 20 MORTIMER ROAD C413 NEAR JN WITH ALBANY STREET WEST

Description of Accident VEHICLE 2 WAS BEING RIDDEN NORTH WEST ALONG MORTIMER ROAD. VEHICLE 1 WAS PULLING AWAY FROM THE PARKING AREA OUTSIDE NUMBER 41 MORTIMER ROAD TO TRAVEL NORTH WEST ALONG MORTIMER ROAD. AS VEHICLE 1 HAS MOVED ACROSS INTO THE CORRECT LANE, VEHICLE 2 HAS APPROACHED, AND FOR REASONS YET TO BE ESTABLISHED THE RIDER OF VEHICLE 2 HAS BRAKED AND FALLEN FROM HIS VEHICLE, COLLIDING WITH VEHICLE'S 3 & 4 THAT WERE PARKED UNATTENDED ADJACENT TO THE SOUTH WEST KERB. ALL VEHICLES REMAINED AT THE SCENE

Slight Accident

Involving 2 Vehicle, 1 Casualty

0346408

Location	South Tyneside A 1300 434229E, 563805N	Date/Time	Friday 23 November 2018 07:35
Road	Dual Carriageway 40	Junction	Roundabout Automatic traffic signal A 194
Conditions	Darkness - Street Lighting Unknown Unknown Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, Driver not contacted at time of accident Postcode: NE34 7DF Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 21 Driver not contacted at time of accident Postcode: NE39 2DQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	21	Not a bus or coach passenger
NE39 2DQ		

*Description
of Location*

JOHN REID ROAD A1300 AT JN WITH NEWCASTLE ROAD A194

*Description
of Accident*

VEHICLE 2 WAS STATIONARY AT THE TRAFFIC LIGHTS WHEN VEHICLE 1 HAS COLLIDED WITH THE REAR OF VEHICLE 2.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0347833

Location	South Tyneside A 194 435127E, 564633N	Date/Time	Thursday 29 November 2018 16:32
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 185
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 27 Not requested Postcode: NE31 1JN Taking pupil to/from school	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 59 Not requested Postcode: NE34 0SF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	59	Not a bus or coach passenger
NE34 0SF		

***Description
of Location***

A194 AT JN WITH JARROW ROAD A185

***Description
of Accident***

DURING RUSH HOUR ON A BUSY SECTION OF ROAD UNDER GOING ROAD WORKS THE DRIVER OF VEHICLE 1 HAS HAD A MOMENTARY LACK OF CONCENTRATION AND COLLIDED AT SLOW SPEED WITH VEHICLE 2 CAUSING DAMAGE AND MINOR INJURY TO THE DRIVER OF VEHICLE 2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0347872

Location	South Tyneside C 402 435776E, 566303N	Date/Time	Friday 30 November 2018 17:10
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 38 Negative Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 38	Not a bus or coach passenger

Description of Location COMMERCIAL ROAD C402 NEAR JN WITH PORTHBERRY WAY

Description of Accident VEHICLE TRAVELLING SOUTH WEST ALONG COMMERCIAL ROAD WHEN FOR REASONS YET TO BE ESTABLISHED IT SUDDENLY VEERED TO THE NEARSIDE AND COLLIDED WITH A POST BOX CAUSING DAMAGE AND INJURY.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0331660

Location	South Tyneside B 1303 436171E, 566733N	Date/Time	Saturday 29 September 2018 12:25
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 56 Negative Postcode: NE33 2DR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	3	Crossing from driver's nearside
NE31 1HL		West

Description of Location	STATION ROAD B1303 NEAR JN WITH ENTRANCE TO HALFORDS

Description of Accident	V1 WAS TRAVELLING IN SOUTHBOUND DIRECTION ALONG STATION ROAD, SOUTH SHIELDS. THE IP, A 3YR OLD CHILD WAS WITH HIS FAMILY WALKING ALONG THE EASTERN SIDE FOOTPATH. THE IP RAN OUT INTO THE ROAD WHERE V1 COLLIDED WITH HE IP, KNOCKING THE IP TO THE GROUND.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0341261

Location	South Tyneside C 406 435050E, 564134N	Date/Time	Sunday 04 November 2018 17:36
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 52 Not requested Postcode: NE34 9QZ Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 52	Not a bus or coach passenger
NE34 9QZ	

Vehicle 2

Driver	Female, 26 Not requested Postcode: NE34 9AL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to West Reversing No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

135 WENLOCK ROAD C406

***Description
of Accident***

VEHICLE ONE AND TWO HAVE BEEN TRAVELLING ON WENLOCK ROAD TOWARDS EBCHESHER STREET WHEN VEHICLE 1 HAS BEGAN TO SLOW TO PULL ON TO HER DRIVEWAY VEHICLE ONE HAS INDICATED AND PULLED TO THE RIGHT TO REVERSE ONTO HER DRIVE WHEN VEHICLE TWO HAS NOT STOPPED AND COLLIED WITH THE REAR DRIVERS SIDE OF VEHICLE ONE CAUSING THE BIKE RIDER TO COME OFF HIS BIKE LEAVING HIM WITH A HAND INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0346073

Location	South Tyneside A 1018 436628E, 566705N	Date/Time	Wednesday 21 November 2018 11:15
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 52 Driver not contacted at time of accident Postcode: SR6 8LS Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 80	Seated passenger
NE33 4SR	

Vehicle 2

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

WESTOE ROAD A1018 NEAR JN WITH ERSKINE ROAD

***Description
of Accident***

VEH 1 WAS DRIVING FROM THE TOWN HALL AT SOUTH SHIELDS ALONG WESTOE ROAD WHEN OUTSIDE NO 10 AN UNKNOWN VEHICLE VEH 2 HAS PULLED OUT CAUSING THE BUS VEH1 TO BRAKE HARD AND THE PASSENGER HAS FALLEN FROM THE SEAT CAUSING INJURY TO THE PASSENGER PEARL WHO HAS SORENESS TO BACK AND KNEE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0346304

Location	South Tyneside 434039E, 564385N	Date/Time	Thursday 22 November 2018 16:36
Road	Single Carriageway 30	Junction	Other junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Other Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 64 Driver not contacted at time of accident Postcode: NE34 6DD Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 52 Not applicable Postcode: NE34 8PY Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to East Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	52	Not a bus or coach passenger
NE34 8PY		

***Description
of Location***

BEDE INDUSTRIAL ESTATE AT JN WITH SHAFTESBURY AVE

***Description
of Accident***

FWIN 758 22/11/18 ON THE 22/11/18 AT 16.36 HRS P2 HAS BEEN ON PEDAL CYCLE ON BEDE INDUSTRIAL EST JARROW WHEN V1 HAS PULLED OUT OF A JUNCTION KNOCKING P2 FROM CYCLE CAUSING MINOR INJURY. V1 SAAB PX08XNR - P1 - DETAILS UNKNOWN - DRIVER REFUSED TO GET OUT OF CAR ASKED IF P2 WANTED MONEY AND DROVE OFF REFUSING TO PASS DETAILS.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0350258

Location	South Tyneside A 194 435007E, 564524N	Date/Time	Tuesday 11 December 2018 17:40
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 26 Not requested Postcode: NE34 0QL Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 24 Not requested Postcode: NE32 4EP Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 57
Not requested
Postcode: NE33 5HG
Commuting to/from work

Collisions Hit no other vehicle
Back
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Movement Vehicle moving from North East to North East
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger
Female 54

Front seat passenger
Not a bus or coach passenger

Description of Location NEWCASTLE ROAD A194

Description of Accident V3 FILTERS FROM LANE 2 TO LANE 1, V3 THEN BRAKES DUE TO TRAFFIC BACKING UP, V1 FAILS TO BREAK IN TIME COLIDING WITH THE REAR OF V3. V2 ALSO FAILS TO BREAK IN TIME AND COLIDES WITH REAR OF V1.

Slight Accident

Involving 4 Vehicle, 2 Casualties

0345417

Location	South Tyneside C 408 437258E, 564375N	Date/Time	Monday 19 November 2018 17:08
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Travelling too fast for conditions (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 20 Negative Postcode: SR6 7DF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other Skidded Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male 20	Not a bus or coach passenger
SR6 7DF	

Vehicle 2

Driver	Male, 42 Negative Postcode: NE34 0EQ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None Entered ditch	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North East to North West Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 42	Not a bus or coach passenger
NE34 0EQ	

Vehicle 3

Driver Male, 49
Negative
Postcode: NE34 7HG
Journey as part of work

Collisions Hit no other vehicle
Front
None
None

Vehicle Bus or coach (17 or more passenger seats)
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from North West to South East
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 4

Driver Female, 39
Driver not contacted at time of accident
Postcode: NE34 7PQ
Commuting to/from work

Collisions Hit no other vehicle
Did not impact
None
None

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit
Movement Vehicle moving from North West to South East
Waiting to go ahead but held up
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location 212 TEMPLE PARK ROAD C408 NEAR JN WITH MELDON AVENUE

Description of Accident VEHICLE 1 WAS TRAVELLING NORTH WEST ON TEMPLE PARK ROAD FROM THE DIRECTION OF KING GEORGE ROAD. VEHICLE 2 WAS TURNING RIGHT FROM MELDON AVENUE ONTO TEMPLE PARK ROAD. VEHICLE 3 WAS TRAVELLING SOUTH EAST ALONG TEMPLE PARK ROAD TOWARDS THE JUNCTION WITH MELDON AVENUE. VEHICLE 4 WAS TRAVELLING SOUTH EAST ALONG TEMPLE PARK ROAD IN FRONT OF VEHICLE 3. VEHICLE 4 STOPPED PRIOR TO THE JUNCTION WITH MELDON AVENUE AND FLASHED ITS HEADLIGHTS TO ALLOW VEHICLE 2 TO TURN OUT ONTO TEMPLE PARK ROAD. VEHICLE

Slight Accident

Involving 2 Vehicle, 2 Casualties

0354500

Location	South Tyneside B 1298 435992E, 564049N	Date/Time	Wednesday 09 January 2019 14:00
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 406
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Disobeyed "Give Way" or "Stop" sign or markings (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 48 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 45	Standing passenger

Casualty 1 - Slight

Vehicle or pillion passenger

Not a car passenger

Female

25

Standing passenger

Description of Location

BOLDON LANE B1298 AT JN WITH GREEN LANE C406

Description of Accident

VEHICLE TWO, A BUS, HAS BEEN TRAVELLING SOUTH ON THE B1298 TURNING RIGHT AT THE ROUNDABOUT ONTO GREEN LANE, VEHICLE ONE HAS FAILED TO STOP AT THE ROUNDABOUT CAUSING VEHICLE TWO TO BRAKE SHARPLY. TWO PASSENGERS HAVE FALLEN AS A RESULT AND SUFFERED MINOR INJURIES. VEHICLE ONE FAILED TO STOP.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0336576

Location	South Tyneside 436155E, 566778N	Date/Time	Tuesday 16 October 2018 14:40
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled B 1303
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Careless, reckless or in a hurry (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 51 Negative Postcode: NE33 1EQ Other	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to North Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 91 Not applicable Postcode: NE33 5LN Other	Vehicle	Mobility Scooter No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Moving off Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	91	Not a bus or coach passenger
NE33 5LN		

*Description
of Location*

HENRYROBSON WAY AT JN WITH STATION ROAD B1303

*Description
of Accident*

ELDERLY FEMALE ON A MOBILITY SCOOTER BEGINS TO CROSS WHEN SAFE TO DO SO. V1 TURNS AT JUNCTION STRIKES MOBILITY SCOOTER CAUSING THE SCOOTER TO TIP OVER THROWING ELDERLY OCCUPANT OUT AND ONTO THE CARRIAGEWAY.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0352866

Location	South Tyneside C 414 436024E, 564188N	Date/Time	Friday 28 December 2018 14:43
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 33 Driver not contacted at time of accident Postcode: NE34 9JH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	69	Crossing from driver's offside
NE34 0QU		South

Description of Location O/S 235 HARTON LANE C414

Description of Accident IP PEDESTRIAN CROSSING HARTON LANE, TOWARDS 235 HARTON LANE. DRIVER V1 REVERSES VEHICLE ONE, OFF THE DRIVE OF 237 HARTON LANE INTO THE CENTRE OF HARTON LANE. VEHICLE ONE COLLIDES WITH IP IN THE CENTRE OF HARTON LANE. REAR DRIVERS SIDE OF VEHICLE ONE HITS IP IN THE RIGHT KNEE AND ARM, KNOCKING IP TO GROUND. VEHICLE ONE DRIVES OFF TOWARDS BOLDON LANE. IP IS HELPED TO FEET BY WITNESS IP WAITS FOR POLICE, BEFORE MAKING HIS OWN WAY HOME

Slight Accident

Involving 1 Vehicle, 1 Casualty

0347883

Location	South Tyneside A 1018 437414E, 564504N	Date/Time	Friday 30 November 2018 12:03
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Other Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 35 Negative Postcode: NE33 2NX Not known	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from Parked to South Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, not crossing
Female	73	Unknown or other
NE34 0EL		Standing Still

Description of Location	171 KING GEORGE ROAD A1018

Description of Accident	VEHICLE 1 WAS PARKED UP ON KING GEORGE ROAD OUTSIDE OF 171 WHEN THE PEDESTRIAN HAS GOT OFF THE BUS SHE HAS STEPPED OUT ONTO THE ROAD WHEN THE VAN HAS SLOWLY START REVERSING AND KNOCKED THE PEDESTRIAN TO THE GROUND WHERE SHE HER LEGS HAVE JUST PARTLY GONE UNDER THE VAN INJURIES ARE LARGE GRAZE TO RIGHT HAND, GRAZE AND SLIGHT SWELLING TO RIGHT SIDE OF HEAD AND PAIN TO HER RIGHT HIP

Slight Accident

Involving 4 Vehicle, 4 Casualties

0347447

Location	South Tyneside A 194 434027E, 563720N	Date/Time	Wednesday 28 November 2018 08:30
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 54 Negative Postcode: NE23 7RJ Journey as part of work	Vehicle	Goods vehicle over 3.5 tonnes and under 7.5 tonnes mgw No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 34 Negative Postcode: NE9 6RX Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	34	Not a bus or coach passenger
NE9 6RX		

Casualty 2 - Slight

Vehicle or pillion passenger
Female 12
NE9 6RX

Front seat passenger
Not a bus or coach passenger

Vehicle 3

Driver Female, 50
Negative
Postcode: NE32 5QQ
Not known

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle moving from West to East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 5 - Slight

Driver or rider
Female 50
NE32 5QQ

Not a car passenger
Not a bus or coach passenger

Casualty 4 - Slight

Vehicle or pillion passenger
Female 26
NE32 5QQ

Front seat passenger
Not a bus or coach passenger

Vehicle 4

Driver Female, 56
Negative
Postcode:
Other

Vehicle Car
No tow or articulation
Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle moving from West to East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location JOHN REID ROAD A194

Description of Accident ALL 4 VEHICLES TRAVELLING EAST BOUND A194 TOWARDS JOHN REID ROAD ROUNDABOUT, FROM LINDISFARNE ROUNDABOUT PASSING HADRIAN ROAD JUNCTION. V3, WAS CAUSED TO BREAK IN THE ROAD, INSIDE LANE. V1, ATTEMPTED TO STOP, BUT WAS UNABLE AND COLLIDED WITH THE REAR OF V3, PUSHING V3 INTO THE REAR OF V4, V2, WAS UNABLE TO STOP AND COLLIDED WITH THE REAR OF V1. AIRBAG DEPLOYED IN V2 AND BOTH DRIVER AND FRONT SEAT PASSENGER COMPLAINED OF NECK AND BACK PAIN. DRIVER OF V2 REMOVED FROM VEHIC

Slight Accident

Involving 2 Vehicle, 1 Casualty

0355407

Location	South Tyneside C 413 436838E, 565468N	Date/Time	Thursday 17 January 2019 20:57
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 52 Negative Postcode: NE34 0SG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 17 Negative Postcode: Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Slowing or stopping Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	17	Not a bus or coach passenger

***Description
of Location***

MORTIMER ROAD C413 AT JN WITH HEPSCOTT TERRACE

***Description
of Accident***

VEH 1 HAS BEEN ON HEPSCOTT TERRACE AT JUNCTION WITH MORTIMER ROAD INTENDING TO TRAVEL SW ONTO READING ROAD. VEH 1 FAILS TO LOOK PROPERLY AND PULLS ONTO MORTIMER ROAD, COLLIDING WITH VEH 2 TRAVELLING SE ON MORTIMER ROAD.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0814416

Location	South Tyneside 435894E, 564375N	Date/Time	Wednesday 06 February 2019 19:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Other Wet/Damp None None Control by other authorised person No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to North West Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	35	Unknown or other
NE33 4LJ		Standing Still

Description of Location	BEATTIE STREET NEAR JUNCTION WITH ETHEL TERRACE

Description of Accident	FWIN 1054 060219 PEDESTRIAN WAS CROSSING ROAD/REAR LANE WHEN V1 HAS REVERED COLLIDING WITH PEDESTRIAN KNOCKING HER ON THE GROUND. DRIVER OF V1 FAILED TO STOP AND LEAVE DETAILS

Slight Accident

Involving 2 Vehicle, 1 Casualty

0814465

Location	South Tyneside A 1300 435638E, 563608N	Date/Time	Thursday 07 February 2019 10:39
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present but unlit Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 16 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 46 Driver not contacted at time of accident Postcode: NE34 6QB Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	46	Not a bus or coach passenger
NE34 6QB		

***Description
of Location***

JOHN REID ROAD (A1300) - 32 METRES FROM JUNCTION WITH CHESTERTON ROAD (A1300)

***Description
of Accident***

DAMAGE RTC CALLER WAS A F/S/P IN VAUXHALL MOKA BLACK (VRM N/K) AS VEH SLOWED TO HALT OPPTHE NEW MILL PUB,A CAR TRAVELLING BEHIND THEM CRASHED INTO BACK OF HER CAR

Slight Accident

Involving 3 Vehicle, 1 Casualty

0311674

Location	South Tyneside A 194 435932E, 565535N	Date/Time	Thursday 19 July 2018 16:25
Road	Roundabout 40	Junction	Roundabout Automatic traffic signal C 407
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 49 Not requested Postcode: NE33 5PZ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 30 Not requested Postcode: Not known	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to North East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	30	Not a bus or coach passenger

Vehicle 3

Driver Male, 48
Not requested
Postcode:
Not known

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Mid junction - on roundabout or on main road

Collisions Hit no other vehicle
Offside
None
None

Movement Vehicle moving from North to South
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location WESTERN APPROACH A194 AT JN WITH BARNES

Description of Accident DRIVER OF V1 HAS ENTERED THE ROUNDABOUT FAILING TO GIVE WAY TO TRAFFIC COMING FROM THE RIGHT. V2 HAS COLLIDED WITH V1. V1 HAS SWERVED AND COLLIDED WITH V3.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0816575

Location	South Tyneside A 194 434362E, 563952N	Date/Time	Friday 08 February 2019 14:00
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 63 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 63	Not a bus or coach passenger

***Description
of Location***

NEWCASTLE ROAD (A194) - 169 METRES FROM JUNCTION WITH HENDERSON ROAD

***Description
of Accident***

VEH2 WAS STATIONARY IN A LINE OF TRAFFIC, WHEN FOR UNKNOWN REASONS, VEH1 FAILED TO SEE THAT VEH2 WAS STATIONARY AND COLLIDED WITH THE REAR OF VEH2. THE DRIVER OF VEH1 INITIALLY STOPPED, DECLINED TO PASS DETAILS AND THRUST £100 INTO THE HANDS OF THE DRIVER OF VEH2 BEFORE GETTING BACK INTO THE VEHICLE AND MAKING OFF. THE DRIVER OF VEH1 FAILED TO STOP AND FAILED TO REPORT THE RTC

Slight Accident

Involving 2 Vehicle, 1 Casualty

0820277

Location	South Tyneside 435787E, 564196N	Date/Time	Thursday 14 February 2019 00:10
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, 30 Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 25 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 25	Not a bus or coach passenger

***Description
of Location***

MARIGOLD WALK NEAR JUNCTION WITH LAVENDER LANE

***Description
of Accident***

DRIVER VEH 2 STATED SHE BELIEVED SHE WAS BEING FOLLOWED BY VEH 1. SHE HAS DRIVEN INTO MARIGOLD WALK, SOUTH SHIELDS AND VEH 1 HAS DRIVEN INTO THE REAR OF HER VEHICLE TWICE BEFORE MAKING OFF FROM SCENE. VEH1 WAS FOUND NEARBY HAVING BEEN SET ON FIRE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0820394

Location	South Tyneside A 1018 437325E, 564843N	Date/Time	Monday 04 March 2019 06:20
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 40 Driver not contacted at time of accident Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, not crossing
Male	57	Unknown or other
NE34 6JP		West

Description of Location KING GEORGE ROAD (A1018) NEAR JUNCTION WITH HARTON LANE

Description of Accident THE PEDAL CYCLIST STATES THAT HE APPROACHED THE ROUNDABOUT FROM MOOR LANE AND CONTINUED ON THE ROUNDABOUT. HE STATES THAT HE WAS AWARE OF A BUS APPROACHING THE ROUNDABOUT FROM KING GEORGE ROAD TRAVELLING NORTH. AS THE CYCLIST MADE EFFORTS TO EXIT THE ROUNDABOUT ONTO HARTON LANE THE BUS CONTINUED IT'S JOURNEY FAILING TO STOP AND CLIPPED THE LEFT KNEE AND SIDE OF THE CYCLIST, KNOCKING HIM TO THE GROUND. THE DRIVER OF THE BUS STOPPED IMMEDIATELY AND ALL DETAILS WERE EXCHANGED. NO OFFENCES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0824974

Location	South Tyneside	Date/Time	Tuesday
	435094E, 564662N		19 March 2019
Road	Single Carriageway	Junction	Not at or within 20 metres of junction
	30		
Conditions	Daylight - Street Lights Present	Contributory	
	Fine without high winds		
	Dry		
	None		
	None		
	None within 50 metres		
	No physical crossing facility within 50 metres		

Vehicle 1

Driver	Male, 60	Vehicle	Car
	Driver not contacted at time of accident		No tow or articulation
	Postcode: NE3 4AD	Location	On main carriageway - not in restricted lane
	Not known		Not at, or within 20 metres of junction
Collisions	Hit no other vehicle	Movement	Vehicle moving from West to East
	Front		Going ahead other
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

Vehicle 2

Driver	Female, 51	Vehicle	Car
	Driver not contacted at time of accident		No tow or articulation
	Postcode: NE32 5UJ	Location	On main carriageway - not in restricted lane
	Other		Not at, or within 20 metres of junction
Collisions	Hit no other vehicle	Movement	Vehicle moving from West to East
	Back		Going ahead other
	None		No skidding, jack-knifing or overturning
	None		Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	51	Not a bus or coach passenger
NE32 5UJ		

***Description
of Location***

HOBSON WAY - 67 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

ON THE 19TH MARCH 2019 AT 1423 HOURS VEHICLE 2 HAS BEEN ON HOBSON WAY, JARROW AT THE TRAFFIC LIGHTS WHEN VEHICLE 1 HAS WENT INTO THE REAR OF VEHICLE 2 CAUSING DAMAGE. BOTH PARTIES HAVE STOPPED AND EXCHANGED DETAILS COMPLYING WITH THE ROAD TRAFFIC ACT HOWEVER THE DRIVER OF VEHICLE 2 HAS SUSTAINED WHIP LASH IN THE PROCESS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0809433

Location South Tyneside
A 194
436199E, 566138N

Road Roundabout
30

Conditions Daylight - Street Lights Present
Fine without high winds
Dry
None
None

None within 50 metres
Zebra Crossing

Date/Time Monday
21 January 2019
13:10

Junction Roundabout
Give way or uncontrolled
A 194

Contributory
Disobeyed "Give Way" or "Stop" sign or markings (A)
Travelling too fast for conditions (B)
Buildings, road signs, street furniture (B)
Careless, reckless or in a hurry (A)

Vehicle 1

Driver Male, 33
Driver not contacted at time of accident
Postcode: NE34 0QL

Not known

Collisions Hit no other vehicle

Front
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Mid junction - on roundabout or on main road

Movement Vehicle moving from West to East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 2

Driver Male, 62
Not provided (medical reasons)
Postcode: NE33 4SJ

Journey as part of work

Collisions Hit no other vehicle

Nearside
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Mid junction - on roundabout or on main road

Movement Vehicle moving from North to West
Turning right
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Slight

Driver or rider
Male 62
NE33 4SJ

Not a car passenger
Not a bus or coach passenger

***Description
of Location***

LAYGATE (A194) NEAR JUNCTION WITH WESTERN APPROACH (A194)

***Description
of Accident***

V1 HAS BEEN TRAVELLING DOWN ON B1301 (LAYGATE) TOWARDS ROUNDABOUT. V2 HAS BEEN TRAVELLING ALONG A194 (WESTERN APPROACH) TOWARDS ROUNDABOUT. V2 HAS BEEN IN THE RIGHT LANE ON ROUNDABOUT WHEN V1 HAS PULLED OUT STRAIGHT INTO THE BACK OF V2.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0825646

Location	South Tyneside A 194 435567E, 565022N	Date/Time	Friday 22 March 2019 23:15
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled B 1302
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A) Slippery road (due to weather) (A)

Vehicle 1

Driver	Male, 44 Negative Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Entered ditch	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from West to East Going ahead other Skidded Left carriageway nearside

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 28	Not a bus or coach passenger

Description of Location	WESTERN APPROACH (A194) - 103 METRES FROM JUNCTION WITH TEMPLETOWN
Description of Accident	DRIVER OF VEHICLE 1 TRAVELLING TO GR-1 EMERGENCY TRAVELLING EAST ON A194 ENTERS ROUNDABOUT WITH B1302 WHERE CLIPS R/O/S WHEEL WITH RAISED CENTRAL KERB OF ROUNDABOUT CAUSING DRIVER TO LOSE CONTROL AND EXIT ROUNDABOUT UNCONTROLLED AND COLLIDE WITH NEARSIDE ROAD SIDE FURNITURE ON EXITING

Slight Accident

Involving 2 Vehicle, 1 Casualty

0826755

Location	South Tyneside 436446E, 565620N	Date/Time	Tuesday 26 March 2019 14:30
Road	Unknown 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 35 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	35	Not a bus or coach passenger

<i>Description of Location</i>	BEWICK STREET - 71 METRES FROM JUNCTION WITH RAVENSWORTH TERRACE
<i>Description of Accident</i>	FWIN 708 26/03/19 V2 HAS BEEN PARKED IN THE STREET WHEN V1 HAS COLLIDED CAUSING DAMAGE AND INJURY TO V2 AND P2. V1 MADE OFF AT SPEED FAILING TO LEAVE ANY DETAILS.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0829174

Location	South Tyneside A 19 433777E, 563475N	Date/Time	Thursday 04 April 2019 07:50
Road	Slip Road 70	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Nervous, uncertain or panic (A)

Vehicle 1

Driver	Male, 55 Negative Postcode: YO8 4LB Journey as part of work	Vehicle	Goods vehicle 7.5 tonnes mgw and over No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 54 Negative Postcode: DH4 7RY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Female	54	Not a bus or coach passenger
DH4 7RY		

***Description
of Location***

A19 - 32 METRES FROM JUNCTION WITH LEAM LANE (A194)

***Description
of Accident***

VEHICLE 2 HAS BEEN APPROACHING THE ROUNDABOUT AND HAS BEEN SLOWING DOWN TO GIVE WAY. VEHICLE 1 WAS TRAVELLING BEHIND, THE DRIVER OF VEH 1 HAS STATED THAT SHE STARTED TO BRAKE BUT HER FOOT SLIPPED SHE THEN COLLIDED INTO THE REAR OF VEHICLE 2 CAUSING DAMAGE TO BOTH VEHICLES. DRIVER OF VEH 2 SUFFERED PAIN TO HER CHEST FROM THE AIRBAG BEING ACTIVATED, SHE WAS TAKEN TO SOUTH TYNESIDE HOSPITAL FOR CHECKS

Slight Accident

Involving 2 Vehicle, 2 Casualties

0829600

Location	South Tyneside A 194 433793E, 563606N	Date/Time	Friday 05 April 2019 14:30
Road	Roundabout 30	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, 45 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 29 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 29	Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 28

Not a bus or coach passenger

DH2 2LG

Description of Location

LEAM LANE (A194) NEAR JUNCTION WITH A19

Description of Accident

VEH 2 WAS DRIVING IN THE OUTSIDE LANE OF A 2 LANE ROUNDABOUT, VEH1 INDICATED TO MOVE LEFT INTO THE OUTSIDE LANE BUT DRIFTED AND COLLIDED WITH ITS NEARSIDE INTO VEH2 OFFSIDE, VEH2 DROVE FORWARD INTO A LAYBY AND WATCHED VEH1 INDICATE AND TURN ONTO A19 WITHOUT STOPPING

Serious Accident

Involving 1 Vehicle, 3 Casualties

0811764

Location	South Tyneside A 1018 436595E, 566798N	Date/Time	Wednesday 30 January 2019 15:47
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None Control by school crossing patrol Central refuge - no other controls	Contributory	Failed to look properly (A) Disobeyed pedestrian crossing facility (A) Distraction outside vehicle (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 39 Negative Postcode: NE33 4EF Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	Bus Lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Pedestrian		In carriageway, crossing elsewhere
Male	35	Crossing from driver's offside
NE34 0AE		East

Casualty 2 - Serious

Pedestrian		In carriageway, crossing elsewhere
Male	7	Crossing from driver's offside
NE33 5DH		East

Casualty 3 - Slight

Vehicle or pillion passenger		Not a car passenger
Male	70	Standing passenger

Description of Location WESTOE ROAD (A1018) - 29 METRES FROM JUNCTION WITH CROSSGATE (A1018)

Description of Accident VEH 1 TRAVELS SOUTH ALONG WESTOE ROAD SOUTH SHIELDS. PEDESTRIANS CROSSING ROAD USING SCHOOL CROSSING PATROL. VEH 1 FAILS TO SEE PERSONS CROSSING ROAD AND COLLIDES WITH PERSONS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0828594

Location	South Tyneside A 194 433870E, 563602N	Date/Time	Thursday 28 March 2019 07:36
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Sudden braking ()

Vehicle 1

Driver	Female, 64 Negative Postcode: NE32 5AF Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 56 Negative Postcode: NE31 1NZ Commuting to/from work	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 56	Not a bus or coach passenger
NE31 1NZ	

***Description
of Location***

LEAM LANE (A194) - 153 METRES FROM JUNCTION WITH HADRIAN ROAD

***Description
of Accident***

VEHICLE 1 HAS BEEN STATIONARY AT THE TRAFFIC LIGHT JUNCTION WAITING TO MOVE OFF ONTO THE ROUNDABOUT JUNCTION. VEHICLE 2 HAS BEEN A SHORT DISTANCE BEHIND VEHICLE ALSO WAITING FOR THE TRAFFIC LIGHTS TO CHANGE AND MOVE INTO THE JUNCTION. AS THE TRAFFIC LIGHTS HAVE CHANGED TO GREEN VEHICLE 1 HAS BEGAN TO MOVE OFF ONTO THE ROUNDABOUT BUT HAS SUDDENLY BARAKED DUE TO HEARING THE SOUND OF AN EMERGENCY VEHICLES SIRENS AND HAVING SEEN THE EMERGENCY VEHICLE ENTER THE ROUNDABOUT A DISTANCE AWAY. VEHICLE 2 H

Slight Accident

Involving 2 Vehicle, 1 Casualty

0825888

Location	South Tyneside B 1298 436235E, 564874N	Date/Time	Sunday 24 March 2019 06:15
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 25 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from North West to North West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 52 Not requested Postcode: NE33 2NT Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	52	Not a bus or coach passenger
NE33 2NT		

<i>Description of Location</i>	STANHOPE ROAD (B1298) AT JUNCTION WITH TALBOT ROAD
<i>Description of Accident</i>	DRIVER OF V1 HAS PULLED OUT OF TALBOT ROAD ONTO STANHOPE ROAD. V2 HAS COLLIDED WITH THE REAR OFFSIDE OF V1.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0830803

Location	South Tyneside A 1018 436945E, 565958N	Date/Time	Wednesday 10 April 2019 16:00
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Male, 87 Not requested Postcode: NE34 6RN Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from South to North Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 50 Not applicable Postcode: NE34 7TL Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	50	Not a bus or coach passenger
NE34 7TL		

***Description
of Location***

IMEARY STREET (A1018) NEAR JUNCTION WITH SUNDERLAND ROAD (A1018)

***Description
of Accident***

VEHICLE 1 HAS EXITED THE ROUNDABOUT ONTO IMEARY STREET AND COLLIDED WITH A PEDESTRAIN RIDING A BICYCLE WHO WAS CROSSING THE ZEBRA CROSSING

Serious Accident

Involving 2 Vehicle, 1 Casualty

0829924

Location	South Tyneside C 406 435223E, 563719N	Date/Time	Sunday 07 April 2019 13:26
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Disobeyed "Give Way" or "Stop" sign or markings (A) Failed to look properly (A)

Vehicle 1

Driver	Male, 8 Not requested Postcode: Other	Vehicle	Electric Motorcycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 8	Not a bus or coach passenger

Vehicle 2

Driver	Male, 25 Negative Postcode: NE24 1PR Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

*Description
of Location*

WENLOCK ROAD AT JUNCTION WITH CLIVE STREET

*Description
of Accident*

IT APPEARS THAT VEHICLE 1 A MINI MOTO RIDDEN BY THE IP HAS ENTERED WENLOCK ROAD FROM CLIVE STREET WITHOUT GIVING WAY. V2 HAS BEEN TRAVELLING UP WENLOCK ROAD IN A SOUTHERLY DIRECTION APPROACHING JUNCTION WITH CLIVE STREET TO THE NEAR SIDE. V1 HAS THEN COLLIDED WITH V2 CAUSING DAMAGE TO V1 AND INJURY TO IP.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0841557

Location	South Tyneside A 194 436239E, 566559N	Date/Time	Tuesday 21 May 2019 15:30
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 41 Not applicable Postcode: NE29 0EN Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 50 Not applicable Postcode: NE33 4JX Journey as part of work	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	50	Not a bus or coach passenger
NE33 4JX		

*Description
of Location*

WESTERN APPROACH (A194) - 121 METRES FROM JUNCTION WITH TUDOR ROAD

*Description
of Accident*

V2 VOLKSWAGEN CADDY TRAVELING NORTH ON WESTERN APPROACH SOUTH SHIELDS SOUTH TYNESIDE. V1 VOLVO S40 COLLIDES WITH REAR OF V2 CAUSING MINOR DAMAGE TO REAR BUMPER AND SLIGHT INJURY WHIPLASH TO DRIVER OF V2 ALL DETAILS EXCHANGED AT SCENE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0841919

Location	South Tyneside A 1300 436093E, 563748N	Date/Time	Wednesday 22 May 2019 13:12
Road	Roundabout 50	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 22 Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 32 Not applicable Postcode: NE34 0HT Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from East to West No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 30	Not a bus or coach passenger

Casualty 1 - Slight

Vehicle or pillion passenger

Rear seat passenger

Female

56

Not a bus or coach passenger

Description of Location

JOHN REID ROAD (A1300) - 27 METRES FROM JUNCTION WITH WHITELEAS WAY (B1298)

Description of Accident

V2 WAS TRAVELLING ON THE JOHN REID ROAD HEADING TOWARDS THE JUNCTION RAB WITH WHITELEAS WAY/BOLDON LANE. V2 HAS APPROACHED THE RAB,PAST THE FIRST EXIT TO HER NEAR SIDE (WHITELEAS WAY). V2 WAS IN THE INNER LANE OF TWO WISHING TO GO STRAIGHT AHEAD (TOWARDS THE LEAM LANE ROAD). V1 HAS APPROACHED THE SAME RAB FROM WHITELEAS WAY,INTENDING TO GO STRAIGHT AT THE RAB TOWARDS BOLDON LANE. AS V1 HAS ENTERED THE RAB HEADING TO GO STRAIGHT ON V1 FRONT HAS COLLIDED WITH V2 NEAR SIDE REAR PANEL. BOTH V1 & V2 S

Slight Accident

Involving 1 Vehicle, 1 Casualty

0838023

Location	South Tyneside C 408 436890E, 564875N	Date/Time	Thursday 09 May 2019 15:30
Road	Single Carriageway 20	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None Control by school crossing patrol No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 41 Not applicable Postcode: NE34 9EA Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In centre of carriageway, not on refuge, central island or central reservation
Female	12	Crossing from driver's nearside
NE34 9SZ		North West

Description of Location	TEMPLE PARK ROAD - 43 METRES FROM JUNCTION WITH ULLSWATER GARDENS

Description of Accident	PEDESTRIAN HAS FINISHED SCHOOL AND WALKED ON TEMPLE PARK ROAD TOWARDS THE GREY HEN PUBLIC HOUSE. IP CROSSED THE ROAD BY STEPPING OUT BETWEEN STATIC CARS AND IN TO THE PATH OF VEHICLE 1. IP SUFFERED CUTS AND BRUISES AND SORENESS TO HER WRIST

Slight Accident

Involving 1 Vehicle, 1 Casualty

0833246

Location	South Tyneside C 406 435127E, 563913N	Date/Time	Monday 22 April 2019 10:28
Road	Single Carriageway 20	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Crossing road masked by stationary or parked vehicle (A)

Vehicle 1

Driver	Female, 36 Negative Postcode: NE34 9FF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male 26	Crossing from driver's nearside - masked by parked or stationary vehicle
NE34 9BA	West

Description of Location WENLOCK ROAD - 50 M NORTH OF DAME FLORA ROBSON AVENUE

Description of Accident V1 IS TRAVELLING SOUTH ON WENLOCK ROAD, SOUTH SHIELDS AND FOR REASONS TO BE ESTABLISHED PED 1 STEPS OUT FROM THE NEARSIDE KERB, BETWEEN PARKED CARS AND INTO THE PATH OF ONCOMING V1. PED 1 IS COMPLAINING OF PAINS TO HIS HIP AND LEG.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0842630

Location	South Tyneside B 1298 436501E, 566189N	Date/Time	Monday 27 May 2019 23:03
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 43 Negative Postcode: NE33 4QL Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead right hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 38 Negative Postcode: NE34 9BA Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead left hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 55	Seated passenger
NE34 8NB	

***Description
of Location***

CHICHESTER ROAD (B1298) - 26 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

V2 WAS TRAVELLING ALONG THE B1298 CHICHESTER ROAD TOWARDS THE ROUNDABOUT JUNCTION WITH THE B1301 DEAN ROAD. FOR REASONS YET TO BE ESTABLISHED V1 WAS TRAVELLING TOWARDS V2 ON THE WRONG SIDE OF THE ROAD WHICH RESULTED IN A COLLISION BETWEEN BOTH VEHICLES.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0840071

Location	South Tyneside A 1300 436738E, 564005N	Date/Time	Sunday 12 May 2019 20:55
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Disobeyed pedestrian crossing facility (B) Failed to look properly (B) Careless, reckless or in a hurry (B) Impaired by alcohol (A) Impaired by drugs (illicit or medicinal) (A) Wrong use of pedestrian crossing facility (B)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing on pedestrian crossing facility
Male 37	Crossing from driver's nearside
NE34 8ND	South

Description of Location	JOHN REID ROAD (A1300) - 24 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident	MALE PEDESTRIAN WALKING SOUTH AT TRAFFIC LIGHTS ON THE EASTBOUND CARRIAGEWAY OF THE JOHN REID ROAD SOUTH SHIELDS. VEH 1 TRAVELLING EAST COLLIDES WITH PEDESTRIAN CAUSING MINOR INJURY TO SHINS.VEH 1 MAKES OFF FROM SCENE.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0820130

Location	South Tyneside B 1298 436503E, 565941N	Date/Time	Thursday 28 February 2019 17:55
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal
Conditions	Darkness - Street Lighting Unknown Raining without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 77 Not applicable Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	11	Crossing from driver's offside
NE33 4EF		North

Description of Location CHICHESTER ROAD (B1298) NEAR JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident IP HAS STEPPED OUT IN FRONT OF TRAFFIC WITHOUT LOOKING, DRIVER HAS STOPPED DIDN'T BELIEVE HE HAD HIT IP AND IP HAS THEN DRIVEN OFF.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0849411

Location	South Tyneside A 1300 435557E, 563593N	Date/Time	Saturday 15 June 2019 20:30
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 44 Not applicable Postcode: NE34 9SS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	44	Not a bus or coach passenger
NE34 9SS		

Casualty 2 - Slight

Vehicle or pillion passenger

Not a car passenger

Female 19

Not a bus or coach passenger

NE34 9SS

Description of Location

JOHN REID ROAD (A1300) - 50 METRES FROM JUNCTION WITH CHESTERTON ROAD (A1300)

Description of Accident

DRIVER OF VEHICLE 2 (ANNE) STATES SHE WAS TRAVELLING AT 40MPH ON THE JOHN REID ROAD IN THE OFFSIDE LANE, APPROACHING THE TRAFFIC LIGHTS WITH CHESTERTON ROAD ON THE RIGHT, TRAVELLING IN A NORTH EAST DIRECTION. SHE FELT A THUD AND THOUGHT HER TYRE HAD POPPED AS LOST CONTROL OF THE WHEEL OF THE VEHICLE, HOWEVER SHE SAW VEHICLE 1 HAD WENT INTO THE BACK OF HER VEHICLE, THE DRIVER THEN SWERVED INTO THE NEAR SIDE LANE, OVERTOOK VEHICLE 2 AND DROVE OFF WITHOUT STOPPING OR EXCHANGING DETAILS, SHE BELIEVE

Slight Accident

Involving 2 Vehicle, 1 Casualty

0850888

Location	South Tyneside A 194 435894E, 565204N	Date/Time	Thursday 20 June 2019 06:50
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to South East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 52 Not applicable Postcode: Commuting to/from work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 52	Not a bus or coach passenger

***Description
of Location***

WESTERN APPROACH (A194) NEAR JUNCTION WITH DEAN ROAD

***Description
of Accident***

ON THE 20TH JUNE 2019 AT 0650 HOURS VEHICLE 1 WAS ON THE ROUNDABOUT TRAVELLING SOUTH EAST TOWARDS WEST WAY, JARROW FROM DEAN ROAD WHEN VEHICLE 2 HAS BEEN TRAVELLING HAS BEEN TRAVELLING EAST FROM DEAN ROAD TOWARDS THE A194. IT HAS BEEN ON THE ROUNDABOUT THAT VEHICLE 1 HAS COLLIDED WITH VEHICLE 2 CAUSING THE RIDER TO FALL TO THE GROUND AND SUSTAIN INJURIES. VEHICLE 1 THEN MAKES OFF WITHOUT STOPPING, EXCHANGING DETAILS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0852222

Location	South Tyneside 436471E, 564190N	Date/Time	Sunday 23 June 2019 18:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 11 Not applicable Postcode: NE34 6QA Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 11	Not a bus or coach passenger
NE34 6QA	

Vehicle 2

Driver	Female, 39 Not applicable Postcode: NE34 0YH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

<i>Description of Location</i>	THE WYNDE AT JUNCTION WITH HIGH MOOR PLACE
<i>Description of Accident</i>	PEDAL CYCLIST ON PAVEMENT APPROACHES A JUNCTION AND RIDES OUT ONTO THE ROAD. VEHICLE 2 ON THE ROAD IMPACTS THE PEDAL CYCLE

Slight Accident

Involving 2 Vehicle, 3 Casualties

0855410

Location	South Tyneside A 194 433775E, 563504N	Date/Time	Monday 08 July 2019 17:20
Road	Roundabout 40	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Emergency vehicle on a call (B)

Vehicle 1

Driver	Male, 26 Negative Postcode: NE35 9AZ Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 47 Negative Postcode: NE32 4SZ Journey as part of work	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 32	Not a bus or coach passenger
NE34 8FS	

Casualty 3 - Slight

Vehicle or pillion passenger

Male 48

NE34 8FS

Not a car passenger

Not a bus or coach passenger

Casualty 1 - Slight

Vehicle or pillion passenger

Male 45

NE34 8FS

Not a car passenger

Not a bus or coach passenger

Description of Location

LEAM LANE (A194) AT JUNCTION WITH A19

Description of Accident

V2 (FIRE APPLIANCE ON EMERGENCY CALL) TRAVELLING WEST ON RAB IN LANE 1, V2 SLOWS DISPLAYING LIGHTS AND SIRENS AND PASSES THROUGH RED TRAFFIC SIGNAL. V1 TRAVELLING NORTH ON SLIP ROAD ENTERS RAB, FAILS TO OBSERVE V2 WHICH COLLIDE. DRIVER OF V1 INITIALLY LEAVES SCENE THEN RETURNS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0859818

Location	South Tyneside A 19 433723E, 563932N	Date/Time	Saturday 20 July 2019 14:49
Road	Slip Road 70	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Female, 35 Not applicable Postcode: NE29 8RR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 55 Not applicable Postcode: DH4 7DH Commuting to/from work	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	55	Not a bus or coach passenger
DH4 7DH		

<i>Description of Location</i>	A19
<i>Description of Accident</i>	V1 IN MAIN CARRIGEWAY APPROACHES QUEUE OF TRAFFIC DUE TO ROADWORKS. V2 TRAVELLING IN LANE 1 TAKES SLIP ROAD INTENDING TO TRAVEL TO ROUNDABOUT. V1 TURNS FROM LANE 1 CROSSING HATCHED AREA ON TO LANE 2 OF SLIP ROAD AND IN TO PATH OF V2. V2 UNABLE TO STOP COLLIDES WITH REAR OF V1

Slight Accident

Involving 2 Vehicle, 1 Casualty

0859949

Location	South Tyneside B 1301 436371E, 566009N	Date/Time	Thursday 18 July 2019 15:20
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 19 Not applicable Postcode: NE33 4RG Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Changing lane to right Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	19	Not a bus or coach passenger
NE33 4RG		

***Description
of Location***

LAYGATE (B1301) - 53 METRES FROM JUNCTION WITH LAYGATE (B1301)

***Description
of Accident***

V2 APOLLO PEDAL CYCLIST CROSSING AT TRAFFIC LIGHTS ON LAYGATE SOUTH SHIELDS SOUTH TYNESIDE. V1 U/K VRM BLACK M/V COLLIDES WITH PEDAL CYCLIST KNOCKING CYCLIST FROM HIS BIKE CAUSING INJURY TO CYCLIST GRAZE/CUT TO RIGHT HAND AND BUMP TO HEAD. V1 STOPPED AND MALE DRIVER ASKED IF CYCLIST WAS OK BUT FAILED TO EXCHANGE DETAILS. IP ATTENDED SOUTH TYNESIDE HOSPITAL TO GET CHECKED OVER NO CONCERNS.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0862110

Location	South Tyneside A 194 436274E, 566647N	Date/Time	Monday 22 July 2019 18:16
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Male, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 32 Not applicable Postcode: NE33 4AL Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	32	Not a bus or coach passenger
NE33 4AL		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Male 32

Not a bus or coach passenger

NE33 4AL

Description of Location

CROSSGATE (A194) NEAR JUNCTION WITH WESTERN APPROACH (A194)

Description of Accident

V2 HAS BEEN TRAVELLING WEST ON CROSSGATE FOLLOWED BY V1. V2 HAS SLOWED AT RAB WITH WESTERN APPROACH TO TURN RIGHT. V1 HAS COLLIDED INTO THE REAR OF V2 CAUSING DAMAGE. DRIVER OF V1 HAS STOPPED BRIEFLY BEFORE MAKING OFF SOUTH ON WESTERN APPROACH WITHOUT LEAVING DETAILS. AS A RESULT OF THE INCIDENT THE OCCUPANTS OF V2 HAVE SUFFERED WHIPLASH INJURIES, THEY HAVE NOT ATTENDED A HOSPITAL BUT THE MOTHER OF THE DRIVER OF V2 IS A NURSE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0863033

Location	South Tyneside A 1018 437465E, 564104N	Date/Time	Monday 29 July 2019 16:52
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Female, 56 Negative Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	Bus Lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 15 Not applicable Postcode: Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	Bus Lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Going ahead other Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	15	Not a bus or coach passenger

***Description
of Location***

KING GEORGE ROAD (A1018) - 45 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

APPARENTLY V2 CYCLIST WAS SWERVING WHILST RIDING ALONG BUS LANE AND HAS VEERED IN TO PATH OF V1 BUS AS IT WAS MOVING PAST HIM

Slight Accident

Involving 3 Vehicle, 2 Casualties

0866972

Location	South Tyneside A 185 434824E, 564807N	Date/Time	Tuesday 06 August 2019 13:45
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Slippery road (due to weather) (A) Following too close (A)

Vehicle 1

Driver	Female, 51 Negative Postcode: NE26 3AA Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	51	Not a bus or coach passenger
NE26 3AA		

Vehicle 2

Driver	Female, 35 Negative Postcode: NE32 3LD Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver	Male, 52
	Negative
	Postcode: NE33 1TT
	Not known
Collisions	Hit no other vehicle
	Back
	None
	None

Vehicle	Taxi/Private hire car
	No tow or articulation
Location	On main carriageway - not in restricted lane
	Not at, or within 20 metres of junction
Movement	Vehicle moving from South to North
	Waiting to go ahead but held up
	No skidding, jack-knifing or overturning
	Did not leave carriageway

Casualty 2 - Slight

Driver or rider		Not a car passenger
Male	52	Not a bus or coach passenger
NE33 1TT		

Description of Location	JARROW ROAD (A185) - 25 METRES FROM JUNCTION WITH BEDESWAY

Description of Accident	V3 (FP07 XTF) WAS TRAVELLING ON JARROW ROAD HEADING NORTH, V3 HAS APPLIED HIS BRAKES AS A VEHICLE IN FRONT TURNED LEFT ONTO BEDESWAY FROM JARROW ROAD, V2 (BK14 KLJ) BEHIND V3 HAS APPLIED HER BRAKES STOPPING, THEN V1 (NA66 VLL) WHICH WAS BEHIND V2 HAS COLLIDED WITH V2'S REAR CAUSING V2 TO BE SHUNTED INTO V3'S REAR.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0867053

Location	South Tyneside C 414 436188E, 564266N	Date/Time	Wednesday 07 August 2019 16:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 53 Not applicable Postcode: NE37 2QZ Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Vehicle or pillion passenger	Not a car passenger
Female 80	Alighting
NE34 0XR	

Description of Location	HARTON LANE - 29 METRES FROM JUNCTION WITH WEAR COURT

Description of Accident	VEHICLE 1, PSV, PULLS AWAY FROM BUS STOP WHILST CASUALTY STILL GETTING TO DOOR TO ALIGHT CAUSING CASUALTY TO FALL SUFFERING INJURIES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0843433

Location	South Tyneside 436337E, 565468N	Date/Time	Friday 24 May 2019 18:13
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 19 Driver not contacted at time of accident Postcode: NE34 0QH Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South East to North West Overtaking moving vehicle on its offside Skidded Left carriageway offside

Vehicle 2

Driver	Male, 22 Not requested Postcode: NE34 8HY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Leaving main road
		Movement	Vehicle moving from South East to North East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	22	Not a bus or coach passenger
NE34 8HY		

***Description
of Location***

WEST PARK ROAD JUNCTION WITH CLIFTON TERRACE

***Description
of Accident***

VEHICLE 2 WAS TRAVELLING NORTH WEST ALONG WEST PARK ROAD WHEN HE HAS INDICATED TO TURN RIGHT ON TO CLIFTON TERRACE. AS HE WAS TURNING RIGHT, VEHICLE 1 HAS APPROACHED FROM BEHIND AT SPEED, OVERTOOK HIM ON VEHICLE 2'S OFFSIDE CAUSING A COLLISION. VEHICLE 1 OFFENDERS MAKE OFF.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0870161

Location	South Tyneside A 1018 437329E, 564841N	Date/Time	Monday 19 August 2019 15:41
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 414
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Male, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 22 Not applicable Postcode: NE33 3BU Not known	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South East to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	22	Not a bus or coach passenger
NE33 3BU		

*Description
of Location*

KING GEORGE ROAD (A1018) AT JUNCTION WITH HARTON LANE

*Description
of Accident*

V2 WAS TRAVELLING NORTH ON THE A1018 WHEN HAVING ENTERED THE ROUNDABOUT J/W HARTON LANE V1 HAS PULLED OUT FROM HARTON LANE INTO HIS PATH, V2 HAS THEN COLLIDED WITH V1 CAUSING DAMAGE AND INJURY AS SHOWN.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0870632

Location	South Tyneside B 1302 435675E, 564775N	Date/Time	Tuesday 20 August 2019 19:30
Road	Single Carriageway 30	Junction	Crossroads Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South East to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 42 Not applicable Postcode: NE34 9LF Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	42	Not a bus or coach passenger
NE34 9LF		

***Description
of Location***

BOLDON LANE (B1302) NEAR JUNCTION WITH HUDSON STREET

***Description
of Accident***

FWIN 430 21/08/19 V2 HAS BEEN STATIONARY AT THE TRAFFIC LIGHTS WHEN V2 HAS COLLIDED WITH THE REAR OF V1. V2 DROVE OFF HOWEVER V2 FOLLOWED AND CAUGHT UP WITH DRIVER AND GOT DETAILS.

Serious Accident

Involving 1 Vehicle, 1 Casualty

0870785

Location	South Tyneside A 194 435491E, 564963N	Date/Time	Thursday 22 August 2019 22:20
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside Kerb None	Location	Footway (pavement) Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Overtaking on nearside Skidded Left carriageway offside

Casualty 1 - Serious

Pedestrian		On footway or verge
Female	35	Unknown or other
		North

Description of Location	WESTERN APPROACH (A194)
Description of Accident	VEHICLE 1 DRIVES AROUND ROUNDABOUT AT SPEED LOSES CONTROL AND MOUNTS PAVEMENT COLLIDING WITH PEDESTRAIN

Slight Accident

Involving 2 Vehicle, 1 Casualty

0873077

Location	South Tyneside B 1298 436570E, 565764N	Date/Time	Friday 30 August 2019 15:00
Road	Single Carriageway 30	Junction	T or staggered junction Automatic traffic signal C 413
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 27 Not applicable Postcode: Not known	Vehicle	Motorcycle - Unknown cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Overtaking moving vehicle on its offside No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 37 Not applicable Postcode: NE33 5QD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	37	Not a bus or coach passenger
NE33 5QD		

*Description
of Location*

STANHOPE ROAD (B1298) NEAR JUNCTION WITH MORTIMER ROAD

*Description
of Accident*

VEHICLE 1 WHICH IS A MOTORCYCLE HAS COLLIDED WITH THE REAR OFFSIDE OF VEHICLE 2 AS VEHICLE 2 HAS INDICATED TO TURN RIGHT THEN DRIVEN OFF

Slight Accident

Involving 2 Vehicle, 1 Casualty

0873159

Location	South Tyneside A 1300 436899E, 564053N	Date/Time	Friday 30 August 2019 20:37
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 12 Not applicable Postcode: NE34 7DY Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North West Going ahead other Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 12	Not a bus or coach passenger
NE34 7DY	

Vehicle 2

Driver	Female, 44 Not applicable Postcode: NE34 9SZ Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

JOHN REID ROAD (A1300)

***Description
of Accident***

V2 TRAVELLING SOUTH ALONG JOHN REID ROAD.. V1 COME FROM PAVEMENT TO EAST SIDE OF ROAD DIRECTLY INTO PATH OF V2 WIHTOUT STOPPING OR LOOKING. (CONFIRMED BY INDEPENDANT WITNESS WATSON) V2 COLLIDE WITH REAR WHEEL OF V1 KNOCKING RIDER OF V1 FROM BIKE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0867355

Location	South Tyneside 435246E, 563781N	Date/Time	Thursday 08 August 2019 18:30
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 25 Not applicable Postcode: Not known	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to North West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Vehicle or pillion passenger	
Female	32
NE34 9RX	
	Not a car passenger
	Not a bus or coach passenger

Vehicle 2

Driver	Female, 32 Not applicable Postcode: NE34 9QR Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	
Female	32
NE34 9QR	
	Not a car passenger
	Not a bus or coach passenger

***Description
of Location***

MADRAS STREET - 37 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

V2 PARKED SECURE AND UNDAMAGED ON MADRAS STREET SOUTH SHIELDS WHEN V1 HAS COLLIDED WITH V2 DAMAGING
SAME

Slight Accident

Involving 2 Vehicle, 1 Casualty

0873728

Location	South Tyneside A 194 433740E, 563536N	Date/Time	Monday 02 September 2019 07:00
Road	Roundabout 40	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 47 Not applicable Postcode: NE34 6JP Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 50 Not applicable Postcode: NE34 6PF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	50	Not a bus or coach passenger
NE34 6PF		

***Description
of Location***

LEAM LANE (A194) NEAR JUNCTION WITH LINDISFARNE ROAD

***Description
of Accident***

VEHICLE 2 TRAVELLING WEST AT LINDISFARNE ROUNDABOUT, AS TRAFFIC LIGHTS TURN GREEN VEHICLE 2 PULLS AWAY WHEN VEHICLE 1 COLLIDES WITH FRONT OFF SIDE WING. BOTH PARTIES REMAIN AT SCENE, ALL DETAILS EXCHANGED.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0875026

Location	South Tyneside 436828E, 565458N	Date/Time	Thursday 05 September 2019 08:35
Road	Single Carriageway 20	Junction	Crossroads Give way or uncontrolled C 413
Conditions	Daylight - Street Lights Present Unknown Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 64 Driver not contacted at time of accident Postcode: NE34 6RH Not known	Vehicle	Taxi/Private hire car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	11	Crossing from driver's offside
		Unknown

Description of Location	READING ROAD NEAR JUNCTION WITH HEPSCOTT TERRACE

Description of Accident	V1 HAD TURNED LEFT INTO READING ROAD WHEN PI IN COMPANY WITH A GROUP OF OTHER SCHOOL CHILDREN RAN FROM THE O/S FOOTPATH. ALL OF THE GROUP STOPPED IN THE MIDDLE OF THE ROADWAY APART FROM PI 1 WHO ATTEMPTED TO DO SO BUT SKIDDED INTO THE PATH OF V1 STRIKING THE FRONT O/S OF THE VEHICLE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0875899

Location	South Tyneside A 1300 435585E, 563584N	Date/Time	Sunday 08 September 2019 16:00
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 12 Not applicable Postcode: NE34 9HU Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	12	Not a bus or coach passenger
NE34 9HU		

***Description
of Location***

JOHN REID ROAD (A1300) - 26 METRES FROM JUNCTION WITH CHESTERTON ROAD

***Description
of Accident***

ON THE 08TH SEPTEMBER 2019 AT 1600 HOURS VEHICLE 2 HAS BEEN TRAVELLING FROM BROCKLEY AVENUE TOWARDS THE NEW MILL INN CROSSING THE A1300 JOHN REID ROAD, SOUTH SHIELDS. IT HAS BEEN AT THIS TIME AND PLACE VEHICLE 1 HAS BEE TRAVELLING EAST TO WEST ON JOHN REID ROAD KNOCKING THE RIDER OF VEHICLE 2 TO THE GROUND CAUSING DAMAGE AND INJURY. VEHICLE 1 HAS THEN MADE OFF AT SPEED WITHOUT MAKING SURE THE RIDER WAS OK AND PROVIDING DETAILS.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0832631

Location	South Tyneside 435834E, 564025N	Date/Time	Wednesday 17 April 2019 15:25
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled C 406
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 48 Not applicable Postcode: NE38 9ET Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Male 21	Crossing from driver's offside
NE34 9TW	East

Description of Location REAY PLACE NEAR JUNCTION WITH GREEN LANE

Description of Accident PED WALKING ALONG GREEN LANE PUSHING HIS PUSH BIKE, V1 PULLING UP TO THE JUNCTION OF GREEN LANE, ALONG REAY PLACE. PED STEPPED INTO THE ROAD IN FRONT OF V1 AND HIT ON HIS RIGHT SIDE BY THE FRONT NEARSIDE CORNER OF V1. PED CHECKED BY PARAMEDICS AND TAKEN TO HOSPITAL, WALKING WOUNDED.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0400213

Location	South Tyneside A 1300 436185E, 563801N	Date/Time	Tuesday 24 September 2019 16:22
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 44 Not applicable Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other Skidded Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 44	Not a bus or coach passenger

**Description
of Location** JOHN REID ROAD (A1300)

**Description
of Accident** ROAD WAS WET, VEHICLE LOST TRACTION ON THE ROAD AND SKIDDED INTO THE BUSHES

Slight Accident

Involving 1 Vehicle, 1 Casualty

0883853

Location	South Tyneside A 194 434534E, 564113N	Date/Time	Tuesday 01 October 2019 19:00
Road	Dual Carriageway 60	Junction	Other junction Automatic traffic signal
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, Not applicable Postcode: Not known	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Female	15	Crossing from driver's nearside
NE31 2AG		East

Description of Location NEWCASTLE ROAD (A194) NEAR JUNCTION WITH SHAFTESBURY AVENUE

Description of Accident FWIN 1157 01/10/19 P2 HAS BEEN CROSSING THE ROAD ON NEWCASTLE ROAD WHEN V1 HAS COME ROUND THE CORNER AND COLLIDED WITH HER CAUSING MINOR INJURY THE DRIVER P1 GOT OUT ASKED IF SHE WAS OK THEN LEFT LEAVING NO DETAILS FAILING TO REPORT.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0886735

Location	South Tyneside A 194 435918E, 565515N	Date/Time	Wednesday 09 October 2019 13:50
Road	Roundabout 60	Junction	Mini roundabout Give way or uncontrolled C 407
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Not applicable Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 26 Not applicable Postcode: NE34 9TD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	26	Not a bus or coach passenger
NE34 9TD		

***Description
of Location***

WESTERN APPROACH (A194) NEAR JUNCTION WITH BARNES ROAD

***Description
of Accident***

V2 TRAVELLING SOUTH WEST IN INSIDE LANE. ON EXITING THE ROUNDABOUT V1 HAS FAILED TO SEE V2 AND ENTERED THE LANE. THE FRONT NEARSIDE OF V1 COLLIDED WITH THE REAR OFFSIDE OF V2. BOTH DRIVERS STOPPED AT SCENE AND EXCHANGED DETAILS. THE DRIVER OF V2 SUFFERED MINOR INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0888631

Location	South Tyneside A 19 433305E, 564929N	Date/Time	Wednesday 16 October 2019 14:20
Road	Dual Carriageway 30	Junction	T or staggered junction Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Poor turn or manoeuvre (A) Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 39 Negative Postcode: SR4 9HU Journey as part of work	Vehicle	Goods vehicle over 3.5 tonnes and under 7.5 tonnes mgw Articulated Vehicle
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 55 Not provided (medical reasons) Postcode: NE24 5LH Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	55	Not a bus or coach passenger
NE24 5LH		

*Description
of Location*

A19 NEAR JUNCTION WITH A19

*Description
of Accident*

VEH 2 TRAVELLING NORTH ON A19 TOWARDS TYNE TUNNEL VEH 1 ALSO TRAVELLING NORTH BEHIND VEH 2. VEH 2 SLOWS AND STOPS FOR TRAFFIC LIGHT AT ENTRANCE TO TYNE TUNNEL. VEH 1 FAILS TO NEGOTIATE STATIONARY VEH 2 COLLIDING INTO THE REAR OF THE VEHICLE CAUSING DAMAGE AND MINOR INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0889753

Location	South Tyneside 435899E, 564432N	Date/Time	Thursday 17 October 2019 17:50
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 61 Driver not contacted at time of accident Postcode: NE34 6PY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to North Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 16 Not applicable Postcode: NE34 0TN Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	16	Not a bus or coach passenger
NE34 0TN		

*Description
of Location*

STANLEY STREET - 24 METRES FROM JUNCTION WITH ETHEL TERRACE

*Description
of Accident*

V1 HAS TURNED INTO LIDL SUPERMARKET CAR PARK AND COLLIDED WITH A CHILD ON A PEDAL CYCLE CROSSING FROM PAVEMENT AT THE ENTRANCE TO OTHER PAVEMENT, DRIVER OF V1 HAS STOPPED AND ASKED THE CHILD IF HE WAS OK TO WHICH THE CHILD HAS REPLIED YES, THE DRIVER OF V1 HAS THEN DRIVEN OFF.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0891239

Location	South Tyneside 435930E, 565920N	Date/Time	Wednesday 23 October 2019 06:58
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Failed to look properly (A) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 55 Negative Postcode: NE11 9JU Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other Overturned Left carriageway offside

Casualty 2 - Slight

Driver or rider		Not a car passenger
Male	55	Not a bus or coach passenger
NE11 9JU		

Vehicle 2

Driver	Female, 41 Negative Postcode: NE33 3BD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	41	Not a bus or coach passenger
NE33 3BD		

***Description
of Location***

SMITH STREET AT JUNCTION WITH LYONS WAY

***Description
of Accident***

VEHICLE 1 WAS TRAVELLING UP SOUTH ELDON STREET AND HAS FAILED TO STOP AT T JUNCTION WHEN COLLIDING WITH VEHICLE 2 WHO WAS TRAVELLING UP REED STREET TOWARDS WESTERN APPROACH. THE RESULTING COLLISION HAS CAUSED VEHICLE 1 TO FLIP ONTO ITS ROOF LANDING BACK ON ITS WHEELS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0858275

Location	South Tyneside A 1300 436764E, 564005N	Date/Time	Tuesday 16 July 2019 17:30
Road	Dual Carriageway 40	Junction	T or staggered junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, 20 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Kerb None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Overtaking stationary vehicle on its offside Skidded Left carriageway offside onto central reservation and rebounded

Vehicle 2

Driver	Female, 57 Not requested Postcode: NE34 9HA Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	57	Not a bus or coach passenger
NE34 9HA		

***Description
of Location***

JOHN REID ROAD NEAR JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

VEHICLE 1 PROCEEDED THROUGH A RED TRAFFIC LIGHT AT SPEED, COLLIDING WITH VEHICLE 2 THAT WAS LAWFULLY TURNING RIGHT ACCROSS THE CARRIAGE WAY FROM THE HOSPITAL.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0893123

Location	South Tyneside B 1301 436540E, 565890N	Date/Time	Monday 28 October 2019 11:44
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Female, Not applicable Postcode: NE33 4DN Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 29 Not applicable Postcode: NE33 5AW Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	29	Not a bus or coach passenger
NE33 5AW		

<i>Description of Location</i>	DEAN ROAD (B1301) - 33 METRES FROM JUNCTION WITH MILTON STREET
<i>Description of Accident</i>	VEH 2 GIVING WAY AT ZEBRA CROSSING ON DEAN STREET FOR PEDESTRIAN CROSSING. VEH 1 HAS GONE INTO THE BACK OF VEH 2 DAMAGING SAME AND CAUSING INJURY. DETAILS EXCHANGED

Slight Accident

Involving 2 Vehicle, 1 Casualty

0869815

Location	South Tyneside C 414 437199E, 564818N	Date/Time	Monday 19 August 2019 02:11
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lighting Unknown Unknown None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 20 Not requested Postcode: NE34 0RF Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle was Parked Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	20	Not a bus or coach passenger
NE34 0RF		

***Description
of Location***

HARTON LANE - 33 METRES FROM JUNCTION WITH WINDERMERE CRESCENT

***Description
of Accident***

WHILST PARKED IN HARTON LANE AT UNSPECIFIED LOCATION V2 DELIBERATELY DRIVES AT V1 WHILST PARKED WITH DRIVER STILL SEATED IN THE VEHICLE AND CAUSES DAMAGE AND INJURY AS SHOWN. V1 THEN DRIVES OFF.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0900625

Location	South Tyneside B 1301 436507E, 565879N	Date/Time	Sunday 17 November 2019 19:24
Road	Roundabout 30	Junction	Mini roundabout Give way or uncontrolled B 1298
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 45 Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 16 Not requested Postcode: Not known	Vehicle	Motorcycle 50cc and Under No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South West Turning right Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	16	Not a bus or coach passenger

***Description
of Location***

DEAN ROAD (B1301) AT JUNCTION WITH STANHOPE PARADE (B1298)

***Description
of Accident***

V2 WAS RIDING AND APPROACHED A MINI ROUNDABOUT, V2 WAS TURNING RIGHT AND PLANNED TO TAKE THE THIRD EXIT. AS HE WAS PASSING THE SECOND EXIT (STANHOPE PARADE) V1 HAD ENTERED THE RAB IN FRONT OF V2 AND TO AVOID A COLLISION V2 BRAKED ,SKIDDED AND RIDER FELL TO GROUND (SUFFERING MINOR INJURY). RIDER GOT UP AND RAN AFTER V1 WHERE V1 STOPPED AFTER A SHORT DISTANCE FROM THE INFO KNOWN AT THIS TIME POSSIBLY A MOMENTARY LACK OF CONCENTRATION FROM DRIVER V1 TO BLAME FOR THE INCIDENT

Slight Accident

Involving 2 Vehicle, 1 Casualty

0903497

Location	South Tyneside 434378E, 564714N	Date/Time	Wednesday 27 November 2019 11:46
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Unknown Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male	Not a bus or coach passenger

***Description
of Location***

BEDESWAY - 33 METRES FROM JUNCTION WITH MONKSWAY

***Description
of Accident***

VEHICLE 1 COLLIDES WITH PEDAL CYCLE CAUSING MINOR INJURY TO CYCLIST.

Serious Accident

Involving 1 Vehicle, 3 Casualties

0859294

Location	South Tyneside A 194 435316E, 564836N	Date/Time	Saturday 06 July 2019 04:19
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Exceeding speed limit (A) Aggressive driving (A) Poor turn or manoeuvre (A) Stolen Vehicle (A) Impaired by alcohol (B)

Vehicle 1

Driver	Male, 18 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None Lamp Post	Location	Footway (pavement) Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other Skidded and overturned Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 18	Not a bus or coach passenger

Casualty 2 - Serious

Vehicle or pillion passenger	Rear seat passenger
Male 19	Not a bus or coach passenger

Casualty 3 - Slight

Vehicle or pillion passenger	Front seat passenger
Male 19	Not a bus or coach passenger

Description of Location JARROW ROAD (A194)

Description of Accident VEHICLE 1 TRAVELLING FROM THE DIRECTION OF NEWCASTLE ROAD TOWARDS SOUTH SHIELDS TOWN CENTRE. VEHICLE APPEARS TO HAVE LOST CONTROL OPPOSITE SIMON SIDE SERVICE STATION, THE VEHICLE HAS CLIPPED THE CENTRAL RAISED AREA AND TURNED SIDEWAYS COLLIDING WITH AN ELECTRICAL BOX, THEN A LAMPOST CAUSING EXTENSIVE DAMAGE TO THE DRIVERS SIDE OF THE VEHICLE AND LAMPOST ITSELF.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0903185

Location	South Tyneside 434889E, 563950N	Date/Time	Wednesday 27 November 2019 16:21
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 49 Negative Postcode: NE34 9AR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North West Turning left No skidding, jack-knifing or overturning Left carriageway offside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 49	Not a bus or coach passenger
NE34 9AR	

Vehicle 2

Driver	Male, 36 Negative Postcode: NE32 4SY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Lamp Post	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside and rebounded

***Description
of Location***

STOKER AVENUE AT JUNCTION WITH BAINBRIDGE AVENUE

***Description
of Accident***

VEHICLE 1 HAS BEEN TURNING RIGHT OUT OF STOKER AVENUE ONTO BAINBRIDGE AVENUE IN THE DIRECTION OF DRUMMOND CRESCENT. THERE WAS A PARKED CAR ON THE NEAR SIDE, VEHICLE 1 HAS THEN DRIVEN FORWARD SLOWLY CROSSING ONTO THE WRONG SIDE OF THE ROAD. VEHICLE 2 IS WITNESSED TO BE DRIVING WITHOUT ANY LIGHTS ON AND THE WITNESS BELIEVES THE VEHICLE TO BE GOING EXCESSIVE SPEED FOR THE WET AND DARK CONDITIONS. BOTH VEHICLES COLLIDE HEAD ON VEHICLE 1 SPINS AND STOPS

Slight Accident

Involving 2 Vehicle, 2 Casualties

0908560

Location	South Tyneside 436460E, 566809N	Date/Time	Wednesday 11 December 2019 11:35
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 72 Not provided (medical reasons) Postcode: NE34 6AY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South East Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	72	Not a bus or coach passenger
NE34 6AY		

Casualty 2 - Slight

Vehicle or pillion passenger		Front seat passenger
Male	74	Not a bus or coach passenger

Vehicle 2

Driver	Male, 30 Negative Postcode: NE35 9HS Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

*Description
of Location*

ST HILDA STREET AT JUNCTION WITH GARDEN LANE

*Description
of Accident*

V2 WAS TRAVELLING SOUTH TOWARDS CROSSGATE WHEN V1 PULLED OUT FROM SAINT HILDA STREET COLLIDING WITH THE
FNS OF V2 CAUSING DAMAGE AND INJURY.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0909088

Location	South Tyneside A 1018 436650E, 566636N	Date/Time	Thursday 12 December 2019 18:20
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Darkness - Street Lights present but unlit Unknown Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Other (A)

Vehicle 1

Driver	Female, 44 Not provided (medical reasons) Postcode: SR2 0LU Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider	
Female	44
SR2 0LU	
	Not a car passenger
	Not a bus or coach passenger

Vehicle 2

Driver	Female, 62 Negative Postcode: NE34 7HZ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside Bollard/Refuge None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other Overturned Did not leave carriageway

***Description
of Location***

WESTOE ROAD (A1018) NEAR JUNCTION WITH DERBY TERRACE

***Description
of Accident***

V1 HEADING NORTH ON WESTOE RD IN SOUTH SHIELDS, V2 HEADING SOUTH ON WESTOE RD IN SOUTH SHIELDS. AS V1 APPROACHES V2, V1 VEERS TOWARD V2 AND MAKES CONTACT WITH THE REAR OFFSIDE OF V2 CAUSING IT TO SPIN AND FLIP ONTO ITS NEAR SIDE.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0909685

Location	South Tyneside A 1300 434910E, 563478N	Date/Time	Friday 13 December 2019 18:05
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 18 Not applicable Postcode: NE34 6PW Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South to North Going ahead other Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 18	Not a bus or coach passenger
NE34 6PW	

Vehicle 2

Driver	Male, 51 Driver not contacted at time of accident Postcode: NE34 9UA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

JOHN REID ROAD (A1300) AT JUNCTION WITH WINSKELL ROAD

***Description
of Accident***

V2 HAS BEEN ON A1300 JOHN REID ROAD TRAVELLING EAST IN LANE 2. AS HE WAS CROSSING RAB WITH DYKELANDS WAY V1 (PEDAL CYCLE) HAS CAME OFF THE CENTRE OF THE RAB AND COLLIDED INTO THE SIDE OF V2 CAUSING MINOR DAMAGE. THE DRIVER OF V2 HAS STOPPED TO CHECK ON THE WELFARE OF THE RIDER OF V1 AND CONFIRMED ANOTHER MOTORIST WAS CALLING AN AMBULANCE BEFORE MOVING HIS CAR AS HE WAS BLOCKING THE ROAD, THE DRIVER OF V2 LETER CALLED POLICE TO REPORT THE INCIDENT. AS A RESULT OF THE INCIDENT THE RIDER OF V1 HAS

Serious Accident

Involving 2 Vehicle, 1 Casualty

0900792

Location South Tyneside
B 1298
436018E, 564665N

Date/Time Wednesday
20 November 2019
17:25

Road Single Carriageway
30

Junction Crossroads
Give way or uncontrolled

Conditions Darkness - Street Lights present and lit
Fine without high winds
Wet/Damp
None
None

None within 50 metres
Central refuge - no other controls

Contributory
Travelling too fast for conditions (B)
Failed to judge other person's path or speed (A)
Careless, reckless or in a hurry (A)
Vehicle blind spot (B)
Emergency vehicle on a call (A)

Vehicle 1

Driver Male, 53
Negative
Postcode: NE28 0DN
Journey as part of work

Vehicle Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under
No tow or articulation

Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Front
None
None

Movement Vehicle moving from South West to North East
Going ahead other
No skidding, jack-knifing or overturning
Did not leave carriageway

Vehicle 2

Driver Male, 24
Negative
Postcode: NE33 4HP
Other

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Approaching junction or waiting/parked at junction exit

Collisions Hit no other vehicle
Offside
None
None

Movement Vehicle moving from West to East
Turning right
No skidding, jack-knifing or overturning
Did not leave carriageway

Casualty 1 - Serious

Driver or rider
Male 24
NE33 4HP

Not a car passenger
Not a bus or coach passenger

***Description
of Location***

STANHOPE ROAD (B1298) AT JUNCTION WITH ALNWICK ROAD

***Description
of Accident***

BOTH VEHICLES HAVE BEEN MOVED PRIOR TO POLICE ATTENDANCE. HOWEVER INITIAL ACCOUNTS FROM BOTH DRIVERS WOULD INDICATE THAT V2 HAS BEEN CARRYING OUT A RIGHT TURN INTO ALNWICK ROAD FROM STANHOPE ROAD WHEN V1 HAS BEEN RESPONDING AN EMERGENCY WHEN THE DRIVER OF V1 HAS MOVED INTO THE OPPOSITE SIDE OF THE ROAD TO PASS A PEDESTRIAN ISLAND WITH KEEP LEFT ARROWS IN FORCE IN ORDER TO MAKE PROGRESS WITH BLUE LIGHTS ILLUMINATED AND TWO TONE SIRENS ACTIVATED. V1 HAS PASSED SEVERAL VEHI

Slight Accident

Involving 2 Vehicle, 1 Casualty

0907050

Location	South Tyneside A 1300 437143E, 564172N	Date/Time	Wednesday 04 December 2019 20:10
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Unknown Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	

Vehicle 1

Driver	Male, 25 Positive Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 43 Driver not contacted at time of accident Postcode: NE34 6DY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	43	Not a bus or coach passenger
NE34 6DY		

***Description
of Location***

JOHN REID ROAD (A1300) - 56 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

V2 BEING DRIVEN NORTH EAST ALONG THE A1300 TOWARDS THE NOOK AREA OF SOUTH SHIELDS. V1 APPROACHES V2 FROM THE REAR, TRAVELLING IN THE SAME DIRECTION, BUT AT GREATER SPEED. V1 FAILS TO SLOW DOWN AND HITS V2 IN THE REAR END. BOTH VEHICLES COME TO A BRIEF STANDSTILL, BEFORE V1 MAKES OFF FROM THE SCENE, FAILING TO STOP.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0911400

Location	South Tyneside B 1301 436329E, 566054N	Date/Time	Wednesday 18 December 2019 15:55
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None Pedestrian in carriageway - not injured None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 46 Negative Postcode: NE34 0XE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing elsewhere
Male	5	Crossing from driver's nearside West

Description of Location	LAYGATE (B1301) - 43 METRES FROM JUNCTION WITH DIXON STREET

Description of Accident	PEDESTRIAN HAS BEEN WITH HIS MOTHER STANDING AT OUTSIDE 289 LAYGATE LOOKING TO CROSS THE B1301 TOWARDS EGLESFIELD ROAD. THEY HAVE TAKEN A STEP INTO THE ROAD TO GET A FEW BETWEEN PARKED CARS. IP HAS TAKEN A STEP IN FRONT OF HIS MOTHER BETWEEN THE PARKED CARS AS VEHICLE 1 HAS BEEN PASSING AT LOW SPEED, IP HAS THEN COLLIDED WITH THE FRONT NEARSIDE WHEEL ARCH. NO DAMAGE CAUSED TO VEHICLE. NO VISIBLE INJURY CAUSED TO IP

Slight Accident

Involving 1 Vehicle, 1 Casualty

0915451

Location	South Tyneside A 1018 436792E, 566151N	Date/Time	Thursday 02 January 2020 17:05
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 40 Driver not contacted at time of accident Postcode: NE34 7NS Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 60	Standing passenger
NE33 3BU	

Description of Location	IMEARY STREET (A1018) - 26 METRES FROM JUNCTION WITH EAST MOFFETT STREET

Description of Accident	PASSENGER MOVES ALONG AISLE ON BUS AS IT APPROACHED BUS STOP. DRIVER BRAKES A LITTLE HEAVY ON ROUTE AND THIS CAUSES THE PASSENGER TO LOOSE BALANCE AND FALL BACKWARDS BANGING HER BACK AGAINST A STEP AND CAUSING INJURY

Slight Accident

Involving 1 Vehicle, 1 Casualty

0916559

Location	South Tyneside B 1298 436501E, 565923N	Date/Time	Tuesday 07 January 2020 07:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Male, 40 Driver not contacted at time of accident Postcode: NE33 2HA Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing on pedestrian crossing facility
Male 34	Crossing from driver's nearside
NE33 5QD	West

Description of Location CHICHESTER ROAD (B1298) NEAR JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident PEDESTRIAN REPORTS TO POLICE THAT AS HE WAS CROSSING THE ZEBRA CROSSING V1 HAS FAILED TO SEE HIM AND STRUCK HIM CAUSING INJURY

Fatal Accident

Involving 1 Vehicle, 1 Casualty

0864486

Location	South Tyneside A 185 434512E, 564974N	Date/Time	Sunday 28 July 2019 15:47
Road	Dual Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Loss of Control (B)

Vehicle 1

Driver	Male, 53 Not provided (medical reasons) Postcode: Not known	Vehicle	Motorcycle over 500cc No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead right hand bend No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Fatal

Driver or rider	Not a car passenger
Male 53	Not a bus or coach passenger

Description of Location	JARROW ROAD (A185) - 106 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident	FOR REASONS UNKNOWN AT THIS TIME V1 TRAVELLING EAST ON JARROW ROAD WHISLT NEGOTIATING A RIGHT HAND BEND LEAVES THE CARRIAGEWAY TO THE NEAR SIDE AND COLLIDES WITH LAMP POST CAUSING FATAL INJURIES.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0890708

Location	South Tyneside 437478E, 564183N	Date/Time	Tuesday 22 October 2019 16:50
Road	Single Carriageway 30	Junction	Other junction Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 53 Negative Postcode: NE34 0SU Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to South Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 57 Negative Postcode: NE34 9HA Commuting to/from work	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Waiting to go ahead but held up Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	57	Not a bus or coach passenger
NE34 9HA		

***Description
of Location***

ACACIA GROVE NEAR JUNCTION WITH KING GEORGE ROAD (A1018)

***Description
of Accident***

V1 WAS EXITING ACACIA GROVE, TURNING LEFT ON TO KING GEORGE ROAD IN TO THE PATH OF V2 RESULTING IN A COLLISION BETWEEN THE TWO. THE RIDER OF V2 WAS THROWN FROM HIS MOTORCYCLE AND COLLIDED WITH THE ROAD. RIDER OF V2 TAKEN TO SOUTH TYNESIDE HOSPITAL. HE WAS DISCHARGED WITH CUTS TO HIS LEFT KNEE, BRUISING AND MUSCLE INJURIES. BOTH DRIVERS PROVIDED NEGATIVE BREATH TESTS

Slight Accident

Involving 2 Vehicle, 1 Casualty

0918708

Location	South Tyneside A 194 435664E, 565100N	Date/Time	Sunday 12 January 2020 19:30
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 64 Driver not contacted at time of accident Postcode: NE33 2EN Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 63	Not a bus or coach passenger
NE33 2EN	

*Description
of Location*

TEMPLETOWN - 25 METRES FROM JUNCTION WITH WESTERN APPROACH (A194)

*Description
of Accident*

DRIVER OF V2 APPROACHES ROUNDABOUT JUNCTION AND ANTICIPATES CLEAR PASSAGE INTO JUNCTION BEFORE SEEING A VEHICLE APPROACHING AND BRAKES TO STOP AT THE JUNCTION V1 APPROACHES FROM BEHIND AND FAILS TO JUDGE THAT V2 HAS STOPPED AND COLLIDES WITH THE REAR OF V2 BEFORE DRIVING PAST AND SPEEDING AWAY WITHOUT PROVIDING DETAILS

Slight Accident

Involving 2 Vehicle, 1 Casualty

0907034

Location	South Tyneside C 406 435482E, 563823N	Date/Time	Friday 06 December 2019 18:56
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Other Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 30 Not applicable Postcode: NE34 9DJ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 58	Not a bus or coach passenger

Vehicle 2

Driver	Male, 37 Driver not contacted at time of accident Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to South West Overtaking stationary vehicle on its offside Skidded Did not leave carriageway

***Description
of Location***

GREEN LANE

***Description
of Accident***

V2 COLLIDED INTO THE REAR OF V1 AFTER V2 OVERTOOK A STATIONERY PUBLIC BUS. UPON V2 RETURNING TO THE CORRECT LANE V2 BECAME AWARE THAT V1 HAD MERGED INTO THE LANE AND WAS UNABLE TO STOP CAUSING V2 TO HIT THE REAR OF V1 CAUSING V1 TO SPIN IN THE MIDDLE OF THE CARRIAGEWAY. V2 THEN HIT V1 A SECOND TIME ON THE FRONT PASSENGER'S SIDE DOOR CAUSING V1 TO SKID OFF OF THE CARRIAGEWAY COMING TO REST AGAINST SOME PEDESTRIAN RAILINGS. V2 THEN MADE OFF AWAY FROM THE SCENE FAILING TO STOP AND PROVIDE DETAILS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0915619

Location	South Tyneside 435926E, 566072N	Date/Time	Saturday 04 January 2020 12:09
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 30 Negative Postcode: DL9 4XG Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to West Moving off No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 30	Not a bus or coach passenger
DL9 4XG	

Vehicle 2

Driver	Male, 40 Negative Postcode: Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

ELDON STREET AT JUNCTION WITH GARDEN GATE DRIVE

***Description
of Accident***

V1 HAS BEEN TRAVELING OUT OF REKENDYKE INDUSTRIAL ESTATE AND DROVE STRAIGHT IN TO THE PATH OF V2 COLLIDING WITH IT AND CAUSING SLIGHT INJURY TO THE DRIVER OF V1.

Serious Accident

Involving 2 Vehicle, 1 Casualty

0923298

Location	South Tyneside A 1018 436812E, 566120N	Date/Time	Friday 24 January 2020 10:50
Road	Single Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 48 Driver not contacted at time of accident Postcode: NE33 2DZ Other	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 37 Not applicable Postcode: Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	Cycle Lane (On main carriageway) Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	37	Not a bus or coach passenger

***Description
of Location***

IMEARY STREET (A1018) AT JUNCTION WITH EAST STEVENSON STREET

***Description
of Accident***

VEH2 (PEDAL CYCLE) WAS TRAVELLING NORTHBOUND ON IMEARY STREET WHEN VEH1 (VAN) EMERGED FROM EAST STEVENSON STREET AND CROSSED IMEARY STREET HEADING FOR WEST STEVENSON STREET. IN CARRYING OUT THIS MANOEUVRE VEH1 COLLIDED WITH VEH2 CAUSING DAMAGE TO THE PEDAL CYCLE AND INJURY TO THE RIDER. THE RIDER OF THE PEDAL CYCLE WALKED OFF FROM THE SCENE.

Fatal Accident

Involving 1 Vehicle, 3 Casualties

0923311

Location	South Tyneside 436490E, 566157N	Date/Time	Friday 24 January 2020 04:10
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled B 1298
Conditions	Darkness - Street Lights present and lit Fine without high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Male, 25 Not provided (medical reasons) Postcode: NE10 8RN Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None Other permanent object	Location	Footway (pavement) Entering main road
		Movement	Vehicle moving from North East to South West Going ahead left hand bend Skidded Left carriageway offside

Casualty 1 - Fatal

Driver or rider	Not a car passenger
Male 25	Not a bus or coach passenger
NE10 8RN	

Casualty 2 - Serious

Vehicle or pillion passenger	Rear seat passenger
Female 27	Not a bus or coach passenger
NE34 9NQ	

Casualty 3 - Serious

Vehicle or pillion passenger	Front seat passenger
Male 38	Not a bus or coach passenger

Description of Location UNCLASSIFIED ROAD NEAR JUNCTION WITH CHICHESTER ROAD (B1298)

Description of Accident VEHICLE 1 TRAVELLS ONTO OFFSIDE OF CARRIAGEWAY, MOUNTS PAVEMENT, TRAVELS OVER PAVEMENT FOR SHORT DISTANCE BEFORE COLLIDING WITH RESIDENTIAL PROPERTY

Slight Accident

Involving 2 Vehicle, 1 Casualty

0923461

Location	South Tyneside A 185 433429E, 564897N	Date/Time	Sunday 26 January 2020 02:20
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled A 19
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Aggressive driving (A) Vehicle in course of crime (A)

Vehicle 1

Driver	Male, 30 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Reversing No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 49 Not requested Postcode: NE5 4AW Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from West to East Parked No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	49	Not a bus or coach passenger
NE5 4AW		

***Description
of Location***

STRAKER STREET (A185) NEAR JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

V1 HAS BEEN REQUIRED TO STOP BY POLICE ON THE SOUTH SIDE OF THE TYNE TUNNEL, AFTER A SHORT FOLLOW. IT HAS DONE SO, ONCE IT HAS GOT ON TO THE A185. THE POLICE VEHICLE (V2) HAS STOPPED BEHIND THE VEHICLE WITH LIGHTS, ILLUMINATED. PC 8159 HERON HAS ALIGHTED THE POLICE VEHICLE TO GO AND SPEAK WITH THE DRIVER OF VEHICLE 1. HAVING DONE SO, THE DRIVER OF V1 HAS THEN PUT THE VEHICLE INTO REVERSE AND REVERSED BACK, HITTING V2 AT THE FRONT, CAUSING DAMAGE TO V2 AND RESULTING IN INJURIES TO THE DRIVER OF V

Slight Accident

Involving 2 Vehicle, 1 Casualty

0926323

Location	South Tyneside A 1018 437444E, 564279N	Date/Time	Monday 03 February 2020 07:03
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1300
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 54 Not applicable Postcode: NE34 7PN Commuting to/from work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	54	Not a bus or coach passenger
NE34 7PN		

*Description
of Location*

KING GEORGE ROAD (A1018) - 131 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

*Description
of Accident*

V2 IS A PEDAL CYCLE THAT WAS BEING RIDDEN WEST ON THE ROUNDABOUT. V1 ALSO TRAVELLING WEST WHEN, ON PASSING, THE FRONT OFFSIDE OF V1 COLLIDED WITH THE FRONT OF V2 CAUSING MINOR DAMAGE AND INJURY TO THE RIDER WHO FELL TO THE GROUND. THE DRIVER OF V1 FAILED TO STOP AND EXCHANGE DETAILS.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0901922

Location	South Tyneside A 1300 436063E, 563759N	Date/Time	Friday 22 November 2019 20:30
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lighting Unknown Raining without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 29 Negative Postcode: NE34 8BU Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 29	Not a bus or coach passenger
NE34 8BU	

Vehicle 2

Driver	Female, 24 Not provided (medical reasons) Postcode: NE34 7BW Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Overturned Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Female 24	Not a bus or coach passenger
NE34 7BW	

***Description
of Location***

JOHN REID ROAD (A1300)

***Description
of Accident***

VEH 2 WAS APPROACHING ROUNDABOUT ON NAMED ROAD ON SLOWING DOWN TO A HALT VEH 1 TRAVELING BEHIND FAILED TO STOP IN TIME AND COLLIDED WITH REAR OF VEH 2

Slight Accident

Involving 2 Vehicle, 1 Casualty

0932275

Location	South Tyneside A 1300 437402E, 564288N	Date/Time	Thursday 20 February 2020 06:30
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Goods Vehicle - Unknown Weight No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South West to East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 27 Driver not contacted at time of accident Postcode: NE32 4AZ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	27	Not a bus or coach passenger
NE32 4AZ		

<i>Description of Location</i>	JOHN REID ROAD (A1300) NEAR JUNCTION WITH KING GEORGE ROAD (A1018)
<i>Description of Accident</i>	V2 HAS BEEN STATIONARY AT GIVEWAY MARKS AT ROUNDABOUT IN LANE 1. V1 IS A WAGON IN LANE 2 WHICH HAS COLLIDED WITH V2 UPON ENTERING ROUNDABOUT BEFORE DRIVING OFF.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0932688

Location	South Tyneside A 1300 434930E, 563454N	Date/Time	Thursday 20 February 2020 06:35
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 23 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 54 Driver not contacted at time of accident Postcode: NE33 4RU Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	54	Not a bus or coach passenger
NE33 4RU		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female

50

Not a bus or coach passenger

Description of Location

JOHN REID ROAD (A1300) - 119 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident

VEHICLE 2 WAS STATIONARY AT THE ROUNDABOUT WHEN VEHICLE 1 HAS COLLIDED WITH THE REAR OF VEHICLE 1. BOTH DRIVERS GOT OUT AND SPOKE TO EACH OTHER BUT IT APPEARS THAT VEHICLE 1 DID NOT HAVE CURRENT INSURANCE AT THE TIME OF THE COLLISION

Slight Accident

Involving 2 Vehicle, 2 Casualties

0935380

Location	South Tyneside A 194 434544E, 564127N	Date/Time	Sunday 01 March 2020 07:54
Road	Dual Carriageway 40	Junction	T or staggered junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 50 Negative Postcode: Journey as part of work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None Road sign/Traffic Signal	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North East Going ahead other Skidded Left carriageway nearside

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 50	Not a bus or coach passenger

Vehicle 2

Driver	Female, 43 Negative Postcode: NE34 6JL Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to North West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Female 43 NE34 6JL	Not a bus or coach passenger

***Description
of Location***

NEWCASTLE ROAD (A194) AT JUNCTION WITH SHAFTESBURY AVENUE

***Description
of Accident***

V1 (POLICE BMW) TRAVELLING EASTBOUND ON A194 NEWCASTLE ROAD, SOUTH SHIELDS ON EMERGENCY REPOSE CALL COLLIDES WITH V2 (NISSAN NAVARA) WHICH IS TURNING RIGHT INTO SHAFTSBURY AVENUE FROM THE WESTBOUND CARRIAGEWAY OF A194 NEWCASTLE ROAD.

Slight Accident

Involving 5 Vehicle, 1 Casualty

0859789

Location	South Tyneside A 19 433718E, 563924N	Date/Time	Saturday 20 July 2019 12:29
Road	Dual Carriageway 50	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry Roadworks None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Distraction in vehicle (B) Careless, reckless or in a hurry (A)

Vehicle 1

Driver	Male, 37 Negative Postcode: DH07 6AG Journey as part of work	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 45 Negative Postcode: NE4 9UH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Rear seat passenger
Female 12	Not a bus or coach passenger

Vehicle 3

Driver	Female, 29
	Negative
	Postcode: NE62 5JN
	Other
Collisions	Hit no other vehicle
	Back
	None
	None

Vehicle	Car
	No tow or articulation
Location	On main carriageway - not in restricted lane
	Not at, or within 20 metres of junction
Movement	Vehicle moving from North to South
	Waiting to go ahead but held up
	No skidding, jack-knifing or overturning
	Did not leave carriageway

Vehicle 4

Driver	Female, 39
	Negative
	Postcode: NE26 3TW
	Other
Collisions	Hit no other vehicle
	Back
	None
	None

Vehicle	Car
	No tow or articulation
Location	On main carriageway - not in restricted lane
	Not at, or within 20 metres of junction
Movement	Vehicle moving from North to South
	Waiting to go ahead but held up
	No skidding, jack-knifing or overturning
	Did not leave carriageway

Vehicle 5

Driver	Male, 42
	Negative
	Postcode: NE26 1HZ
	Other
Collisions	Hit no other vehicle
	Back
	None
	None

Vehicle	Car
	No tow or articulation
Location	On main carriageway - not in restricted lane
	Not at, or within 20 metres of junction
Movement	Vehicle moving from North to South
	Waiting to go ahead but held up
	No skidding, jack-knifing or overturning
	Did not leave carriageway

*Description
of Location*

A19

*Description
of Accident*

V2 V3 V4 V5 HAVE BEEN STATIONARY IN QUEUING TRAFFIC HEADING SOUTH ON THE A19 ADJACENT TO THE OFF SLIP FOR LINDISFARNE INTERCHANGE. V1 HAS FOR REASONS UNKNOWN COLLIDED WITH THE REAR OF V2 CAUSING A COLLIDING DOMINO EFFECT ON V3 V4 V5.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0863604

Location	South Tyneside	Date/Time	Friday
	436570E, 566895N		26 July 2019
Road	Single Carriageway	Junction	T or staggered junction
	30		Automatic traffic signal
Conditions	Daylight - Street Lights Present	Contributory	A 183
	Fine without high winds		
	Dry		
	None		
	None		
	None within 50 metres		
	Pedestrian phase at traffic signal junction		

Vehicle 1

Driver	Female, Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 49 Not requested Postcode: NE34 9SU Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	Bus Lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 50	Seated passenger
NE33 4AW	

***Description
of Location***

FOWLER STREET NEAR JUNCTION WITH BEACH ROAD (A183)

***Description
of Accident***

V2 SINGLE DECKER BUS TRAVELING SOUTH ON FOWLER STREET AT JUNCTION OF BEACH ROAD SOUTH SHIELDS SOUTH TYNESIDE AT TRAFFIC LIGHTS. U/K VRM V1 POSSIBLY WHITE DACIA SANDERO JUMPS A RED LIGHT CAUSING V2 TO BRAKE SUDDENLY TO AVOID COLLISION CAUSING A PASSENGER ON THE BUS TO FALL AND HAVE INJURY CAUSED TO RIGHT HAND AND RIGHT KNEE. V1 FAILS TO STOP PROBABLY UNAWARE.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0864143

Location	South Tyneside A 194 436167E, 566191N	Date/Time	Friday 26 July 2019 12:45
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled B 1301
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 20 Not requested Postcode: NE32 5EB Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 56 Not requested Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from South West to North East Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 56	Not a bus or coach passenger

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female

12

Not a bus or coach passenger

Description of Location

LAYGATE (A194) NEAR JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident

VEH2 WAS STATIONARY IN LANE 1 ON THE ROUNDABOUT WAITING FOR TRAFFIC IN FRONT TO MOVE OFF WHEN FOR UNKNOWN REASONS, VEH1 COLLIDED WITH VEH2 CAUSING DAMAGE AND INJURY TO THE OCCUPANTS OF VEH2. DETAILS WERE EXCHANGED AT THE SCENE AND THE OCCUPANTS OF VEH2 WERE TAKEN TO HOSPITAL BY RELATIVES.

Slight Accident

Involving 2 Vehicle, 3 Casualties

0937098

Location	South Tyneside A 194 436512E, 566795N	Date/Time	Thursday 05 March 2020 12:40
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 44 Driver not contacted at time of accident Postcode: NE34 8RZ Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 3 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 67	Seated passenger
NE34 7EF	

Casualty 2 - Slight

Vehicle or pillion passenger

Female 61

NE33 3HD

Not a car passenger

Seated passenger

Casualty 1 - Slight

Vehicle or pillion passenger

Female 86

NE33 3HW

Not a car passenger

Seated passenger

Description of Location

CROSSGATE (A194) - 32 METRES FROM JUNCTION WITH GARDEN LANE

Description of Accident

VEH2, A PSV HAS BEEN TRAVELLING UP CROSSGATE, IN THE NEAR SIDE LANE, TOWARDS THE JUNCTION WITH THE A183, WHEN AN UNKNOWN VEH1 HAS CROSSED LANES FROM THE OFFSIDE TO THE NEAR SIDE, IN FRONT OF VEH2, CAUSING THE DRIVER OF VEH2 TO BRAKE SHARPLY. 3 X PASSENGERS FROM VEH2 HAVE BEEN THROWN FROM THEIR SEATS CAUSING INJURIES. AN AMBULANCE WAS CALLED TO THE SCENE BY THE DRIVER OF VEH2. VEH1 DID NOT STOP, AND AT THE JUNCTION WITH THE A183, HAS THEN TURNED RIGHT AT THE TOP AND PROCEEDED ALONG WESTOE ROAD (A1

Slight Accident

Involving 1 Vehicle, 1 Casualty

0945929

Location	South Tyneside C 407 436373E, 565804N	Date/Time	Tuesday 14 April 2020 15:48
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Not traced, 45 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from West to East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Male	45	Crossing from driver's nearside - masked by parked or stationary vehicle
NE33 5LL		South

Description of Location	DEAN ROAD - 42 METRES FROM JUNCTION WITH DACRE STREET

Description of Accident	VEHICLE 1 WAS TRAVELLING ALONG DEAN ROAD SOUTH SHIELDS IN A EASTERLY DIRECTION HEADING TOWARDS THE MINI ROUNDABOUT JUNCTION WITH CHICHESTER ROAD. VEHICLE 1 WAS TRAVELLING IN THE OUTSIDE LANE. THE VICTIM WAS RUNNING ACROSS THE ZEBRA CROSSING IN A SOUTHERLY DIRECTION WHEN VEHICLE 1'S NEAR SIDE HAS COLLIDED WITH IP KNOCKING HIM TO THE GROUND.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0947186

Location	South Tyneside 435994E, 565337N	Date/Time	Tuesday 21 April 2020 13:34
Road	Single Carriageway 50	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 20 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 29 Driver not contacted at time of accident Postcode: NE34 8LS Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	29	Not a bus or coach passenger
NE34 8LS		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female

30

Not a bus or coach passenger

Description of Location

DEAN ROAD NEAR JUNCTION WITH TEMPLE STREET

Description of Accident

IP HAS BEEN DRIVING ON DENE ROAD WHEN V1 HAS CRASHED INTO THE BACK OF V2 AND MADE OFF WITHOUT OFFERING DETAILS

Slight Accident

Involving 2 Vehicle, 1 Casualty

0947655

Location	South Tyneside A 194 433759E, 563507N	Date/Time	Thursday 23 April 2020 13:37
Road	Dual Carriageway 50	Junction	Roundabout Automatic traffic signal A 19
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 28 Driver not contacted at time of accident Postcode: SR4 0AN Other	Vehicle	Motorcycle 50cc and Under No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to West Turning left Skidded Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 28	Not a bus or coach passenger
SR4 0AN	

Vehicle 2

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

LEAM LANE (A194) NEAR JUNCTION WITH A19

***Description
of Accident***

RIDER OF V1 TURNS LEFT FROM RIGHT HAND LANE AND AS A RESULT COMES OFF MOTORCYCLE IN CLOSE PROXIMITY TO V2, V2 UNAWARE AND POSSIBLE UNCONNECTED

Slight Accident

Involving 2 Vehicle, 1 Casualty

0895118

Location	South Tyneside 436075E, 563863N	Date/Time	Monday 04 November 2019 18:48
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled B 1298
Conditions	Darkness - Street Lights present and lit Unknown Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 33 Not applicable Postcode: Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North West Going ahead other Skidded and overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 33	Not a bus or coach passenger

***Description
of Location***

STRATHMORE GARDENS NEAR JUNCTION WITH BOLDON LANE (B1298)

***Description
of Accident***

BICYCLE RIDER WAS TRAVELLING ALONG BOLDON LANE TOWARDS JOHN REID ROAD WHEN APPROACHING THE JUNCTION
SRATHMORE GARDENS A DARK COLOURED 4X4 VEHICLE HAS COLLIDED WITH THE BICYCLE KNOCKING THE RIDER OF HIS BIKE

Slight Accident

Involving 2 Vehicle, 1 Casualty

0955764

Location	South Tyneside A 1300 436166E, 563777N	Date/Time	Tuesday 02 June 2020 18:32
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Impaired by alcohol (A) Aggressive driving (A) Impaired by drugs (illicit or medicinal) (B)

Vehicle 1

Driver	Male, 29 Driver not contacted at time of accident Postcode: NE31 2DU Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 19 Not applicable Postcode: NE31 2BH Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	19	Not a bus or coach passenger
NE31 2BH		

***Description
of Location***

JOHN REID ROAD (A1300)

***Description
of Accident***

VEHICLE 1 TRAVELLING SOUTH WEST ON JOHN REID ROAD FAILS TO SLOW WHEN APPROACHING ROUNDABOUT AND COLLIDES WITH REAR OF VEHICLE 2 WHICH IS HELD AT JUNCTION BY TRAFFIC WAITING TO MOVE OFF. VEHICLE 1 THEN DRIVES OFF FROM COLLISION SCENE.

Slight Accident

Involving 2 Vehicle, 3 Casualties

0957404

Location	South Tyneside A 194 434489E, 564050N	Date/Time	Friday 12 June 2020 19:20
Road	Dual Carriageway 40	Junction	Other junction Automatic traffic signal
Conditions	Daylight - Street Lights Present Raining without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Female, 60 Not requested Postcode: DH2 3TE Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Waiting to go ahead but held up No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 60	Not a bus or coach passenger
DH2 3TE	

Vehicle 2

Driver	Male, 38 Negative Postcode: NE32 3QQ Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 2 - Slight

Driver or rider	Not a car passenger
Male 38	Not a bus or coach passenger
NE32 3QQ	

Casualty 3 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 34

Not a bus or coach passenger

NE33 5HW

Description of Location

NEWCASTLE ROAD (A194) NEAR JUNCTION WITH HENDERSON ROAD

Description of Accident

VEH 1 HAS BEEN STOPPED AT THE PELICAN CROSSING ON NEWCASTLE ROAD, WHEN THE LIGHTS HAVE BEEN ON RED, VEH 2 HAS BEEN TRAVELLING EAST TO WEST AND HAS SEEN THE RED LIGHT AND HAS BELIEVED IT HAS TURNED GREEN HOWEVER WITNESS HAS STATED IT HAS STILL BEEN ON RED AND VEH 2 HAS THEN WENT INTO THE BACK OF THE VEH 1. CAUSING DAMAGE. DRIVER OF VEH 2 HAS SLIGHT INJURY TO LEFT LEG AND PASSENGER HAS CHEST PAINS DUE TO AIR BAGS BEING DEPLOYED, DRIVER OF VEH 1 HAS SYMPTOMS OF SHOCK. DETAILS HA

Slight Accident

Involving 1 Vehicle, 1 Casualty

0944394

Location	South Tyneside A 185 434669E, 564855N	Date/Time	Friday 03 April 2020 02:07
Road	Single Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 23 Negative Postcode: NE31 1DY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North West to South East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 23	Not a bus or coach passenger
NE31 1DY	

Description of Location	JARROW ROAD (A185) - 137 METRES FROM JUNCTION WITH BEDESWAY

Description of Accident	DRIVER FULLY ADMITTS DRIVING AT EXCESS SPEED CAUSING HIM TO LOOSE CONTROL AND HIT THE KERB CAUSING THE VEHICLE TO VEER INTO THE NEARSIDE AND HIT A LAMP POST DAMAGING SAME TO SUCH AN EXTENT THAT IT LATER HAD TO BE CUT DOWN. THE RESULTANT IMPACT CAUSED THE OFFENDING VEHICLE TO ROLL ONTO ITS SIDE. MINOR INJURY TO DRIVER LEFT HAND (SMALL CUT)

Slight Accident

Involving 2 Vehicle, 2 Casualties

0963666

Location	South Tyneside 435881E, 565637N	Date/Time	Friday 10 July 2020 14:15
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A)

Vehicle 1

Driver	Male, 81 Driver not contacted at time of accident Postcode: NE33 5LX Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
Movement			Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 33 Driver not contacted at time of accident Postcode: NE34 0QY Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
Movement			Vehicle moving from South to North Waiting to turn right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	33	Not a bus or coach passenger
NE34 0QY		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 30

Not a bus or coach passenger

NE34 0QY

Description of Location

SOUTH ELDON STREET NEAR JUNCTION WITH FRASER CLOSE

Description of Accident

APPARENTLY ON 10/07/20 AT 14.15HRS V2, A MAZDA 2, VRN FY15 ZCF IS STATIONARY ON SOUTH ELDON STREET, WAITING TO TURN RIGHT INTO GOMPERTZ GARDENS, SOUTH SHIELDS. AT THIS TIME V1, A NISSAN MICRA, VRM SG57 OJZ COLLIDES WITH THE REAR OF V2 APPARENTLY NOT AWARE THAT V2 WAS WAITING FOR AN ONCOMING BUS. BOTH OCCUPANTS OF V2 SUSTAIN WHIP LASH TYPE INJURY, WITH DRIVER V1 UNINJURED.

Slight Accident

Involving 5 Vehicle, 4 Casualties

0921843

Location	South Tyneside A 19 433659E, 564267N	Date/Time	Tuesday 21 January 2020 17:40
Road	Dual Carriageway 70	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 29 Negative Postcode: Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front Parked vehicle None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 3 - Slight

Driver or rider	Not a car passenger
Male 29	Not a bus or coach passenger

Vehicle 2

Driver	Male, 20 Negative Postcode: Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back Parked vehicle None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North to South Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 35
Negative
Postcode:
Commuting to/from work

Collisions Hit no other vehicle

Back
Parked vehicle
None

Casualty 2 - Slight

Driver or rider
Male 35

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Not at, or within 20 metres of junction

Movement Vehicle moving from North to South
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Not a car passenger
Not a bus or coach passenger

Vehicle 4

Driver Male, 40
Negative
Postcode:
Commuting to/from work

Collisions Hit no other vehicle

Back
Parked vehicle
None

Casualty 1 - Slight

Driver or rider
Male 40

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Not at, or within 20 metres of junction

Movement Vehicle moving from North to South
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Not a car passenger
Not a bus or coach passenger

Vehicle 5

Driver Female, 38
Negative
Postcode:
Not known

Collisions Hit no other vehicle

Back
Parked vehicle
None

Casualty 4 - Slight

Driver or rider
Female 38

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane

Not at, or within 20 metres of junction

Movement Vehicle moving from North to South
Parked
No skidding, jack-knifing or overturning
Did not leave carriageway

Not a car passenger
Not a bus or coach passenger

*Description
of Location*

A19

*Description
of Accident*

THE VEHICLE IN FRONT OF VEHICLE 5 HAS SUDDENLY BRAKED. VEHICLES 5, 4, 3 AND 2 HAVE ALL MANAGED TO BRAKE IN TIME AND STOP BUT VEHICLE 1 HAS CRASHED INTO THE BACK OF VEHICLE 2 PROPELLING IT INTO VEHICLE 3 AND SO ON UNTIL VEHICLE 4 BUMPED INTO VEHICLE 5. ALL VEHICLES WERE IN THE SAME LANE 'B344

Slight Accident

Involving 2 Vehicle, 1 Casualty

0964006

Location	South Tyneside A 1300 436153E, 563774N	Date/Time	Sunday 12 July 2020 12:28
Road	Dual Carriageway 40	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Following too close (B) Failed to look properly (B) Swerved (A) Loss of Control (B) Distraction in vehicle (B) Careless, reckless or in a hurry (B)

Vehicle 1

Driver	Male, 34 Negative Postcode: DH4 7EJ Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside Bollard/Refuge None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 69 Negative Postcode: NE34 7BH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Front seat passenger
Female 68	Not a bus or coach passenger
NE34 7BH	

***Description
of Location***

JOHN REID ROAD (A1300)

***Description
of Accident***

DRIVER OF V1 STATES HIS BRAKES FAILED TO STOP HIS VEHICLE & HE DIDN'T THINK HE WOULD BE ABLE TO AVOID A COLLISION WITH THE VEHICLE DIRECTLY IN FRONT OF HIM QUEUING AT THE ROUNDABOUT JUNCTION OF BOLDON LANE. DRIVER STATES HIS PARTNER WAS IN THE VEHICLE IN FRONT WITH CHILDREN SO TOOK EVASIVE ACTION SWERVING TO AVOID COLLISION BUT IN DOING SO HAS MOUNTED A PEDESTRIAN ISLAND DIVIDING THE TWO LANES OF THE DUAL CARRIAGEWAY AND STRUCK A BELISHA BEACON, THE POLE HAS BEEN COMPLETLEY UPROOTE

Serious Accident

Involving 2 Vehicle, 1 Casualty

0967588

Location	South Tyneside A 1300 436109E, 563796N	Date/Time	Sunday 12 July 2020 16:00
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Female, 22 Negative Postcode: NE34 9JE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 38 Not provided (medical reasons) Postcode: NE35 9BA Other	Vehicle	Motorcycle over 50cc and up to 125cc No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South Moving off Overturned Did not leave carriageway

Casualty 1 - Serious

Driver or rider		Not a car passenger
Male	38	Not a bus or coach passenger
NE35 9BA		

***Description
of Location***

JOHN REID ROAD (A1300) AT JUNCTION WITH BOLDON LANE (B1298)

***Description
of Accident***

V1 AND V2 WERE STATIONARY AT THE ROUNDABOUT OF BOLDON LANE AND JOHN REID ROAD. V2 INITIALLED PULLING AWAY BUT STOPPED, V1 ALSO MOVED OFF, HOWEVER FAILED TO SEE THAT V2 HAD STOPPED AND COLLIDED INTO THE REAR OF V2, SENDING THE RIDER TO THE FLOOR SUSTAINING AN INJURY TO HIS FOOT.

Slight Accident

Involving 2 Vehicle, 2 Casualties

0968975

Location	South Tyneside A 194 434511E, 564063N	Date/Time	Thursday 30 July 2020 17:30
Road	Dual Carriageway 40	Junction	Crossroads Automatic traffic signal
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pedestrian phase at traffic signal junction	Contributory	

Vehicle 1

Driver	Male, 30 Driver not contacted at time of accident Postcode: NE31 1RY Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 58 Driver not contacted at time of accident Postcode: NE32 4RB Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from North East to South West Slowing or stopping No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	58	Not a bus or coach passenger
NE32 4RB		

Casualty 2 - Slight

Vehicle or pillion passenger

Rear seat passenger

Female 53

Not a bus or coach passenger

NE32 4BF

Description of Location

NEWCASTLE ROAD (A194) NEAR JUNCTION WITH HENDERSON ROAD

Description of Accident

V2 HAS BEEN TRAVELLING SOUTHWEST ON A194 FOLLOWED BY V1 IN LANE 1. V2 HAS SLOWED FOR ONCOMING TRAFFIC LIGHTS ON RED AND V1 HAS COLLIDED INTO THE REAR OF V2 CAUSING MINOR DAMAGE. DETAILS WERE EXCHANGED BETWEEN BOTH DRIVERS AT THE TIME. AS A RESULT OF THE COLLISION THE DRIVER AND THE REAR SEAT PASSENGER OF V2 HAVE LATER ATTENDED SOUTH TYNESIDE HOSPITAL SUFFERING FROM MINOR WHIPLASH COMPLAINTS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0955915

Location	South Tyneside B 1302 435554E, 564987N	Date/Time	Monday 08 June 2020 05:23
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 64 Negative Postcode: NE34 0PW Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 56 Not applicable Postcode: NE34 0PW Commuting to/from work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	56	Not a bus or coach passenger
NE34 0PW		

***Description
of Location***

HUDSON STREET (B1302) NEAR JUNCTION WITH WESTERN APPROACH (A194)

***Description
of Accident***

CYCLIST (V2) HEADING NORTH ON HUDSON ROAD APPROACHING ROUNDABOUT WITH WESTERN APPROACH. V1 HAS FOLLOWED. V2 HAS INTENTION TO TRAVEL STRAIGHT OVER ROUNDABOUT AND V1 HAS INTENTION TO TURN LEFT. V2 HAS ENTERED ROUNDABOUT AND HAS RIGHT OF WAY AS V1 HAS TURNED LEFT INTO V2.

Serious Accident

Involving 1 Vehicle, 2 Casualties

0962075

Location	South Tyneside A 194 435571E, 565023N	Date/Time	Sunday 05 July 2020 03:19
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 34 Not provided (medical reasons) Postcode: NE28 8EH Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Left carriageway nearside

Casualty 1 - Serious

Driver or rider	Not a car passenger
Male 34	Not a bus or coach passenger
NE28 8EH	

Casualty 2 - Serious

Vehicle or pillion passenger	Front seat passenger
Male 24	Not a bus or coach passenger

Description of Location WESTERN APPROACH (A194) - 99 METRES FROM JUNCTION WITH TEMPLETOWN

Description of Accident FOR REASONS TO BE ESTABLISHED V1 TRAVELS IN AN EASTERLY DIRECTION ON THE A194 AND AFTER NEGOTIATING A ROUNDABOUT GOING AHEAD, COLLIDES WITH RAILINGS AND A PERIMETER WALL OF THE PORT OF TYNE, CAUSING SERIOUS INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0970664

Location	South Tyneside B 1301 436493E, 565882N	Date/Time	Wednesday 05 August 2020 09:00
Road	Dual Carriageway 30	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Zebra Crossing	Contributory	

Vehicle 1

Driver	Female, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 21 Not applicable Postcode: Commuting to/from work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Female 21	Not a bus or coach passenger

*Description
of Location*

DEAN ROAD (B1301) AT JUNCTION WITH LAYGATE

*Description
of Accident*

V2-PEDAL CYCLE- HAS BEEN WALKING ACROSS THE ZEBRA CROSSING OUTSIDE OF CHICHESTER METRO STATION WHEN SHE HAS BEEN STRUCK BY A VEHICLE. THE DRIVER OF THE VEHICLE -FEMALE-DID STOP AND OFFER ASSISTANCE AND MADE SURE THE FEMALE CYCLIST WAS OK. THE RIDER DIDN'T THINK TO GET THE VEHICLES REGISTRATION OR DRIVERS DETAILS. IT WAS A SHORT TIME LATER THE RIDER WAS FEELING PAIN AND DISCOMFORT WHEN TO SOUTH TYNESIDE HOSPITAL TO BE CHECKED OVER, DIAGNOSIS WAS MUSCULAR PAIN/BRUISING TO RIGHT HIP

Slight Accident

Involving 2 Vehicle, 2 Casualties

0971270

Location	South Tyneside C 408 437286E, 564355N	Date/Time	Saturday 08 August 2020 15:40
Road	Single Carriageway 50	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Central refuge - no other controls	Contributory	

Vehicle 1

Driver	Male, 16 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 43 Driver not contacted at time of accident Postcode: NE34 0HT Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to Waiting to turn right No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	43	Not a bus or coach passenger
NE34 0HT		

Casualty 2 - Slight

Vehicle or pillion passenger

Front seat passenger

Female 47

Not a bus or coach passenger

NE34 0HT

Description of Location

TEMPLE PARK ROAD NEAR JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident

2 VEH HIT AND RUN RTC CLLR REPORTING THAT A BLUE ASTRA HAS GONE INTO THE BACK OF HIM AND DRIVEN OFF. THERE IS QUITE A LOT OF DAMAGE TO THE BACK OF THE CLLRS CAR AND THE FRONT OF THE ASTRA WAS BADLY DAMAGED. CLLR AND HIS PASSENGER HAVE A BIT OF SORENESS AND SHOCK THE DRIVER OF THE ASTRA DID GET OUT AND SPEAK TO THE CLLR BUT HE QUICKLY GOT BACK IN THE VEH AND DROVE OFF. THERE WERE THREE MALES INCLUDING THE DRIVER IN THE ASTRA. THEY LO

Slight Accident

Involving 2 Vehicle, 1 Casualty

0972186

Location	South Tyneside A 1300 436111E, 563794N	Date/Time	Thursday 13 August 2020 07:50
Road	Roundabout 40	Junction	Roundabout Give way or uncontrolled B 1298
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Careless, reckless or in a hurry (A) Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 41 Negative Postcode: Journey as part of work	Vehicle	Goods vehicle 3.5 tonnes maximum gross weight (mgw) and under No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 57 Not applicable Postcode: NE34 6RS Commuting to/from work	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from North to South Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	57	Not a bus or coach passenger
NE34 6RS		

***Description
of Location***

JOHN REID ROAD (A1300) AT JUNCTION WITH BOLDON LANE (B1298)

***Description
of Accident***

V1 HAS BEEN TRAVELLING FROM NORTH TO SOUTH ON BOLDON LANE APPROACHING THE ROUNDABOUT WITH THE A1300 JOHN REID ROAD. THE CYCLIST HAS BEEN TRAVELLING IN THE SAME DIRECTION DIRECTLY IN FRONT OF V1. THE CYCLIST HAS ENTERED THE ROUNDABOUT BUT HAS BRAKED TO GIVE WAY ONCOMING VEHICLE TRAVELLING FROM WEST TO EAST. V1 HAS THEN COLLIDED WITH THE REAR OF THE CYCLIST KNOCKING HIM OFF CAUSING INJURY.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0972748

Location	South Tyneside B 1298 436572E, 566298N	Date/Time	Friday 14 August 2020 11:30
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 61 Driver not contacted at time of accident Postcode: NE34 8JD Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North West to South West Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Female, 34 Driver not contacted at time of accident Postcode: NE34 0RR Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Female	34	Not a bus or coach passenger
NE34 0RR		

***Description
of Location***

CHICHESTER ROAD (B1298) AT JUNCTION WITH UNCLASSIFIED ROAD

***Description
of Accident***

APPARENTLY ON 14TH AUGUST 2020 V1, A VOLVO C30 VRM AF13HSY WAS PARKED AT THE EXIT FROM THE ALDI SUPERMARKET ON CHICHESTER ROAD, SOUTH SHIELDS, A PUBLIC ROAD. ANOTHER UNKNOWN VEHICLE FLASHED IT'S LIGHTS FOR V1 TO EXIT AND V1 EDGED OUT OF THE JUNCTION AND COLLIDED WITH V2, A KIA PICANTO, VRM SA60 OVG. MINOR DAMAGE WAS CAUSED TO BOTH VEHICLES AND AT THE TIME NO INJURY REPORTED. DRIVER V2 HAS SINCE REPORTED SOFT TISSUE DAMAGE TO HER LEFT SHOULDER AND ARM.

Slight Accident

Involving 3 Vehicle, 1 Casualty

0973635

Location	South Tyneside A 1018 436701E, 566493N	Date/Time	Wednesday 12 August 2020 17:06
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None Control by other authorised person Zebra Crossing	Contributory	

Vehicle 1

Driver	Male, 22 Not requested Postcode: NE34 9UE Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 22	Not a bus or coach passenger
NE34 9UE	

Vehicle 2

Driver	Male, 24 Not requested Postcode: NE31 1TU Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 3

Driver Male, 18
Not requested
Postcode: NE33 2DT
Other

Collisions Hit no other vehicle
Back
None
None

Vehicle Car
No tow or articulation

Location On main carriageway - not in restricted lane
Not at, or within 20 metres of junction

Movement Vehicle moving from South to North
No skidding, jack-knifing or overturning
Did not leave carriageway

Description of Location WESTOE ROAD (A1018)

Description of Accident V3 HAS PULLED UP IN TRAFFIC OUTSIDE THE CHURCH, V2 HAS PULLED UP BEHIND IT SAFELY. V1 HAS THEN FAILED TO STOP IN TIME CARSHING INTO THE REAR OF V2 WHICH HAS IN TURN BUMPED INTO THE REAR OF V3 SLIGHT DAMAGE TO REAR OF V3. SLIGHT DAMAGE TO REAR AND FRONT OF V2. V1 HAS DAMAGE TO FRONT WHICH HAS RIPPED THE FRONT BUMPER OFF

Slight Accident

Involving 2 Vehicle, 1 Casualty

0965428

Location	South Tyneside A 1018 437251E, 565501N	Date/Time	Friday 10 July 2020 16:17
Road	Roundabout 30	Junction	Roundabout Give way or uncontrolled C 409
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres Central refuge - no other controls	Contributory	Failed to judge other person's path or speed (A)

Vehicle 1

Driver	Male, 67 Negative Postcode: SR6 7QT Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North to South Changing lane to left No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 70 Not applicable Postcode: SR2 7TH Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from North to South Turning left No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	70	Not a bus or coach passenger
SR2 7TH		

***Description
of Location***

SUNDERLAND ROAD (A1018) NEAR JUNCTION WITH CEMETERY APPROACH

***Description
of Accident***

VEHICLE 2 (PEDAL CYCLE) MID-JUNCTION IN NEAR SIDE LANE INTENDING TO TRAVEL SOUTH ON SUNDERLAND ROAD HIT BY VEHICLE 1 MAKING INJUDICIOUS MANOUVRE FROM CENTRE OF CARRIAGEWAY ON JUNCTION.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0975885

Location	South Tyneside A 194 433939E, 563651N	Date/Time	Wednesday 26 August 2020 16:45
Road	Dual Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 30 Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider	Not a car passenger
Male 30	Not a bus or coach passenger

Vehicle 2

Driver	Male, 48 Negative Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from North East to South West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

***Description
of Location***

LEAM LANE (A194) - 120 METRES FROM JUNCTION WITH EDINBURGH ROAD

***Description
of Accident***

V1 STOPPED AT PEDESTRIAN CROSSING AND ON SEEING 2 LANES OF STATIONARY TRAFFIC CROSSED THE ROAD NOT REALISING THAT THERE WAS A 3RD LANE OF MOVING TRAFFIC. V2 TRAVELLING WEST BOUND IN MOVING TRAFFIC AND APPROACHES THE CROSSING WHERE V1 CROSSES INFRONT OF HIM AND THE COLLISION OCCURS CAUSING INJURY TO PEDAL CYCLIST.

Fatal Accident

Involving 1 Vehicle, 1 Casualty

0976919

Location	South Tyneside B 1298 436712E, 566389N	Date/Time	Saturday 29 August 2020 08:55
Road	Slip Road 30	Junction	T or staggered junction Automatic traffic signal A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 31 Negative Postcode: Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North East to South West Going ahead right hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Fatal

Pedestrian		In carriageway, crossing on pedestrian crossing facility
Female	51	Crossing from driver's nearside
		North

Description of Location	CHICHESTER ROAD (B1298) NEAR JUNCTION WITH IMEARY STREET (A1018)

Description of Accident	FOR REASONS YET TO BE ESTABLISHED V1 HAS TRAVELLED SOUTH EAST THROUGH JUNCTION COMPLEX, U1 HAS TRAVELLED NORTH ON IMEARY STREET AND HAS WALKED INTO PATH OF V1 WHERE THE COLLISION HAS THEN FOLLOWED.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0978627

Location	South Tyneside C 414 436579E, 564477N	Date/Time	Friday 04 September 2020 15:24
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 51 Driver not contacted at time of accident Postcode: NE33 5DD Journey as part of work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Moving off No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Female 30	Boarding

Description of Location HARTON LANE - 27 METRES FROM JUNCTION WITH UNCLASSIFIED ROAD

Description of Accident V1 SCANIA DOUBLE DECKER BUS ON HARTON ROAD SOUTH SHIELDS SOUTH TYNESIDE PULLING AWAY FROM BUS STOP. U/K PASSENGER ON THE BUS FALLS AND BANGS RIGHT ARM CAUSING MINOR INJURY REFUSES ANY MEDICAL ATTENTION OR TO PASS ANY DETAILS.

Slight Accident

Involving 1 Vehicle, 1 Casualty

0979593

Location	South Tyneside B 1302 435591E, 564951N	Date/Time	Monday 07 September 2020 09:55
Road	Single Carriageway 30	Junction	Not at or within 20 metres of junction
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, Driver not contacted at time of accident Postcode: Commuting to/from work	Vehicle	Bus or coach (17 or more passenger seats) No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Vehicle or pillion passenger	Not a car passenger
Male 47	Seated passenger

Description of Location	HUDSON STREET (B1302) - 79 METRES FROM JUNCTION WITH LORD NELSON STREET

Description of Accident	V1 BUS CARRYING PASSENGERS BREAKS SUDDENLY CAUSING PASSENGER TO FALL FORWARD HITTING HIS HEAD CAUSING INJURY REQUIRING HOSPITAL TREATMENT

Slight Accident

Involving 2 Vehicle, 1 Casualty

0979797

Location	South Tyneside A 1018 437271E, 565271N	Date/Time	Wednesday 09 September 2020 09:30
Road	Dual Carriageway 30	Junction	Crossroads Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Not traced, Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Entering main road
		Movement	Vehicle moving from East to West No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 13 Not applicable Postcode: Other	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Mid junction - on roundabout or on main road
		Movement	Vehicle moving from North to South No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	13	Not a bus or coach passenger

***Description
of Location***

KING GEORGE ROAD (A1018) AT JUNCTION WITH HOLMFIELD AVENUE

***Description
of Accident***

RIDER OF V2 TRAVELS SOUTH WHEN DRIVER OF V1 COMES FROM SIDE ROAD WITH INTENTION TO TRAVEL ACROSS ROAD V1 IS ESTABLISHED ON AND AS A RESULT FAILS TO SEE RIDER OF V2 AND COLLIDES WITH SAME DRIVER OF V1 STOPS, ENGAGES WITH RIDER OF V2 AND THEN DRIVES AWAY

Slight Accident

Involving 2 Vehicle, 1 Casualty

0981149

Location	South Tyneside 436763E, 565563N	Date/Time	Monday 14 September 2020 15:10
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled C 413
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 54 Driver not contacted at time of accident Postcode: NE34 8EL Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 13 Not applicable Postcode: Other	Vehicle	Other Vehicle No tow or articulation
Collisions	Hit no other vehicle Did not impact None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from to No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	13	Not a bus or coach passenger

***Description
of Location***

UNCLASSIFIED ROAD AT JUNCTION WITH MORTIMER ROAD

***Description
of Accident***

V1 DRIVING ALONG ROAD PULLS OUT TO PASS PARKED BUS AT BUS STOP, MALE YOUTH RIDING AN ELECTRIC SCOOTER PULLS OUT INFRONT OF V1 WITHOUT LOOKING AND COLLIDES WITH V1. MALE FALLS ONTO BONNET CAUSING SCRATCHES AND SMALL DENT. MALE RIDES OFF WITH MINOR SCRATCH TO LEG/KNEE ELBOW BUT DOES NOT STOP TO PASS DETAILS.

Slight Accident

Involving 2 Vehicle, 1 Casualty

0981999

Location	South Tyneside C 408 437397E, 564306N	Date/Time	Wednesday 16 September 2020 08:10
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 1018
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Male, 40 Driver not contacted at time of accident Postcode: Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Leaving roundabout
		Movement	Vehicle moving from East to West Going ahead left hand bend No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 15 Not applicable Postcode: NE34 0TW Pupil riding to/from school	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Back None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	15	Not a bus or coach passenger
NE34 0TW		

***Description
of Location***

TEMPLE PARK ROAD NEAR JUNCTION WITH KING GEORGE ROAD (A1018)

***Description
of Accident***

RIDER OF V2 CROSSES FROM PATH TO CENTRAL ISLAND WHEN V1 COLLIDES WITH V2 CAUSING RIDER TO BE DISMOUNTED AND CAUSING INJURY DRIVER OF V1 STOPS AND ASKS IF RIDER IS OK BEFORE DRIIVNG AWAY

Slight Accident

Involving 2 Vehicle, 1 Casualty

0982366

Location	South Tyneside 435899E, 565537N	Date/Time	Thursday 17 September 2020 14:20
Road	Single Carriageway 30	Junction	Roundabout Give way or uncontrolled A 194
Conditions	Daylight - Street Lights Present Fine without high winds Dry None None None within 50 metres No physical crossing facility within 50 metres	Contributory	

Vehicle 1

Driver	Female, 45 Driver not contacted at time of accident Postcode: NE33 4RG Not known	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Nearside None None	Location	On main carriageway - not in restricted lane Cleared junction or waiting/parked at junction exit
		Movement	Vehicle moving from East to West Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 30 Not applicable Postcode: Not known	Vehicle	Pedal Cycle No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Entering roundabout
		Movement	Vehicle moving from West to East Waiting to turn left Overturned Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	30	Not a bus or coach passenger

***Description
of Location***

BARNES ROAD NEAR JUNCTION WITH WESTERN APPROACH (A194)

***Description
of Accident***

VEHICLE 1 HAD TRAVELLED ACROSS THE ROUNDABOUT AND JUST CLEARING HEAR A BANG AND REALISED THAT THERE HAD BEN A COLLISION WHERE VEHICLE 2 WHICH IS A PEDAL CYCLE HAS COLLIDED WITH THE REAR NEAR SIDE OF VEHICLE 1. BOTH RIDER AND DRIVER OF VEHICLE 1 STOPPED AT THE SCENE AND DRIVER OF VEHICLE 1 PROVIDED THEIR DETAILS HOWEVER RIDER OF CYCLE REFUSED AND LEFT

Slight Accident

Involving 1 Vehicle, 1 Casualty

0987708

Location	South Tyneside B 1298 436523E, 565375N	Date/Time	Monday 05 October 2020 15:25
Road	Single Carriageway 30	Junction	T or staggered junction Give way or uncontrolled
Conditions	Daylight - Street Lights Present Fine without high winds Wet/Damp None None None within 50 metres No physical crossing facility within 50 metres	Contributory	Failed to look properly (A) Failed to judge vehicle's path or speed (B)

Vehicle 1

Driver	Female, 44 Driver not contacted at time of accident Postcode: NE33 3GA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Approaching junction or waiting/parked at junction exit
		Movement	Vehicle moving from South to North Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Pedestrian	In carriageway, crossing elsewhere
Female 12	Crossing from driver's offside
NE34 0TT	West

Description of Location	STANHOPE ROAD (B1298) NEAR JUNCTION WITH WANTAGE STREET
Description of Accident	DRIVER OF V1 TRAVELLING NORTH ON STANHOPE ROAD WHEN PEDESTIAN (AT FAULT) CROSSES WITHOUT SEEING V1 AND IS STRUCK CAUSING MINOR INJURY

Slight Accident

Involving 2 Vehicle, 1 Casualty

0989943

Location	South Tyneside 434483E, 564076N	Date/Time	Monday 12 October 2020 20:50
Road	Single Carriageway 40	Junction	Not at or within 20 metres of junction
Conditions	Darkness - Street Lights present and lit Raining without high winds Wet/Damp None None None within 50 metres Pelican, puffin, toucan or similar non-junction pedestrian light c	Contributory	

Vehicle 1

Driver	Male, 27 Driver not contacted at time of accident Postcode: NE31 2DW Commuting to/from work	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Front None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South East to North East Turning right No skidding, jack-knifing or overturning Did not leave carriageway

Vehicle 2

Driver	Male, 45 Driver not contacted at time of accident Postcode: NE32 4LA Other	Vehicle	Car No tow or articulation
Collisions	Hit no other vehicle Offside None None	Location	On main carriageway - not in restricted lane Not at, or within 20 metres of junction
		Movement	Vehicle moving from South West to North East Going ahead other No skidding, jack-knifing or overturning Did not leave carriageway

Casualty 1 - Slight

Driver or rider		Not a car passenger
Male	45	Not a bus or coach passenger
NE32 4LA		

***Description
of Location***

NEWCASTLE ROAD - 24 METRES FROM JUNCTION WITH HENDERSON ROAD

***Description
of Accident***

APPARENTLY ON 12TH OCTOBER 2020 AT ABOUT 20.50HRS V2, A VAUXHALL ASTRA VRM, DY11AXO, WAS DRIVING EAST ON THE A194, NEWCASTLE ROAD, SOUTH TYNESIDE, A PUBLIC ROAD. AT THIS TIME V1, A VOLKESWAGEN JETTA VRM, NA07 XHK HAS COME ACROSS THE JUNCTION FROM HENDERSON RAD AND COLLIDED WITH THE REAR OFF SIDE OF V2. DRIVER V1 STOPPED AND GAVE HIS NAME AND PHONE NUMBER STATING THAT HE HADN'T SEEN V2 AND WAS LATE FOR WORK AND HAD TO GO.



Appendix C

TRICS

Calculation Reference: AUDIT-640801-201028-1012

TRIP RATE CALCULATION SELECTION PARAMETERS:

Land Use : 03 - RESIDENTIAL
 Category : A - HOUSES PRIVATELY OWNED
TOTAL VEHICLES

Selected regions and areas:

05	EAST MIDLANDS	
	LN LINCOLNSHIRE	1 days
06	WEST MIDLANDS	
	ST STAFFORDSHIRE	1 days
	WM WEST MIDLANDS	1 days
07	YORKSHIRE & NORTH LINCOLNSHIRE	
	NY NORTH YORKSHIRE	1 days

This section displays the number of survey days per TRICS® sub-region in the selected set

Primary Filtering selection:

This data displays the chosen trip rate parameter and its selected range. Only sites that fall within the parameter range are included in the trip rate calculation.

Parameter: No of Dwellings
 Actual Range: 17 to 89 (units:)
 Range Selected by User: 5 to 500 (units:)

Parking Spaces Range: All Surveys Included

Parking Spaces per Dwelling Range: All Surveys Included

Bedrooms per Dwelling Range: All Surveys Included

Percentage of dwellings privately owned: All Surveys Included

Public Transport Provision:

Selection by: Include all surveys

Date Range: 01/01/12 to 19/11/19

This data displays the range of survey dates selected. Only surveys that were conducted within this date range are included in the trip rate calculation.

Selected survey days:

Monday	2 days
Tuesday	1 days
Friday	1 days

This data displays the number of selected surveys by day of the week.

Selected survey types:

Manual count	4 days
Directional ATC Count	0 days

This data displays the number of manual classified surveys and the number of unclassified ATC surveys, the total adding up to the overall number of surveys in the selected set. Manual surveys are undertaken using staff, whilst ATC surveys are undertaken using machines.

Selected Locations:

Edge of Town Centre	4

This data displays the number of surveys per main location category within the selected set. The main location categories consist of Free Standing, Edge of Town, Suburban Area, Neighbourhood Centre, Edge of Town Centre, Town Centre and Not Known.

Selected Location Sub Categories:

Residential Zone	3
No Sub Category	1

This data displays the number of surveys per location sub-category within the selected set. The location sub-categories consist of Commercial Zone, Industrial Zone, Development Zone, Residential Zone, Retail Zone, Built-Up Zone, Village, Out of Town, High Street and No Sub Category.

Secondary Filtering selection:

Use Class:

C3

4 days

This data displays the number of surveys per Use Class classification within the selected set. The Use Classes Order 2005 has been used for this purpose, which can be found within the Library module of TRICS®.

Population within 500m Range:

All Surveys Included

Population within 1 mile:

10,001 to 15,000

1 days

25,001 to 50,000

3 days

This data displays the number of selected surveys within stated 1-mile radii of population.

Population within 5 miles:

5,001 to 25,000

1 days

125,001 to 250,000

1 days

250,001 to 500,000

2 days

This data displays the number of selected surveys within stated 5-mile radii of population.

Car ownership within 5 miles:

0.5 or Less

1 days

0.6 to 1.0

3 days

This data displays the number of selected surveys within stated ranges of average cars owned per residential dwelling, within a radius of 5-miles of selected survey sites.

Travel Plan:

No

4 days

This data displays the number of surveys within the selected set that were undertaken at sites with Travel Plans in place, and the number of surveys that were undertaken at sites without Travel Plans.

PTAL Rating:

No PTAL Present

4 days

This data displays the number of selected surveys with PTAL Ratings.

LIST OF SITES relevant to selection parameters

1	LN-03-A-04 EGERTON ROAD LINCOLN	DETACHED & SEMI-DETACHED	LINCOLNSHIRE
	Edge of Town Centre Residential Zone		
	Total No of Dwellings:	30	
	Survey date: MONDAY	29/06/15	Survey Type: MANUAL
2	NY-03-A-12 RACECOURSE LANE NORTHALLERTON	TOWN HOUSES	NORTH YORKSHIRE
	Edge of Town Centre Residential Zone		
	Total No of Dwellings:	47	
	Survey date: TUESDAY	27/09/16	Survey Type: MANUAL
3	ST-03-A-06 STANFORD ROAD WOLVERHAMPTON BLAKENHALL	SEMI-DET. & TERRACED	STAFFORDSHIRE
	Edge of Town Centre No Sub Category		
	Total No of Dwellings:	17	
	Survey date: FRIDAY	09/05/14	Survey Type: MANUAL
4	WM-03-A-05 COUNDON ROAD COVENTRY	TERRACED & DETACHED	WEST MIDLANDS
	Edge of Town Centre Residential Zone		
	Total No of Dwellings:	89	
	Survey date: MONDAY	21/11/16	Survey Type: MANUAL

This section provides a list of all survey sites and days in the selected set. For each individual survey site, it displays a unique site reference code and site address, the selected trip rate calculation parameter and its value, the day of the week and date of each survey, and whether the survey was a manual classified count or an ATC count.

TRIP RATE for Land Use 03 - RESIDENTIAL/A - HOUSES PRIVATELY OWNED

TOTAL VEHICLES

Calculation factor: 1 DWELLS

BOLD print indicates peak (busiest) period

Time Range	ARRIVALS			DEPARTURES			TOTALS		
	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate
00:00 - 01:00									
01:00 - 02:00									
02:00 - 03:00									
03:00 - 04:00									
04:00 - 05:00									
05:00 - 06:00									
06:00 - 07:00									
07:00 - 08:00	4	46	0.071	4	46	0.219	4	46	0.290
08:00 - 09:00	4	46	0.142	4	46	0.246	4	46	0.388
09:00 - 10:00	4	46	0.126	4	46	0.109	4	46	0.235
10:00 - 11:00	4	46	0.137	4	46	0.137	4	46	0.274
11:00 - 12:00	4	46	0.098	4	46	0.115	4	46	0.213
12:00 - 13:00	4	46	0.126	4	46	0.175	4	46	0.301
13:00 - 14:00	4	46	0.148	4	46	0.120	4	46	0.268
14:00 - 15:00	4	46	0.098	4	46	0.153	4	46	0.251
15:00 - 16:00	4	46	0.158	4	46	0.098	4	46	0.256
16:00 - 17:00	4	46	0.219	4	46	0.115	4	46	0.334
17:00 - 18:00	4	46	0.284	4	46	0.148	4	46	0.432
18:00 - 19:00	4	46	0.169	4	46	0.104	4	46	0.273
19:00 - 20:00									
20:00 - 21:00									
21:00 - 22:00									
22:00 - 23:00									
23:00 - 24:00									
Total Rates:			1.776			1.739			3.515

This section displays the trip rate results based on the selected set of surveys and the selected count type (shown just above the table). It is split by three main columns, representing arrivals trips, departures trips, and total trips (arrivals plus departures). Within each of these main columns are three sub-columns. These display the number of survey days where count data is included (per time period), the average value of the selected trip rate calculation parameter (per time period), and the trip rate result (per time period). Total trip rates (the sum of the column) are also displayed at the foot of the table.

To obtain a trip rate, the average (mean) trip rate parameter value (TRP) is first calculated for all selected survey days that have count data available for the stated time period. The average (mean) number of arrivals, departures or totals (whichever applies) is also calculated (COUNT) for all selected survey days that have count data available for the stated time period. Then, the average count is divided by the average trip rate parameter value, and multiplied by the stated calculation factor (shown just above the table and abbreviated here as FACT). So, the method is: $COUNT/TRP*FACT$. Trip rates are then rounded to 3 decimal places.

The survey data, graphs and all associated supporting information, contained within the TRICS Database are published by TRICS Consortium Limited ("the Company") and the Company claims copyright and database rights in this published work. The Company authorises those who possess a current TRICS licence to access the TRICS Database and copy the data contained within the TRICS Database for the licence holders' use only. Any resulting copy must retain all copyrights and other proprietary notices, and any disclaimer contained thereon.

The Company accepts no responsibility for loss which may arise from reliance on data contained in the TRICS Database. [No warranty of any kind, express or implied, is made as to the data contained in the TRICS Database.]

Parameter summary

Trip rate parameter range selected:	17 - 89 (units:)
Survey date range:	01/01/12 - 19/11/19
Number of weekdays (Monday-Friday):	4
Number of Saturdays:	0
Number of Sundays:	0
Surveys automatically removed from selection:	0
Surveys manually removed from selection:	0

This section displays a quick summary of some of the data filtering selections made by the TRICS® user. The trip rate calculation parameter range of all selected surveys is displayed first, followed by the range of minimum and maximum survey dates selected by the user. Then, the total number of selected weekdays and weekend days in the selected set of surveys are shown. Finally, the number of survey days that have been manually removed from the selected set outside of the standard filtering procedure are displayed.

Calculation Reference: AUDIT-640801-201028-1055

TRIP RATE CALCULATION SELECTION PARAMETERS:

Land Use : 03 - RESIDENTIAL
 Category : B - AFFORDABLE/LOCAL AUTHORITY HOUSES
TOTAL VEHICLES

Selected regions and areas:

04	EAST ANGLIA	
	NF NORFOLK	1 days
07	YORKSHIRE & NORTH LINCOLNSHIRE	
	WY WEST YORKSHIRE	1 days
08	NORTH WEST	
	GM GREATER MANCHESTER	1 days
09	NORTH	
	TW TYNE & WEAR	1 days
11	SCOTLAND	
	DU DUNDEE CITY	1 days

This section displays the number of survey days per TRICS® sub-region in the selected set

Primary Filtering selection:

This data displays the chosen trip rate parameter and its selected range. Only sites that fall within the parameter range are included in the trip rate calculation.

Parameter: No of Dwellings
 Actual Range: 29 to 83 (units:)
 Range Selected by User: 11 to 516 (units:)

Parking Spaces Range: All Surveys Included

Parking Spaces per Dwelling Range: All Surveys Included

Bedrooms per Dwelling Range: All Surveys Included

Percentage of dwellings privately owned: All Surveys Included

Public Transport Provision:

Selection by: Include all surveys

Date Range: 01/01/12 to 19/10/18

This data displays the range of survey dates selected. Only surveys that were conducted within this date range are included in the trip rate calculation.

Selected survey days:

Wednesday	2 days
Thursday	2 days
Friday	1 days

This data displays the number of selected surveys by day of the week.

Selected survey types:

Manual count	5 days
Directional ATC Count	0 days

This data displays the number of manual classified surveys and the number of unclassified ATC surveys, the total adding up to the overall number of surveys in the selected set. Manual surveys are undertaken using staff, whilst ATC surveys are undertaken using machines.

Selected Locations:

Edge of Town Centre	2
Suburban Area (PPS6 Out of Centre)	3

This data displays the number of surveys per main location category within the selected set. The main location categories consist of Free Standing, Edge of Town, Suburban Area, Neighbourhood Centre, Edge of Town Centre, Town Centre and Not Known.

Selected Location Sub Categories:

Residential Zone	3
Built-Up Zone	1
No Sub Category	1

This data displays the number of surveys per location sub-category within the selected set. The location sub-categories consist of Commercial Zone, Industrial Zone, Development Zone, Residential Zone, Retail Zone, Built-Up Zone, Village, Out of Town, High Street and No Sub Category.

Secondary Filtering selection:

Use Class:

C3

5 days

This data displays the number of surveys per Use Class classification within the selected set. The Use Classes Order 2005 has been used for this purpose, which can be found within the Library module of TRICS®.

Population within 500m Range:

All Surveys Included

Population within 1 mile:

15,001 to 20,000

1 days

25,001 to 50,000

4 days

This data displays the number of selected surveys within stated 1-mile radii of population.

Population within 5 miles:

75,001 to 100,000

2 days

125,001 to 250,000

1 days

250,001 to 500,000

2 days

This data displays the number of selected surveys within stated 5-mile radii of population.

Car ownership within 5 miles:

0.6 to 1.0

5 days

This data displays the number of selected surveys within stated ranges of average cars owned per residential dwelling, within a radius of 5-miles of selected survey sites.

Travel Plan:

No

5 days

This data displays the number of surveys within the selected set that were undertaken at sites with Travel Plans in place, and the number of surveys that were undertaken at sites without Travel Plans.

PTAL Rating:

No PTAL Present

5 days

This data displays the number of selected surveys with PTAL Ratings.

LIST OF SITES relevant to selection parameters

1	DU-03-B-01	TERRACED BUNGALOWS	DUNDEE CITY
	307-441 BALUNIE DRIVE		
	DUNDEE		
	DOUGLAS & ANGUS		
	Suburban Area (PPS6 Out of Centre)		
	Residential Zone		
	Total No of Dwellings:	68	
	Survey date: FRIDAY	21/04/17	Survey Type: MANUAL
2	GM-03-B-01	TERRACED HOUSES	GREATER MANCHESTER
	NEWBOLD		
	ROCHDALE		
	Suburban Area (PPS6 Out of Centre)		
	No Sub Category		
	Total No of Dwellings:	43	
	Survey date: WEDNESDAY	21/10/15	Survey Type: MANUAL
3	NF-03-B-01	TERRACED HOUSES	NORFOLK
	NELSON ROAD NORTH		
	GREAT YARMOUTH		
	Edge of Town Centre		
	Residential Zone		
	Total No of Dwellings:	45	
	Survey date: WEDNESDAY	13/09/17	Survey Type: MANUAL
4	TW-03-B-01	TERRACED HOUSES	TYNE & WEAR
	SCEPTRE STREET		
	NEWCASTLE UPON TYNE		
	Edge of Town Centre		
	Residential Zone		
	Total No of Dwellings:	83	
	Survey date: THURSDAY	18/10/18	Survey Type: MANUAL
5	WY-03-B-03	TERRACED HOUSES	WEST YORKSHIRE
	LINCOLN GREEN ROAD		
	LEEDS		
	Suburban Area (PPS6 Out of Centre)		
	Built-Up Zone		
	Total No of Dwellings:	29	
	Survey date: THURSDAY	19/09/13	Survey Type: MANUAL

This section provides a list of all survey sites and days in the selected set. For each individual survey site, it displays a unique site reference code and site address, the selected trip rate calculation parameter and its value, the day of the week and date of each survey, and whether the survey was a manual classified count or an ATC count.

TRIP RATE for Land Use 03 - RESIDENTIAL/B - AFFORDABLE/LOCAL AUTHORITY HOUSES

TOTAL VEHICLES

Calculation factor: 1 DWELLS

BOLD print indicates peak (busiest) period

Time Range	ARRIVALS			DEPARTURES			TOTALS		
	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate
00:00 - 01:00									
01:00 - 02:00									
02:00 - 03:00									
03:00 - 04:00									
04:00 - 05:00									
05:00 - 06:00									
06:00 - 07:00									
07:00 - 08:00	5	54	0.060	5	54	0.071	5	54	0.131
08:00 - 09:00	5	54	0.131	5	54	0.164	5	54	0.295
09:00 - 10:00	5	54	0.131	5	54	0.149	5	54	0.280
10:00 - 11:00	5	54	0.131	5	54	0.101	5	54	0.232
11:00 - 12:00	5	54	0.112	5	54	0.101	5	54	0.213
12:00 - 13:00	5	54	0.123	5	54	0.153	5	54	0.276
13:00 - 14:00	5	54	0.082	5	54	0.119	5	54	0.201
14:00 - 15:00	5	54	0.138	5	54	0.168	5	54	0.306
15:00 - 16:00	5	54	0.243	5	54	0.205	5	54	0.448
16:00 - 17:00	5	54	0.198	5	54	0.153	5	54	0.351
17:00 - 18:00	5	54	0.239	5	54	0.194	5	54	0.433
18:00 - 19:00	5	54	0.138	5	54	0.108	5	54	0.246
19:00 - 20:00									
20:00 - 21:00									
21:00 - 22:00									
22:00 - 23:00									
23:00 - 24:00									
Total Rates:			1.726			1.686			3.412

This section displays the trip rate results based on the selected set of surveys and the selected count type (shown just above the table). It is split by three main columns, representing arrivals trips, departures trips, and total trips (arrivals plus departures). Within each of these main columns are three sub-columns. These display the number of survey days where count data is included (per time period), the average value of the selected trip rate calculation parameter (per time period), and the trip rate result (per time period). Total trip rates (the sum of the column) are also displayed at the foot of the table.

To obtain a trip rate, the average (mean) trip rate parameter value (TRP) is first calculated for all selected survey days that have count data available for the stated time period. The average (mean) number of arrivals, departures or totals (whichever applies) is also calculated (COUNT) for all selected survey days that have count data available for the stated time period. Then, the average count is divided by the average trip rate parameter value, and multiplied by the stated calculation factor (shown just above the table and abbreviated here as FACT). So, the method is: $COUNT/TRP*FACT$. Trip rates are then rounded to 3 decimal places.

The survey data, graphs and all associated supporting information, contained within the TRICS Database are published by TRICS Consortium Limited ("the Company") and the Company claims copyright and database rights in this published work. The Company authorises those who possess a current TRICS licence to access the TRICS Database and copy the data contained within the TRICS Database for the licence holders' use only. Any resulting copy must retain all copyrights and other proprietary notices, and any disclaimer contained thereon.

The Company accepts no responsibility for loss which may arise from reliance on data contained in the TRICS Database. [No warranty of any kind, express or implied, is made as to the data contained in the TRICS Database.]

Parameter summary

Trip rate parameter range selected: 29 - 83 (units:)
 Survey date range: 01/01/12 - 19/10/18
 Number of weekdays (Monday-Friday): 5
 Number of Saturdays: 0
 Number of Sundays: 0
 Surveys automatically removed from selection: 0
 Surveys manually removed from selection: 0

This section displays a quick summary of some of the data filtering selections made by the TRICS® user. The trip rate calculation parameter range of all selected surveys is displayed first, followed by the range of minimum and maximum survey dates selected by the user. Then, the total number of selected weekdays and weekend days in the selected set of surveys are shown. Finally, the number of survey days that have been manually removed from the selected set outside of the standard filtering procedure are displayed.

Calculation Reference: AUDIT-640801-201028-1032

TRIP RATE CALCULATION SELECTION PARAMETERS:

Land Use : 03 - RESIDENTIAL
 Category : D - AFFORDABLE/LOCAL AUTHORITY FLATS
 TOTAL VEHICLES

Selected regions and areas:

02	SOUTH EAST	
	ES EAST SUSSEX	1 days
	HC HAMPSHIRE	1 days
	HF HERTFORDSHIRE	1 days
05	EAST MIDLANDS	
	LN LINCOLNSHIRE	1 days
	NT NOTTINGHAMSHIRE	1 days
07	YORKSHIRE & NORTH LINCOLNSHIRE	
	WY WEST YORKSHIRE	1 days
08	NORTH WEST	
	CH CHESHIRE	1 days

This section displays the number of survey days per TRICS® sub-region in the selected set

Primary Filtering selection:

This data displays the chosen trip rate parameter and its selected range. Only sites that fall within the parameter range are included in the trip rate calculation.

Parameter: No of Dwellings
 Actual Range: 15 to 103 (units:)
 Range Selected by User: 6 to 234 (units:)

Parking Spaces Range: All Surveys Included

Parking Spaces per Dwelling Range: All Surveys Included

Bedrooms per Dwelling Range: All Surveys Included

Percentage of dwellings privately owned: All Surveys Included

Public Transport Provision:

Selection by: Include all surveys

Date Range: 01/01/12 to 28/06/19

This data displays the range of survey dates selected. Only surveys that were conducted within this date range are included in the trip rate calculation.

Selected survey days:

Monday	1 days
Tuesday	2 days
Wednesday	1 days
Thursday	2 days
Friday	1 days

This data displays the number of selected surveys by day of the week.

Selected survey types:

Manual count	7 days
Directional ATC Count	0 days

This data displays the number of manual classified surveys and the number of unclassified ATC surveys, the total adding up to the overall number of surveys in the selected set. Manual surveys are undertaken using staff, whilst ATC surveys are undertaken using machines.

Selected Locations:

Edge of Town Centre	2
Suburban Area (PPS6 Out of Centre)	5

This data displays the number of surveys per main location category within the selected set. The main location categories consist of Free Standing, Edge of Town, Suburban Area, Neighbourhood Centre, Edge of Town Centre, Town Centre and Not Known.

Selected Location Sub Categories:

Residential Zone	7

This data displays the number of surveys per location sub-category within the selected set. The location sub-categories consist of Commercial Zone, Industrial Zone, Development Zone, Residential Zone, Retail Zone, Built-Up Zone, Village, Out of Town, High Street and No Sub Category.

Secondary Filtering selection:

Use Class:

C3 7 days

This data displays the number of surveys per Use Class classification within the selected set. The Use Classes Order 2005 has been used for this purpose, which can be found within the Library module of TRICS®.

Population within 500m Range:

All Surveys Included

Population within 1 mile:

15,001 to 20,000	1 days
20,001 to 25,000	2 days
25,001 to 50,000	3 days
50,001 to 100,000	1 days

This data displays the number of selected surveys within stated 1-mile radii of population.

Population within 5 miles:

100,001 to 125,000	1 days
125,001 to 250,000	2 days
250,001 to 500,000	3 days
500,001 or More	1 days

This data displays the number of selected surveys within stated 5-mile radii of population.

Car ownership within 5 miles:

0.6 to 1.0	4 days
1.1 to 1.5	3 days

This data displays the number of selected surveys within stated ranges of average cars owned per residential dwelling, within a radius of 5-miles of selected survey sites.

Travel Plan:

No 7 days

This data displays the number of surveys within the selected set that were undertaken at sites with Travel Plans in place, and the number of surveys that were undertaken at sites without Travel Plans.

PTAL Rating:

No PTAL Present 7 days

This data displays the number of selected surveys with PTAL Ratings.

1	CH-03-D-01	BLOCK OF FLATS			CESHIRE
	HEATH LANE				
	CHESTER				
	BOUGHTON HEATH				
	Suburban Area (PPS6 Out of Centre)				
	Residential Zone				
	Total No of Dwellings:		30		
	Survey date: THURSDAY		24/05/12		Survey Type: MANUAL
2	ES-03-D-06	FLATS & HOUSES			EAST SUSSEX
	WELLINGTON ROAD				
	BRIGHTON				
	Suburban Area (PPS6 Out of Centre)				
	Residential Zone				
	Total No of Dwellings:		15		
	Survey date: THURSDAY		16/10/14		Survey Type: MANUAL
3	HC-03-D-06	BLOCKS OF FLATS			HAMPSHIRE
	HANNAY RISE				
	SOUTHAMPTON				
	THORNHILL				
	Suburban Area (PPS6 Out of Centre)				
	Residential Zone				
	Total No of Dwellings:		66		
	Survey date: TUESDAY		24/11/15		Survey Type: MANUAL
4	HF-03-D-02	BLOCK OF FLATS			HERTFORDSHIRE
	SILAM RD				
	STEVENAGE				
	Edge of Town Centre				
	Residential Zone				
	Total No of Dwellings:		103		
	Survey date: FRIDAY		28/06/19		Survey Type: MANUAL
5	LN-03-D-02	FLATS			LINCOLNSHIRE
	ADDISON DRIVE				
	LINCOLN				
	Suburban Area (PPS6 Out of Centre)				
	Residential Zone				
	Total No of Dwellings:		22		
	Survey date: WEDNESDAY		01/07/15		Survey Type: MANUAL
6	NT-03-D-02	BLOCK OF FLATS			NOTTINGHAMSHIRE
	WATCOMBE ROAD				
	NOTTINGHAM				
	CARRINGTON				
	Suburban Area (PPS6 Out of Centre)				
	Residential Zone				
	Total No of Dwellings:		22		
	Survey date: TUESDAY		23/06/15		Survey Type: MANUAL
7	WY-03-D-04	BLOCK OF FLATS			WEST YORKSHIRE
	BELLE VUE ROAD				
	LEEDS				
	Edge of Town Centre				
	Residential Zone				
	Total No of Dwellings:		15		
	Survey date: MONDAY		19/10/15		Survey Type: MANUAL

This section provides a list of all survey sites and days in the selected set. For each individual survey site, it displays a unique site reference code and site address, the selected trip rate calculation parameter and its value, the day of the week and date of each survey, and whether the survey was a manual classified count or an ATC count.

TRIP RATE for Land Use 03 - RESIDENTIAL/D - AFFORDABLE/LOCAL AUTHORITY FLATS

TOTAL VEHICLES

Calculation factor: 1 DWELLS

BOLD print indicates peak (busiest) period

Time Range	ARRIVALS			DEPARTURES			TOTALS		
	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate
00:00 - 01:00									
01:00 - 02:00									
02:00 - 03:00									
03:00 - 04:00									
04:00 - 05:00									
05:00 - 06:00									
06:00 - 07:00									
07:00 - 08:00	7	39	0.055	7	39	0.077	7	39	0.132
08:00 - 09:00	7	39	0.103	7	39	0.150	7	39	0.253
09:00 - 10:00	7	39	0.095	7	39	0.132	7	39	0.227
10:00 - 11:00	7	39	0.103	7	39	0.132	7	39	0.235
11:00 - 12:00	7	39	0.103	7	39	0.114	7	39	0.217
12:00 - 13:00	7	39	0.099	7	39	0.088	7	39	0.187
13:00 - 14:00	7	39	0.121	7	39	0.106	7	39	0.227
14:00 - 15:00	7	39	0.121	7	39	0.154	7	39	0.275
15:00 - 16:00	7	39	0.150	7	39	0.121	7	39	0.271
16:00 - 17:00	7	39	0.190	7	39	0.106	7	39	0.296
17:00 - 18:00	7	39	0.125	7	39	0.128	7	39	0.253
18:00 - 19:00	7	39	0.092	7	39	0.084	7	39	0.176
19:00 - 20:00									
20:00 - 21:00									
21:00 - 22:00									
22:00 - 23:00									
23:00 - 24:00									
Total Rates:			1.357			1.392			2.749

This section displays the trip rate results based on the selected set of surveys and the selected count type (shown just above the table). It is split by three main columns, representing arrivals trips, departures trips, and total trips (arrivals plus departures). Within each of these main columns are three sub-columns. These display the number of survey days where count data is included (per time period), the average value of the selected trip rate calculation parameter (per time period), and the trip rate result (per time period). Total trip rates (the sum of the column) are also displayed at the foot of the table.

To obtain a trip rate, the average (mean) trip rate parameter value (TRP) is first calculated for all selected survey days that have count data available for the stated time period. The average (mean) number of arrivals, departures or totals (whichever applies) is also calculated (COUNT) for all selected survey days that have count data available for the stated time period. Then, the average count is divided by the average trip rate parameter value, and multiplied by the stated calculation factor (shown just above the table and abbreviated here as FACT). So, the method is: $COUNT/TRP*FACT$. Trip rates are then rounded to 3 decimal places.

The survey data, graphs and all associated supporting information, contained within the TRICS Database are published by TRICS Consortium Limited ("the Company") and the Company claims copyright and database rights in this published work. The Company authorises those who possess a current TRICS licence to access the TRICS Database and copy the data contained within the TRICS Database for the licence holders' use only. Any resulting copy must retain all copyrights and other proprietary notices, and any disclaimer contained thereon.

The Company accepts no responsibility for loss which may arise from reliance on data contained in the TRICS Database. [No warranty of any kind, express or implied, is made as to the data contained in the TRICS Database.]

Parameter summary

Trip rate parameter range selected:	15 - 103 (units:)
Survey date range:	01/01/12 - 28/06/19
Number of weekdays (Monday-Friday):	7
Number of Saturdays:	0
Number of Sundays:	0
Surveys automatically removed from selection:	0
Surveys manually removed from selection:	0

This section displays a quick summary of some of the data filtering selections made by the TRICS® user. The trip rate calculation parameter range of all selected surveys is displayed first, followed by the range of minimum and maximum survey dates selected by the user. Then, the total number of selected weekdays and weekend days in the selected set of surveys are shown. Finally, the number of survey days that have been manually removed from the selected set outside of the standard filtering procedure are displayed.

Calculation Reference: AUDIT-640801-201028-1005

TRIP RATE CALCULATION SELECTION PARAMETERS:

Land Use : 03 - RESIDENTIAL
 Category : C - FLATS PRIVATELY OWNED
TOTAL VEHICLES

Selected regions and areas:

02	SOUTH EAST	
	HC HAMPSHIRE	1 days
	HF HERTFORDSHIRE	1 days
06	WEST MIDLANDS	
	WM WEST MIDLANDS	1 days
10	WALES	
	CO CONWY	1 days
11	SCOTLAND	
	SA SOUTH AYRSHIRE	1 days

This section displays the number of survey days per TRICS® sub-region in the selected set

Primary Filtering selection:

This data displays the chosen trip rate parameter and its selected range. Only sites that fall within the parameter range are included in the trip rate calculation.

Parameter: No of Dwellings
 Actual Range: 37 to 91 (units:)
 Range Selected by User: 6 to 215 (units:)

Parking Spaces Range: All Surveys Included

Parking Spaces per Dwelling Range: All Surveys Included

Bedrooms per Dwelling Range: All Surveys Included

Percentage of dwellings privately owned: All Surveys Included

Public Transport Provision:

Selection by: Include all surveys

Date Range: 01/01/12 to 18/11/19

This data displays the range of survey dates selected. Only surveys that were conducted within this date range are included in the trip rate calculation.

Selected survey days:

Monday	1 days
Tuesday	2 days
Thursday	1 days
Friday	1 days

This data displays the number of selected surveys by day of the week.

Selected survey types:

Manual count	5 days
Directional ATC Count	0 days

This data displays the number of manual classified surveys and the number of unclassified ATC surveys, the total adding up to the overall number of surveys in the selected set. Manual surveys are undertaken using staff, whilst ATC surveys are undertaken using machines.

Selected Locations:

Edge of Town Centre	5

This data displays the number of surveys per main location category within the selected set. The main location categories consist of Free Standing, Edge of Town, Suburban Area, Neighbourhood Centre, Edge of Town Centre, Town Centre and Not Known.

Selected Location Sub Categories:

Residential Zone	2
Built-Up Zone	3

This data displays the number of surveys per location sub-category within the selected set. The location sub-categories consist of Commercial Zone, Industrial Zone, Development Zone, Residential Zone, Retail Zone, Built-Up Zone, Village, Out of Town, High Street and No Sub Category.

Secondary Filtering selection:

Use Class:

C3

5 days

This data displays the number of surveys per Use Class classification within the selected set. The Use Classes Order 2005 has been used for this purpose, which can be found within the Library module of TRICS®.

Population within 500m Range:

All Surveys Included

Population within 1 mile:

10,001 to 15,000

2 days

25,001 to 50,000

3 days

This data displays the number of selected surveys within stated 1-mile radii of population.

Population within 5 miles:

50,001 to 75,000

2 days

250,001 to 500,000

3 days

This data displays the number of selected surveys within stated 5-mile radii of population.

Car ownership within 5 miles:

0.6 to 1.0

5 days

This data displays the number of selected surveys within stated ranges of average cars owned per residential dwelling, within a radius of 5-miles of selected survey sites.

Travel Plan:

Yes

2 days

No

3 days

This data displays the number of surveys within the selected set that were undertaken at sites with Travel Plans in place, and the number of surveys that were undertaken at sites without Travel Plans.

PTAL Rating:

No PTAL Present

5 days

This data displays the number of selected surveys with PTAL Ratings.

LIST OF SITES relevant to selection parameters

1	CO-03-C-01	BLOCKS OF FLATS	CONWY
	MOSTYN BROADWAY		
	LLANDUDNO		
	Edge of Town Centre		
	Built-Up Zone		
	Total No of Dwellings:	37	
	Survey date: MONDAY	26/03/18	Survey Type: MANUAL
2	HC-03-C-01	BLOCKS OF FLATS	HAMPSHIRE
	CROSS STREET		
	PORTSMOUTH		
	Edge of Town Centre		
	Built-Up Zone		
	Total No of Dwellings:	90	
	Survey date: TUESDAY	05/06/18	Survey Type: MANUAL
3	HF-03-C-03	BLOCK OF FLATS	HERTFORDSHIRE
	SHENLEY ROAD		
	BOREHAMWOOD		
	Edge of Town Centre		
	Built-Up Zone		
	Total No of Dwellings:	91	
	Survey date: THURSDAY	14/11/19	Survey Type: MANUAL
4	SA-03-C-01	BLOCK OF FLATS	SOUTH AYRSHIRE
	RACECOURSE ROAD		
	AYR		
	Edge of Town Centre		
	Residential Zone		
	Total No of Dwellings:	51	
	Survey date: TUESDAY	16/09/14	Survey Type: MANUAL
5	WM-03-C-04	BLOCKS OF FLATS	WEST MIDLANDS
	GILLQUART WAY		
	COVENTRY		
	PARKSIDE		
	Edge of Town Centre		
	Residential Zone		
	Total No of Dwellings:	55	
	Survey date: FRIDAY	11/11/16	Survey Type: MANUAL

This section provides a list of all survey sites and days in the selected set. For each individual survey site, it displays a unique site reference code and site address, the selected trip rate calculation parameter and its value, the day of the week and date of each survey, and whether the survey was a manual classified count or an ATC count.

TRIP RATE for Land Use 03 - RESIDENTIAL/C - FLATS PRIVATELY OWNED

TOTAL VEHICLES

Calculation factor: 1 DWELLS

BOLD print indicates peak (busiest) period

Time Range	ARRIVALS			DEPARTURES			TOTALS		
	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate	No. Days	Ave. DWELLS	Trip Rate
00:00 - 01:00									
01:00 - 02:00									
02:00 - 03:00									
03:00 - 04:00									
04:00 - 05:00									
05:00 - 06:00									
06:00 - 07:00									
07:00 - 08:00	5	65	0.034	5	65	0.102	5	65	0.136
08:00 - 09:00	5	65	0.040	5	65	0.194	5	65	0.234
09:00 - 10:00	5	65	0.062	5	65	0.086	5	65	0.148
10:00 - 11:00	5	65	0.077	5	65	0.068	5	65	0.145
11:00 - 12:00	5	65	0.083	5	65	0.120	5	65	0.203
12:00 - 13:00	5	65	0.111	5	65	0.108	5	65	0.219
13:00 - 14:00	5	65	0.074	5	65	0.080	5	65	0.154
14:00 - 15:00	5	65	0.065	5	65	0.090	5	65	0.155
15:00 - 16:00	5	65	0.114	5	65	0.071	5	65	0.185
16:00 - 17:00	5	65	0.136	5	65	0.080	5	65	0.216
17:00 - 18:00	5	65	0.142	5	65	0.080	5	65	0.222
18:00 - 19:00	5	65	0.157	5	65	0.093	5	65	0.250
19:00 - 20:00									
20:00 - 21:00									
21:00 - 22:00									
22:00 - 23:00									
23:00 - 24:00									
Total Rates:			1.095			1.172			2.267

This section displays the trip rate results based on the selected set of surveys and the selected count type (shown just above the table). It is split by three main columns, representing arrivals trips, departures trips, and total trips (arrivals plus departures). Within each of these main columns are three sub-columns. These display the number of survey days where count data is included (per time period), the average value of the selected trip rate calculation parameter (per time period), and the trip rate result (per time period). Total trip rates (the sum of the column) are also displayed at the foot of the table.

To obtain a trip rate, the average (mean) trip rate parameter value (TRP) is first calculated for all selected survey days that have count data available for the stated time period. The average (mean) number of arrivals, departures or totals (whichever applies) is also calculated (COUNT) for all selected survey days that have count data available for the stated time period. Then, the average count is divided by the average trip rate parameter value, and multiplied by the stated calculation factor (shown just above the table and abbreviated here as FACT). So, the method is: $COUNT/TRP*FACT$. Trip rates are then rounded to 3 decimal places.

The survey data, graphs and all associated supporting information, contained within the TRICS Database are published by TRICS Consortium Limited ("the Company") and the Company claims copyright and database rights in this published work. The Company authorises those who possess a current TRICS licence to access the TRICS Database and copy the data contained within the TRICS Database for the licence holders' use only. Any resulting copy must retain all copyrights and other proprietary notices, and any disclaimer contained thereon.

The Company accepts no responsibility for loss which may arise from reliance on data contained in the TRICS Database. [No warranty of any kind, express or implied, is made as to the data contained in the TRICS Database.]

Parameter summary

Trip rate parameter range selected: 37 - 91 (units:)
 Survey date range: 01/01/12 - 18/11/19
 Number of weekdays (Monday-Friday): 5
 Number of Saturdays: 0
 Number of Sundays: 0
 Surveys automatically removed from selection: 0
 Surveys manually removed from selection: 0

This section displays a quick summary of some of the data filtering selections made by the TRICS® user. The trip rate calculation parameter range of all selected surveys is displayed first, followed by the range of minimum and maximum survey dates selected by the user. Then, the total number of selected weekdays and weekend days in the selected set of surveys are shown. Finally, the number of survey days that have been manually removed from the selected set outside of the standard filtering procedure are displayed.



Appendix D

Gravity Model

Gravity Model

WU03EW - Location of usual residence and place of work by method of travel to work (MSOA level)

ONS Crown Copyright Reserved [from Nomis on 1 October 2020]

Population : All usual residents aged 16 and over in employment the week before the census

Units : Persons

Date : 2011

usual residence : E02001769 : South Tyneside 002 (2011 super output area - middle layer)

place of work : 2011 super output area - mid All categories: Method of travel to work (2001 specification)


	1970	Route from site
E02001769 : South Tyneside 002	463 24%	Commercial Rd N - B1344 N
E02001768 : South Tyneside 001	212 11%	Commercial Rd N - B1344 N
E02001779 : South Tyneside 012	135 7%	Commercial Rd S - Corstophine Town S - Temple Town S
E02001731 : Newcastle upon Tyne 024	124 6%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001774 : South Tyneside 007	122 6%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001778 : South Tyneside 011	116 6%	Commercial Rd S - Laygate E - A194 S - Hudson St S
E02001803 : Sunderland 013	59 3%	Commercial Rd S - Laygate E - A194 S - Westway E
E02001770 : South Tyneside 003	58 3%	Commercial Rd S - Laygate E - B1301 E
E02001772 : South Tyneside 005	53 3%	Commercial Rd S - Laygate E - B1301 E
E02001797 : Sunderland 007	43 2%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A19 S
E02001688 : Gateshead 007	40 2%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001776 : South Tyneside 009	40 2%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02006841 : Gateshead 027	34 2%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001777 : South Tyneside 010	31 2%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001752 : North Tyneside 015	29 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001788 : South Tyneside 021	26 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - B1302 S
E02001790 : South Tyneside 023	25 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - B1302 S
E02001796 : Sunderland 006	22 1%	Commercial Rd S - Laygate E - A194 S - Westway E
E02001756 : North Tyneside 019	20 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001819 : Sunderland 029	20 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A19 S
E02001782 : South Tyneside 015	19 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001684 : Gateshead 003	18 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001786 : South Tyneside 019	18 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - B1302 S
E02001807 : Sunderland 017	18 1%	Commercial Rd S - Laygate E - A194 S - Westway E - King George Rd S
E02001730 : Newcastle upon Tyne 023	17 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001781 : South Tyneside 014	16 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW
E02001798 : Sunderland 008	16 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001809 : Sunderland 019	16 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001799 : Sunderland 009	15 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001714 : Newcastle upon Tyne 007	14 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001787 : South Tyneside 020	14 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001789 : South Tyneside 022	14 1%	Commercial Rd S - Laygate E - A194 S - Westway E - King George Rd S
E02001795 : Sunderland 005	14 1%	Commercial Rd S - Laygate E - A194 S - Westway E
E02004326 : County Durham 034	13 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001733 : Newcastle upon Tyne 026	13 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
E02001773 : South Tyneside 006	13 1%	Commercial Rd S - Laygate E - B1301 E
E02001775 : South Tyneside 008	13 1%	Commercial Rd S - Laygate E - B1301 E
E02001800 : Sunderland 010	13 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001713 : Newcastle upon Tyne 006	12 1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
E02001771 : South Tyneside 004	12 1%	Commercial Rd S - Laygate E - B1301 E

34%	Commercial Rd N - B1344 N
24%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A185 W
8%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - Leam Ln SW
8%	Commercial Rd S - Laygate E - B1301 E
7%	Commercial Rd S - Corstophine Town S - Temple Town S
9%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - B1302 S
5%	Commercial Rd S - Laygate E - A194 S - Westway E
3%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW - A19 S
2%	Commercial Rd S - Laygate E - A194 S - Westway E - King George Rd S
1%	Commercial Rd S - Corstophine Town S - Temple Town S - A194 SW




Appendix E

Network Flow Diagrams

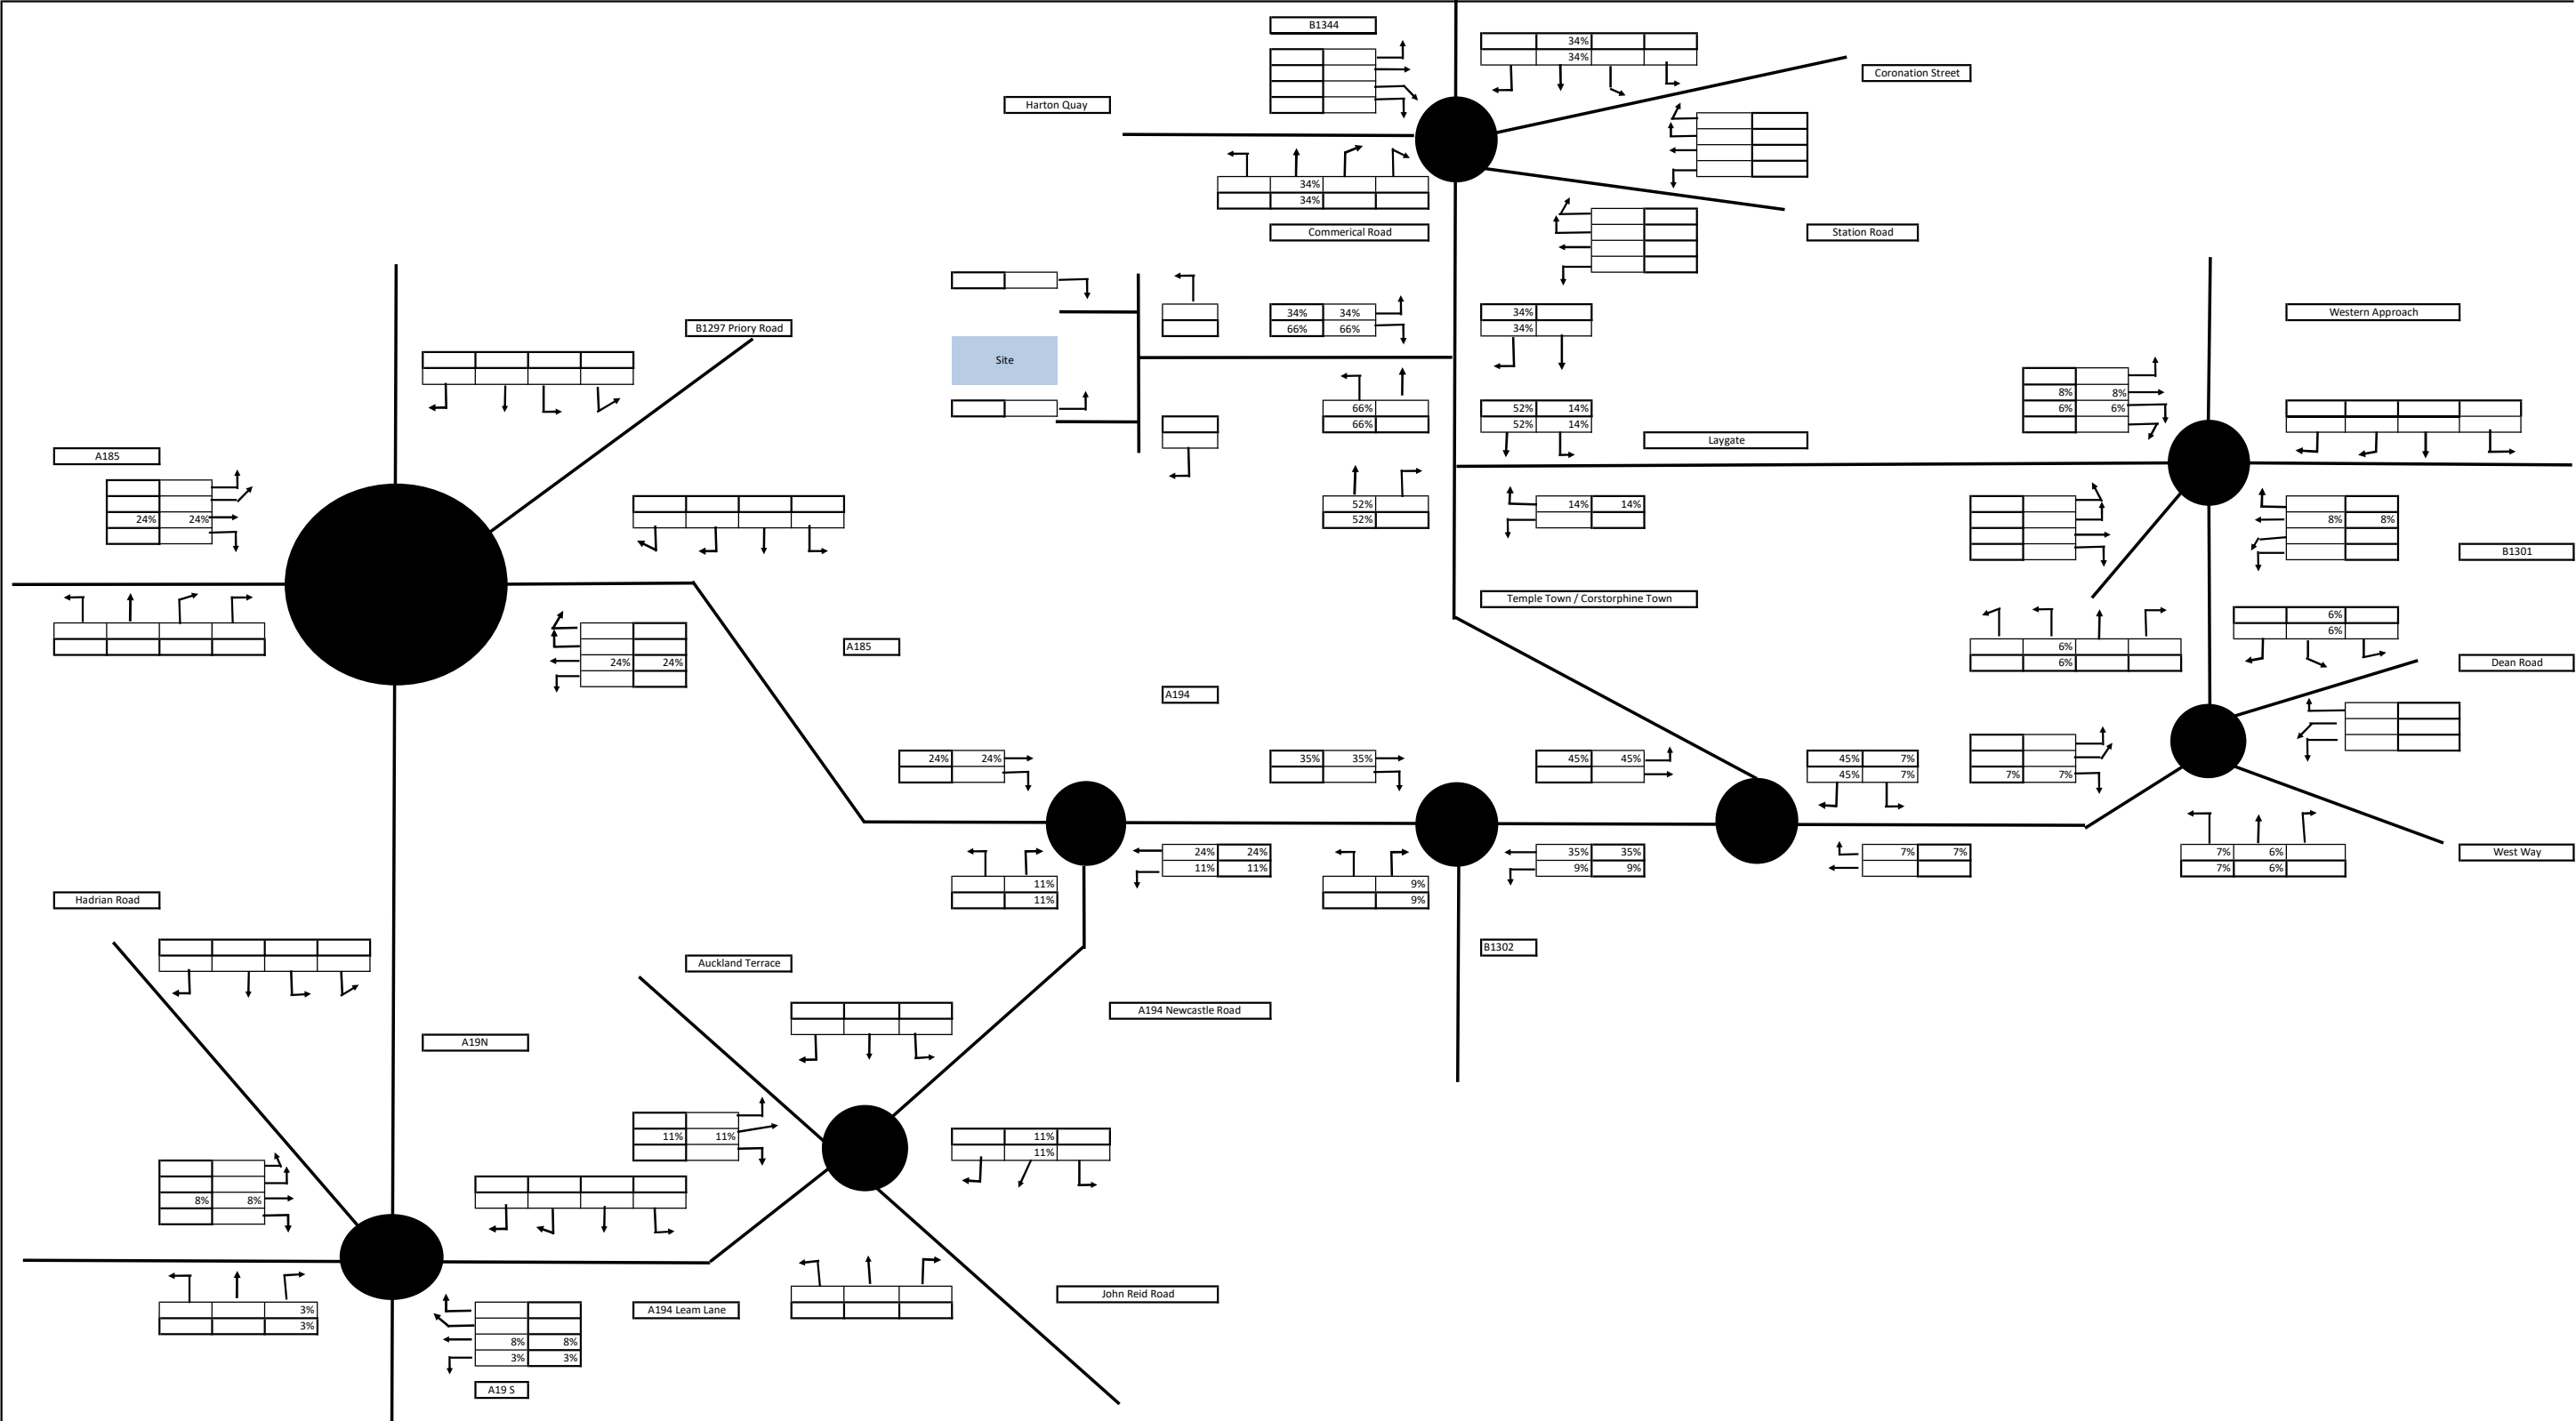

Client:	Project:	Title:			Number:	Revision:	Date	Feb-21	Checked	JM
Keepmoat Homes Ltd	Holborn Riverside	Gravity Model Distribution					Design	GH	Approved	GS

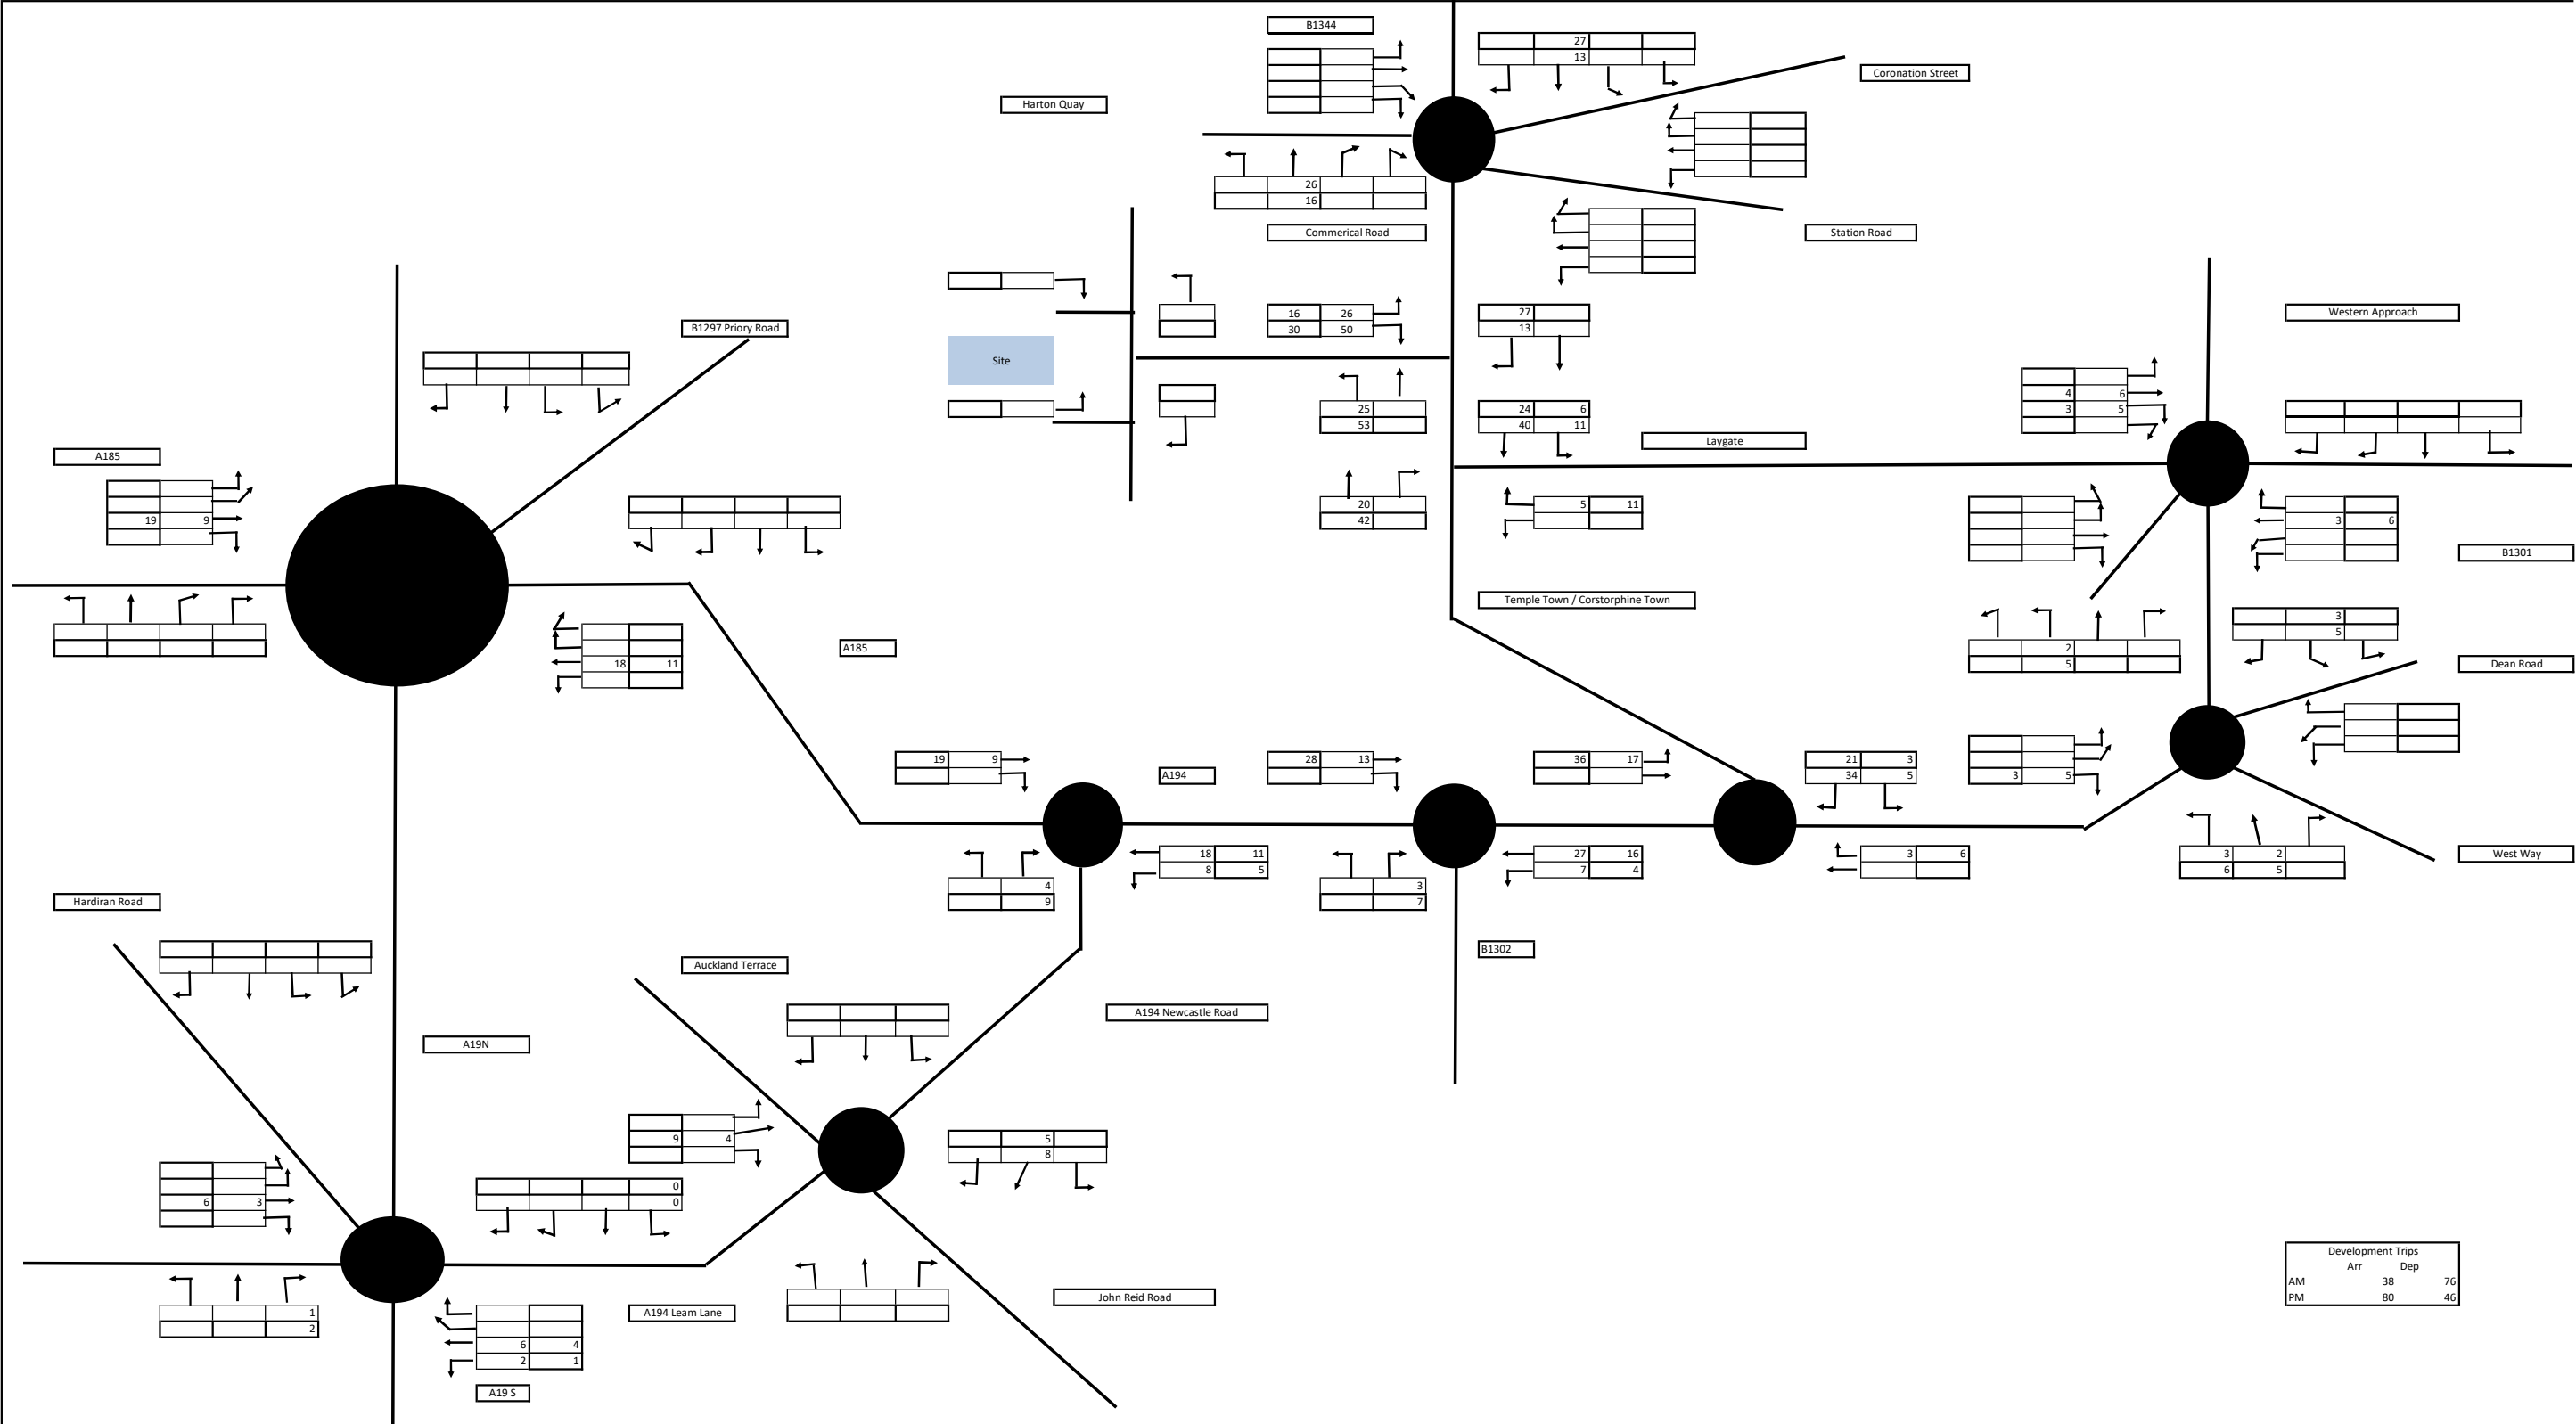

Development Trips			
	Arr	Dep	
AM	38	76	
PM	80	46	

Client: Keepmoat Homes Ltd	Project Holborn Riverside	Title: Development Trips		Number:	Revision:	Date	Feb-21	Checked	JM
						Design	GH	Approved	GS